
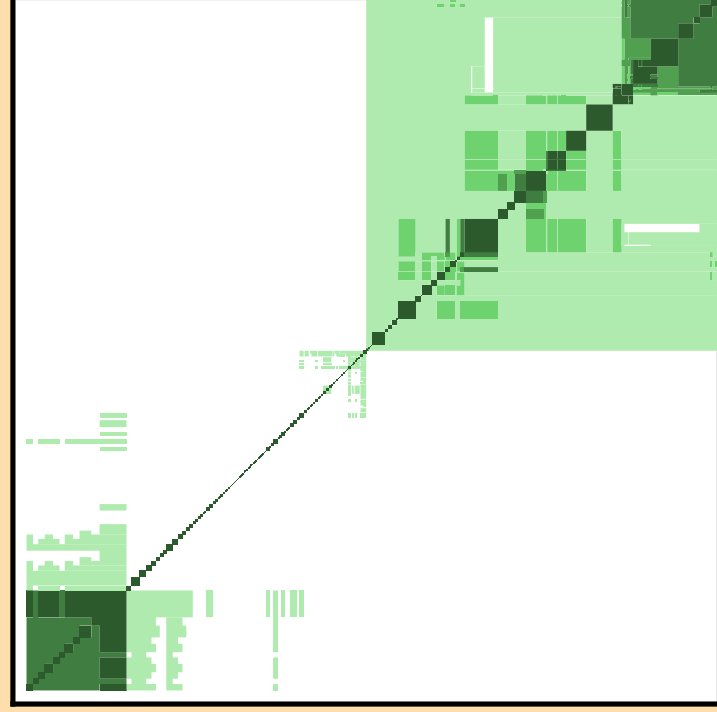



Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

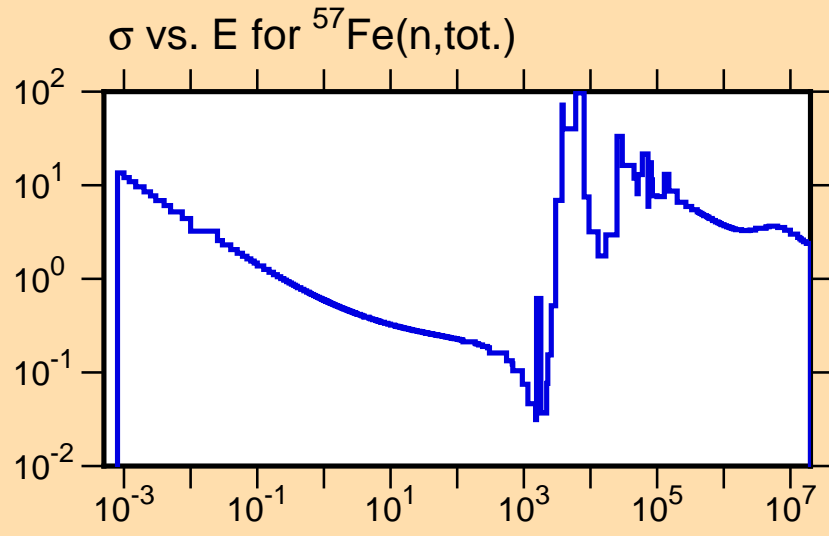

Correlation Matrix


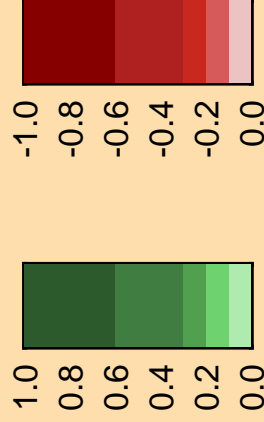


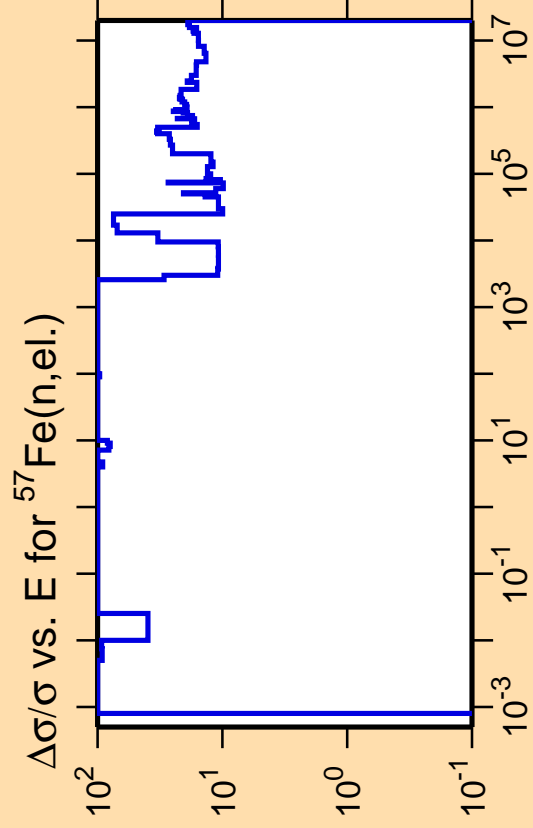

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.

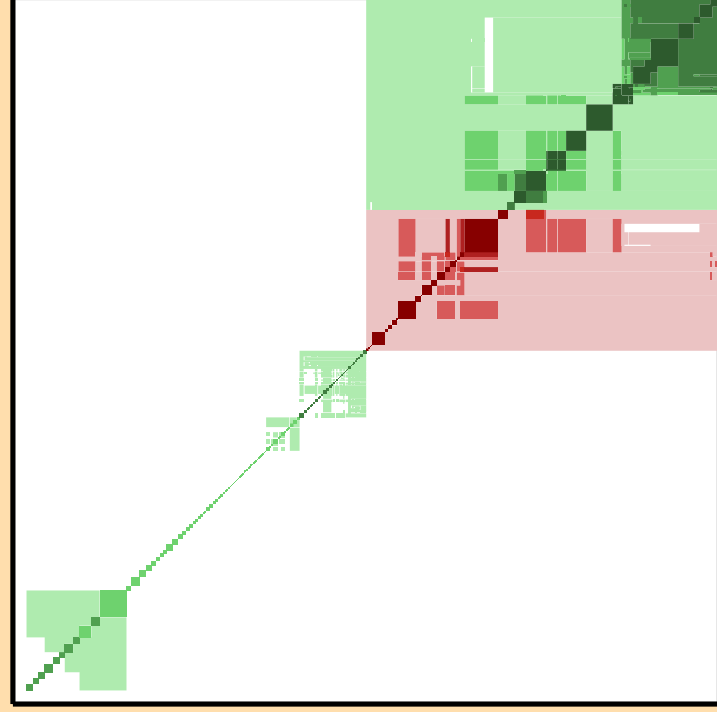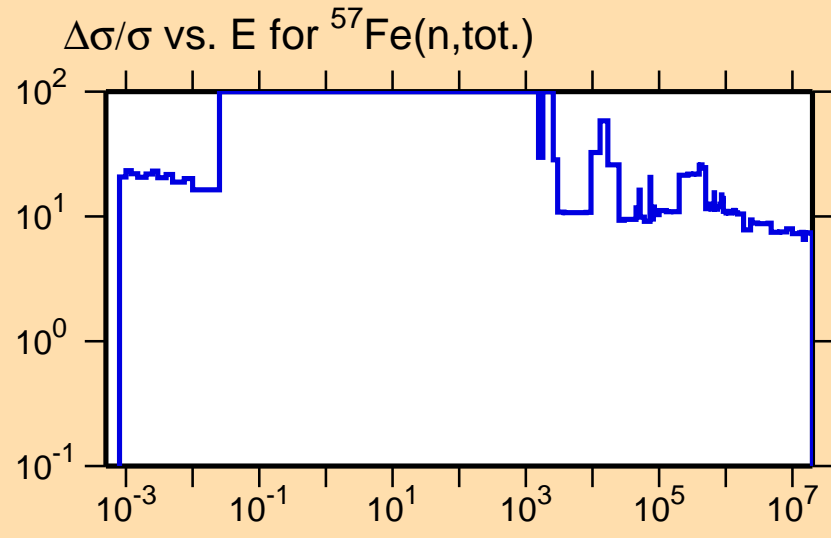

Correlation Matrix





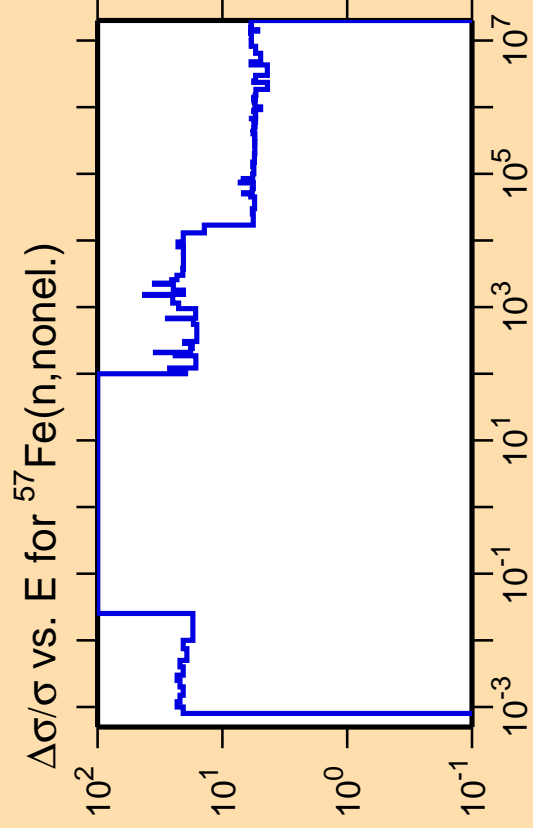

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.

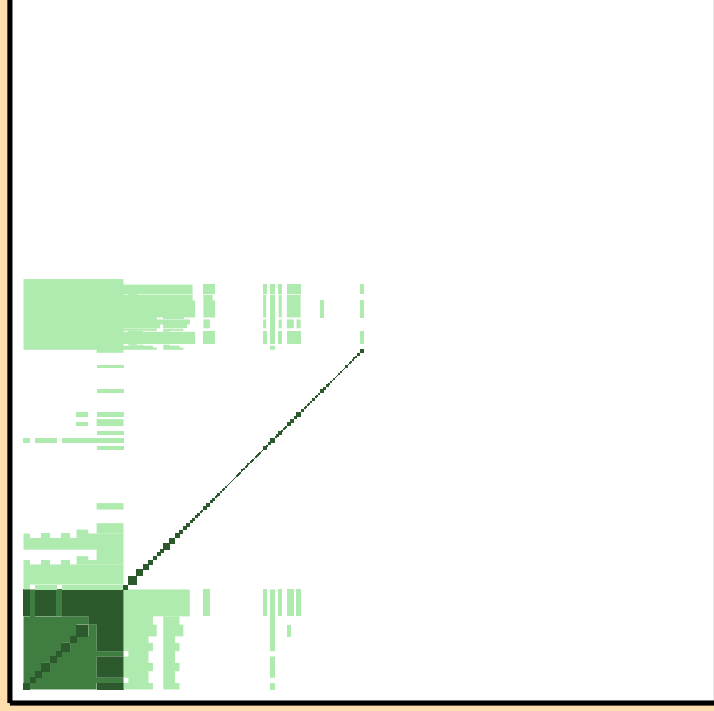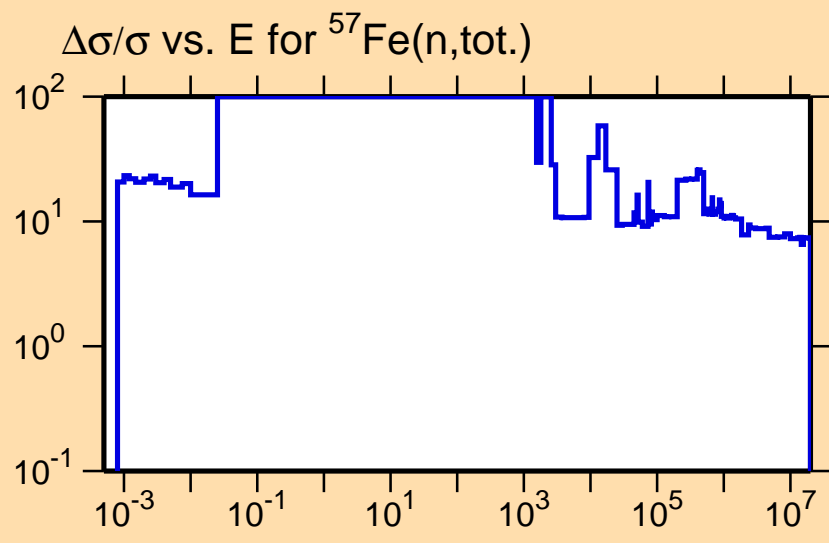

Correlation Matrix





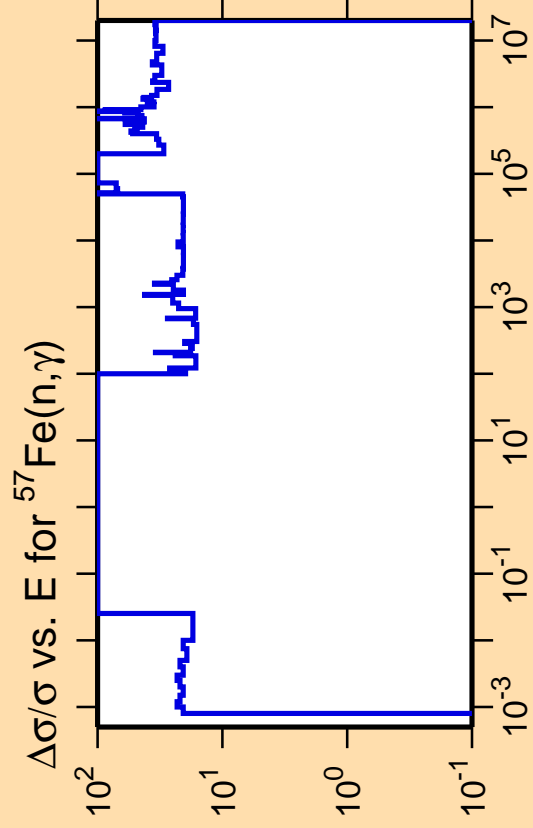

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.

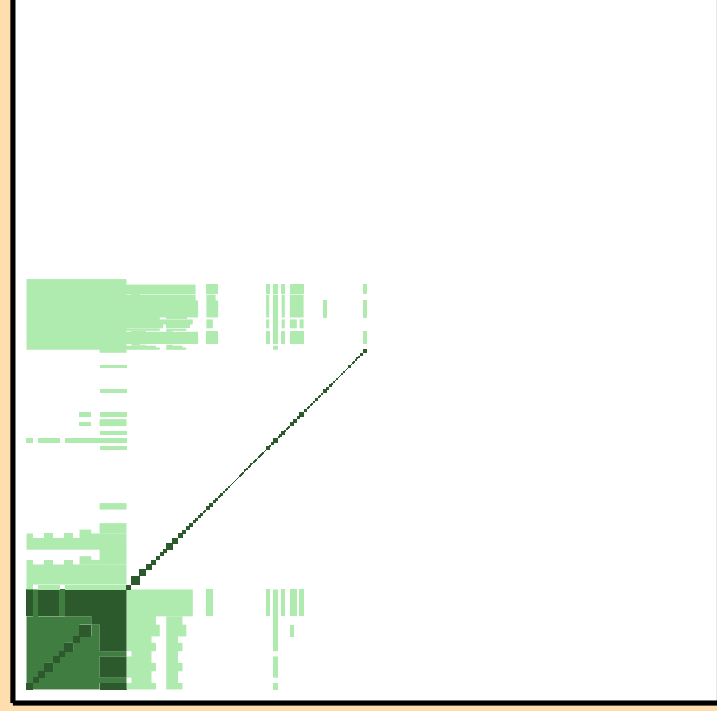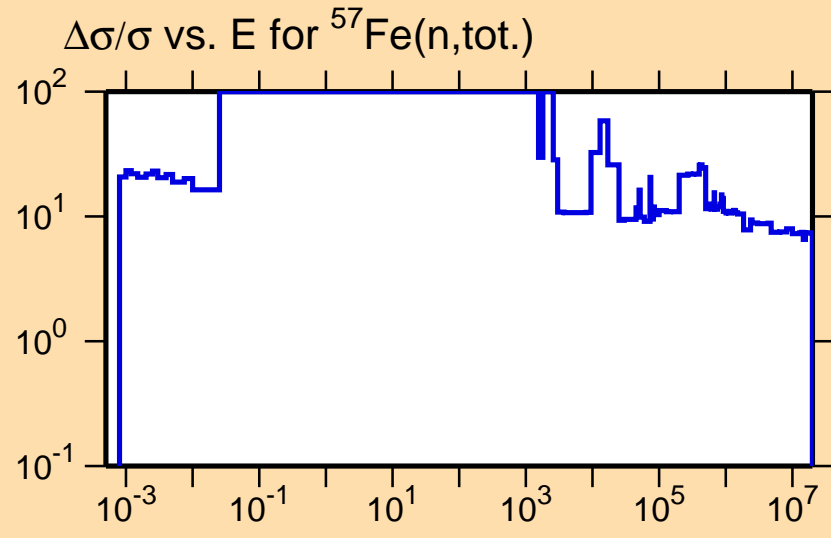

Correlation Matrix





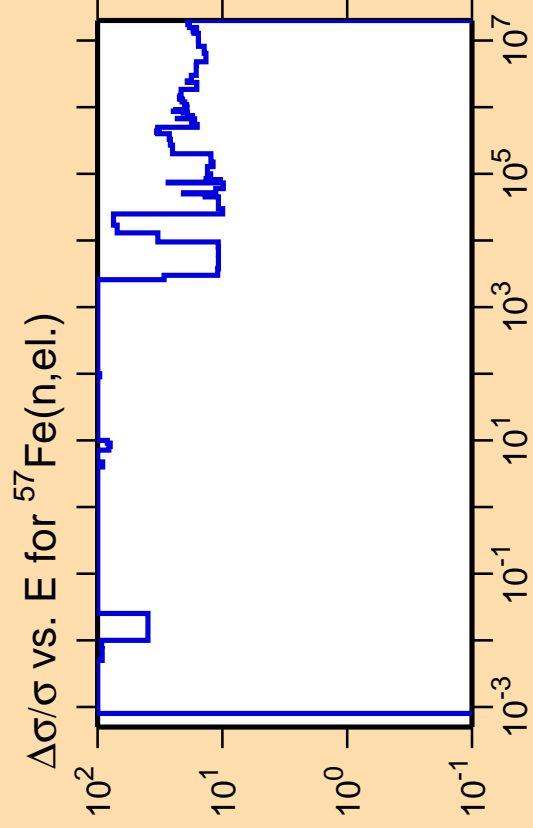

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

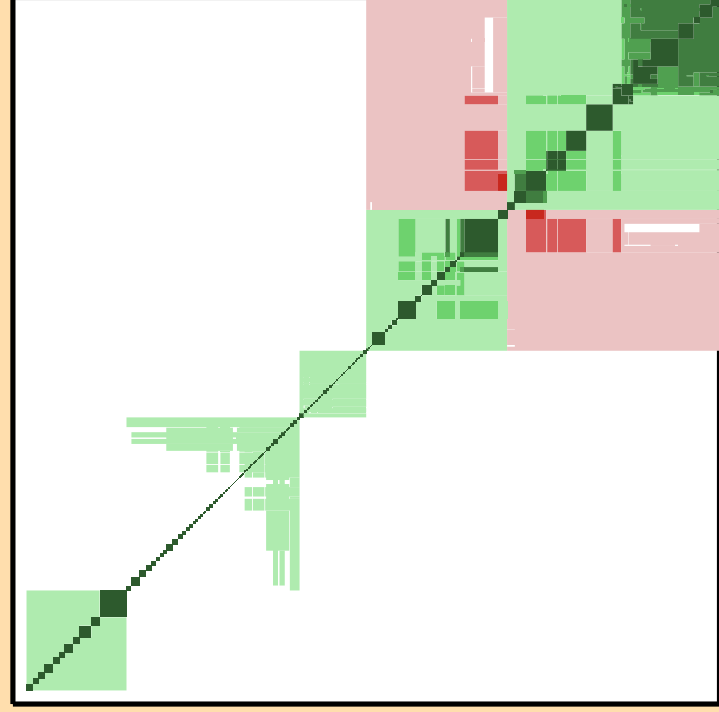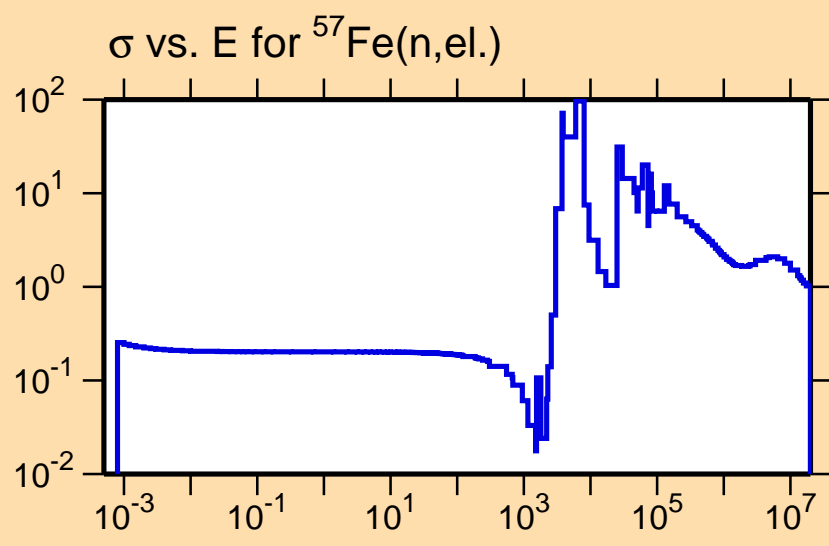

Correlation Matrix





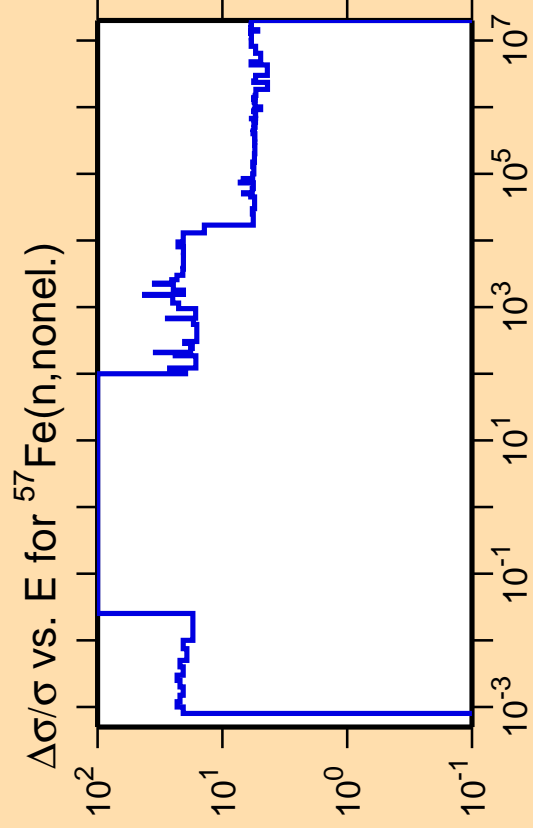


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.

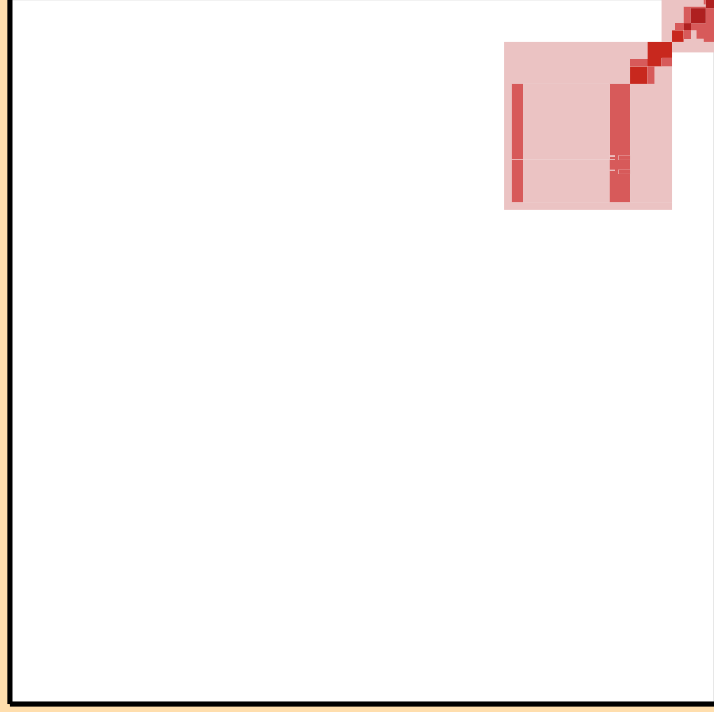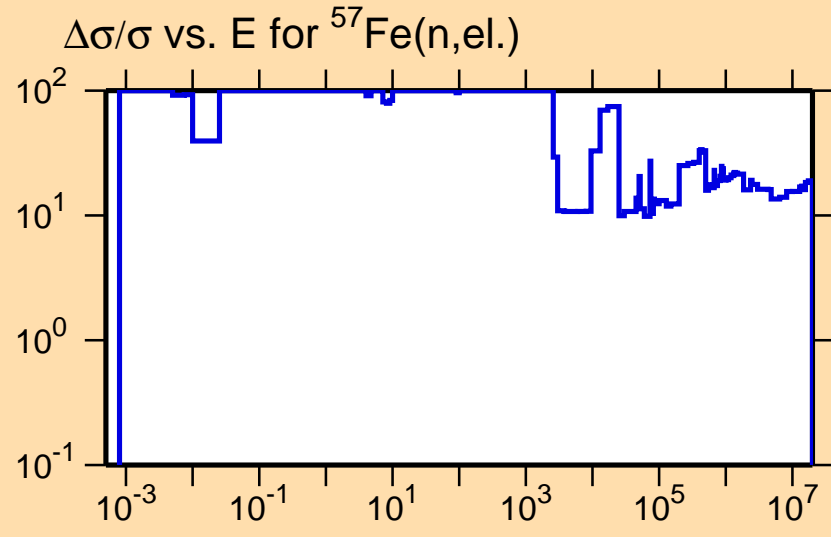

Correlation Matrix






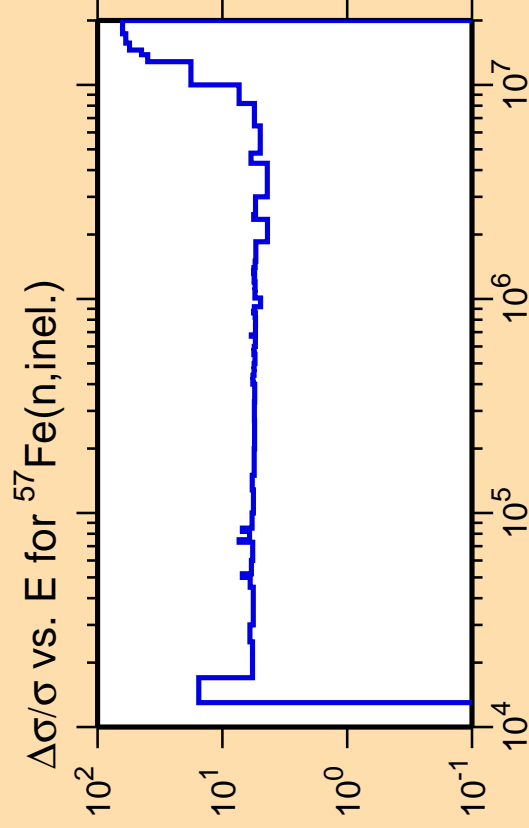


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.

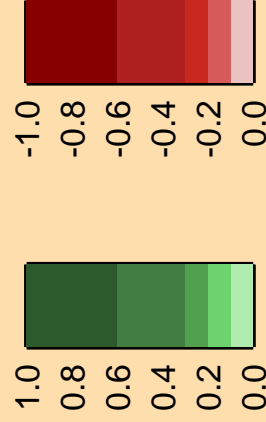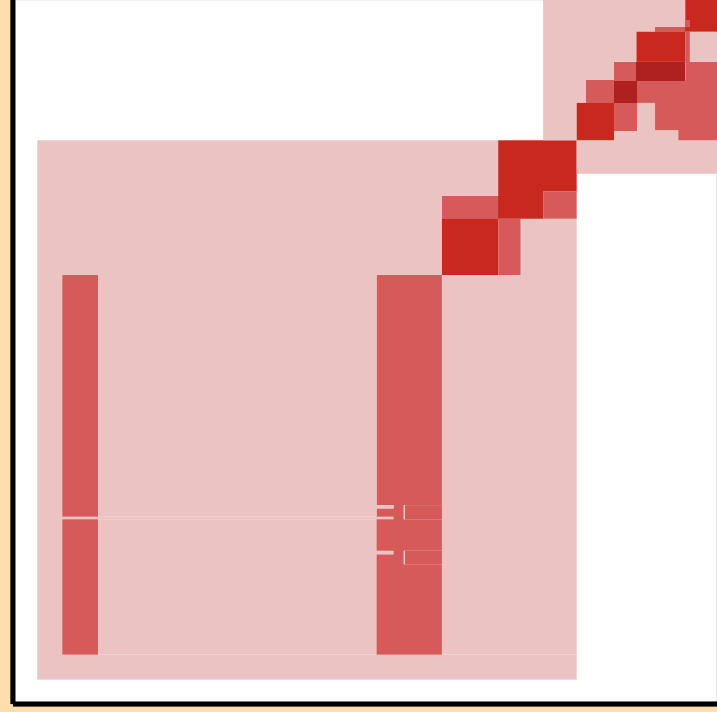
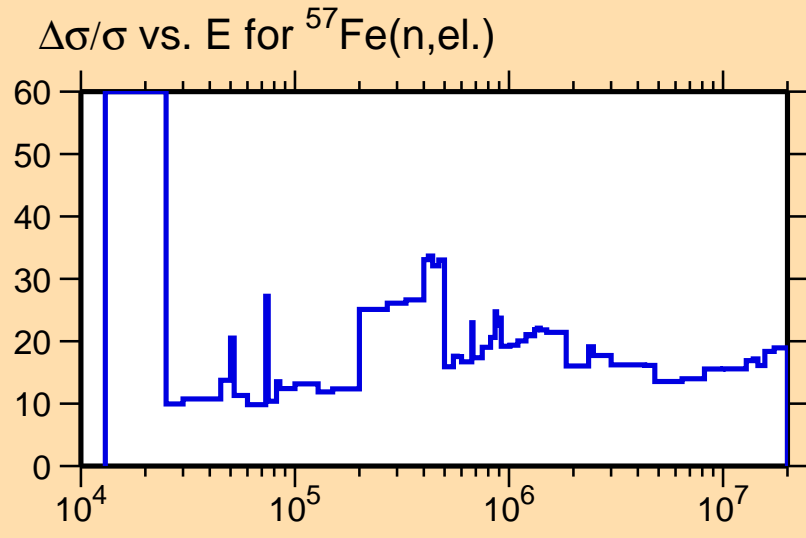


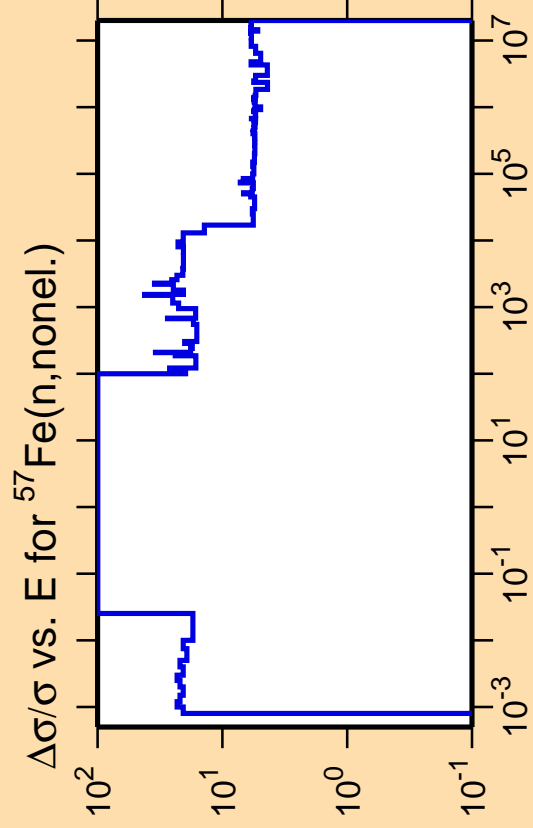

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

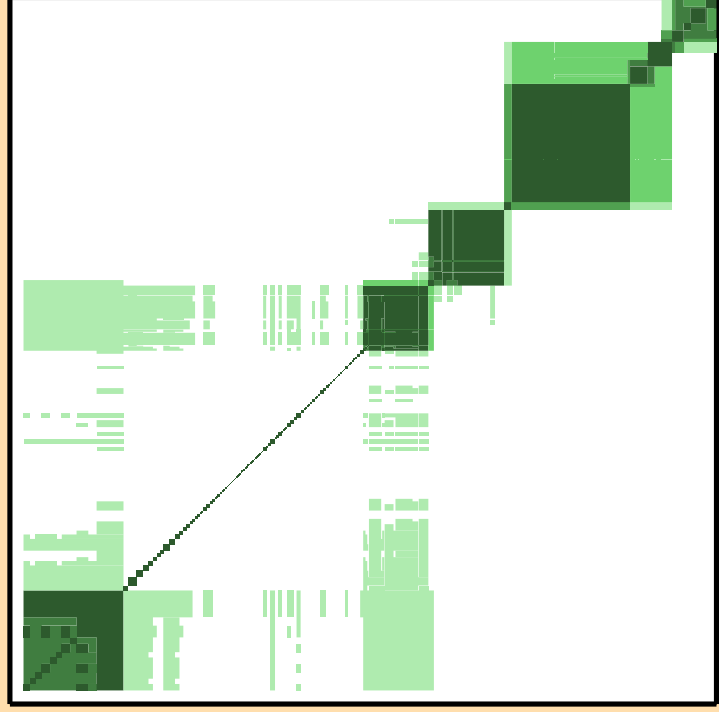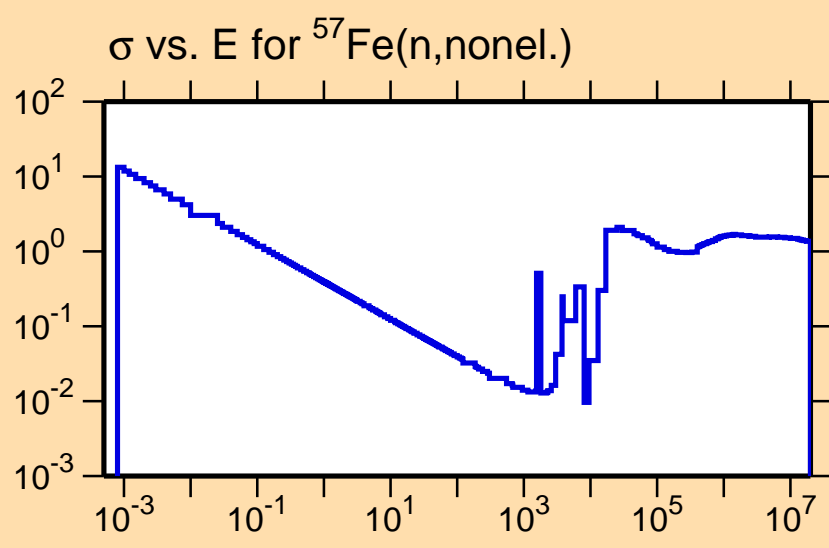

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{57}\text{Fe}(n,\text{inel.})$

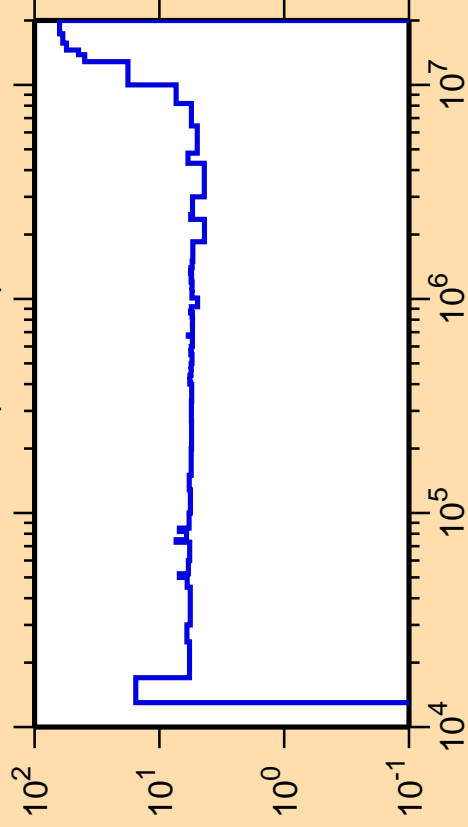


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{57}\text{Fe}(n,\text{nonel.})$

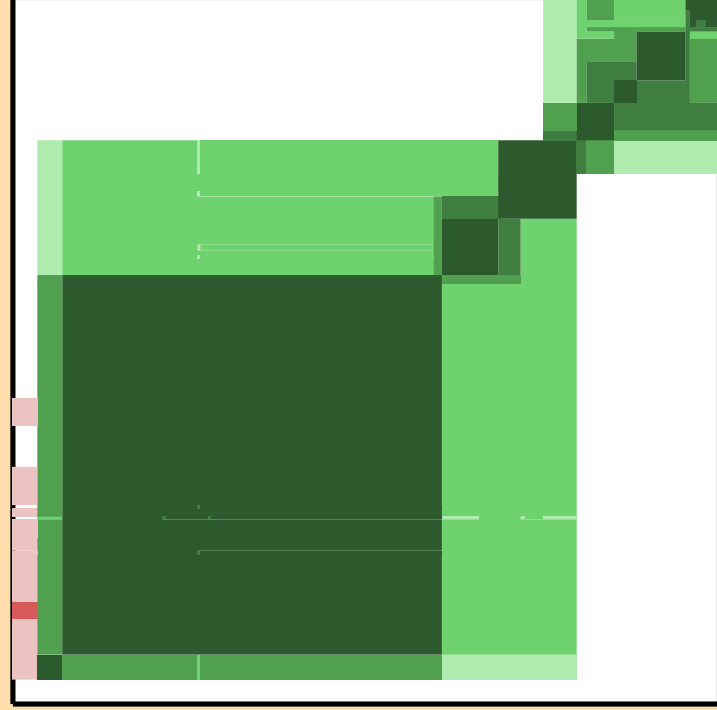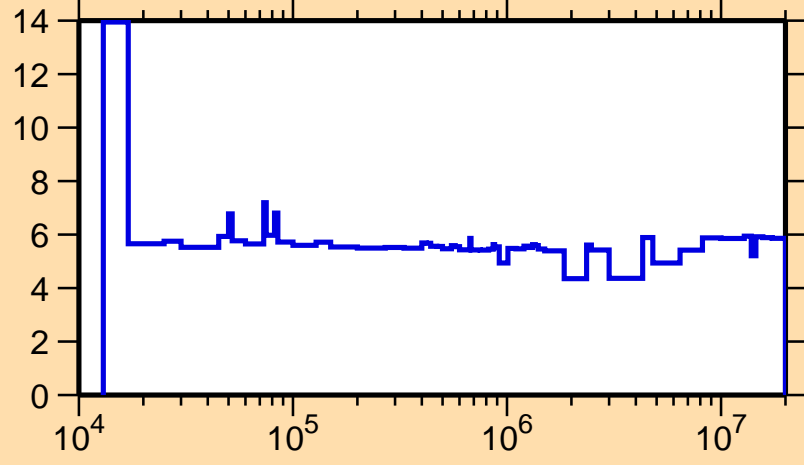

Correlation Matrix


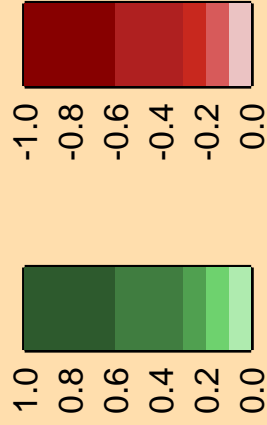


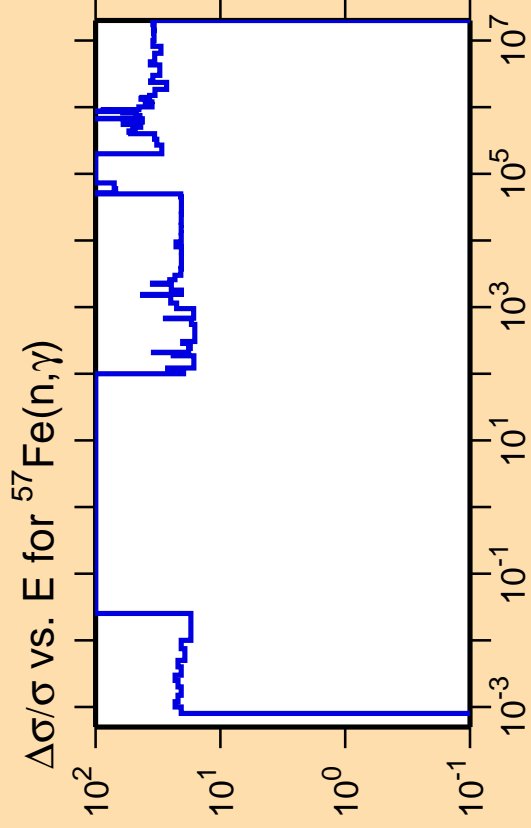

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

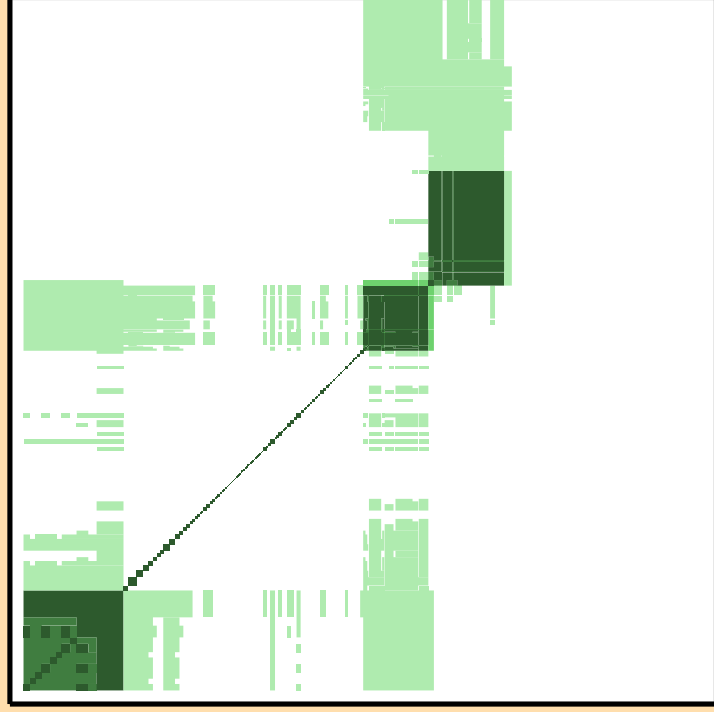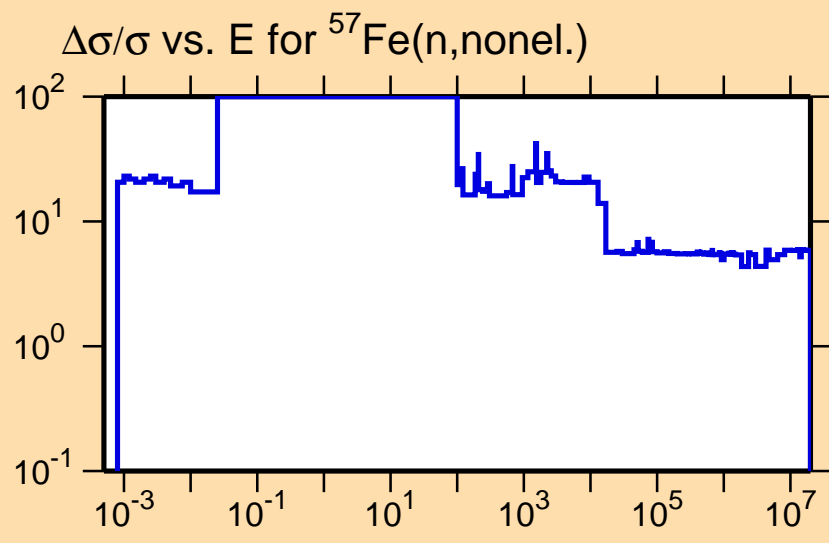

Correlation Matrix




$\Delta\sigma/\sigma$ vs. E for $^{57}\text{Fe}(n,\text{inel.})$

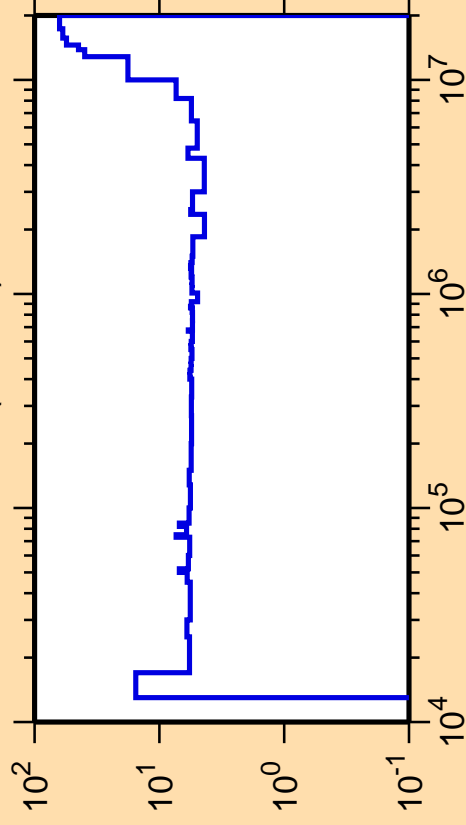


Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

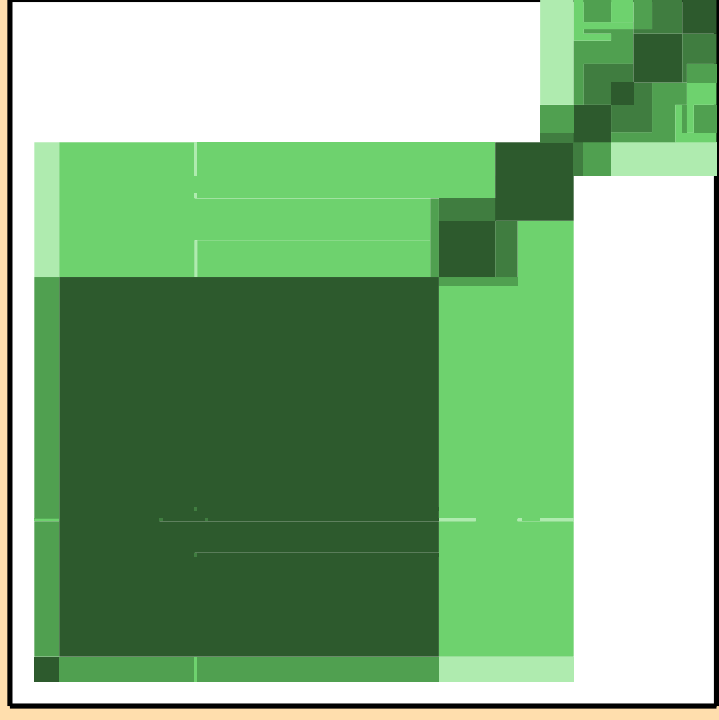


σ vs. E for $^{57}\text{Fe}(n,\text{inel.})$

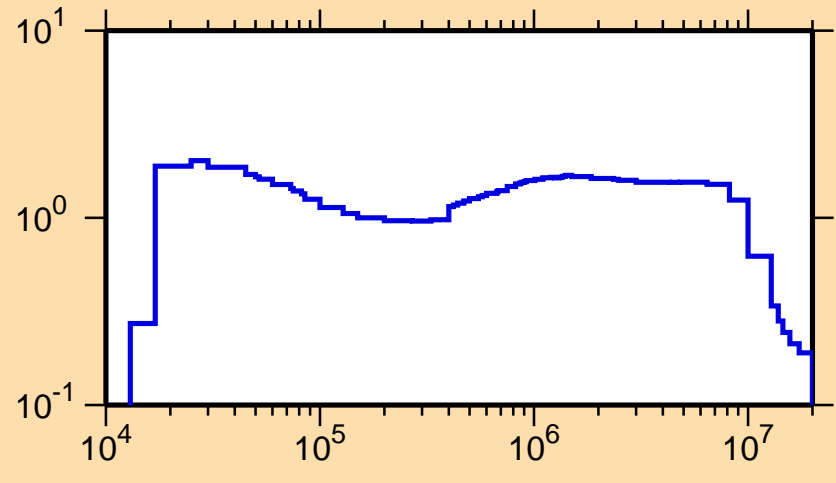

Correlation Matrix


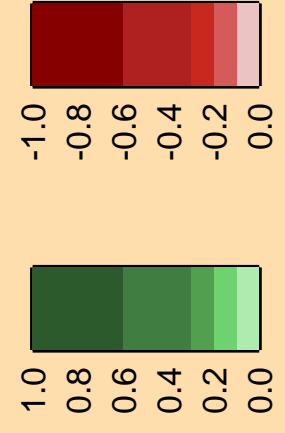


$\Delta\sigma/\sigma$ vs. E for $^{57}\text{Fe}(n,2n)$

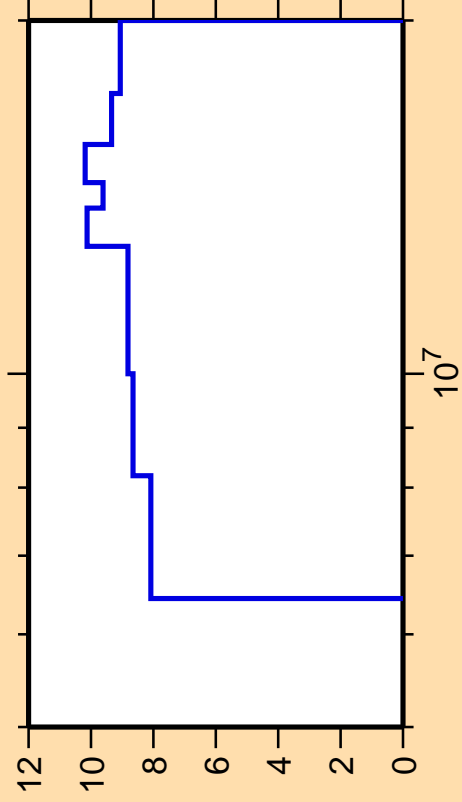

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

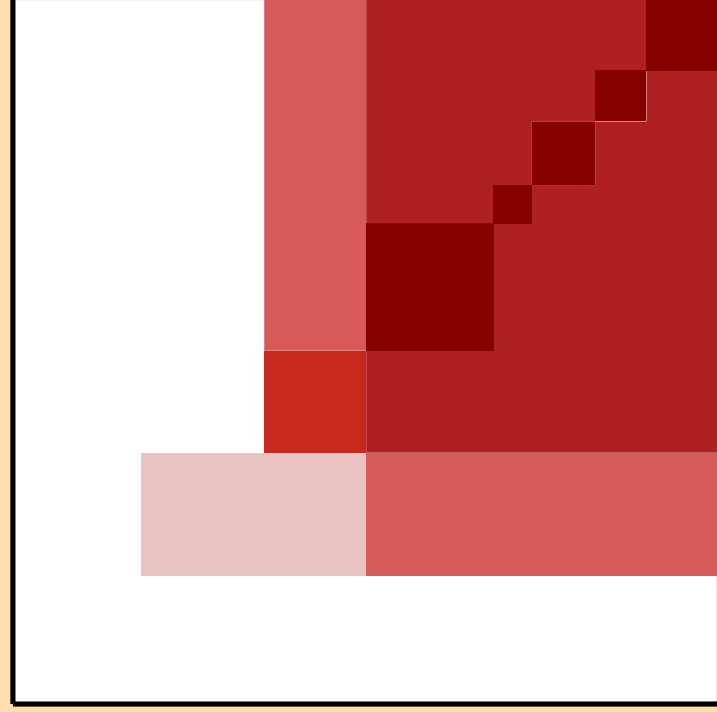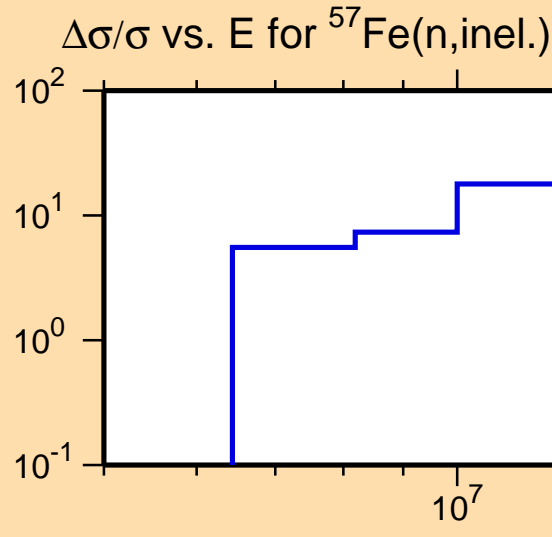

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{57}\text{Fe}(n,\alpha)$


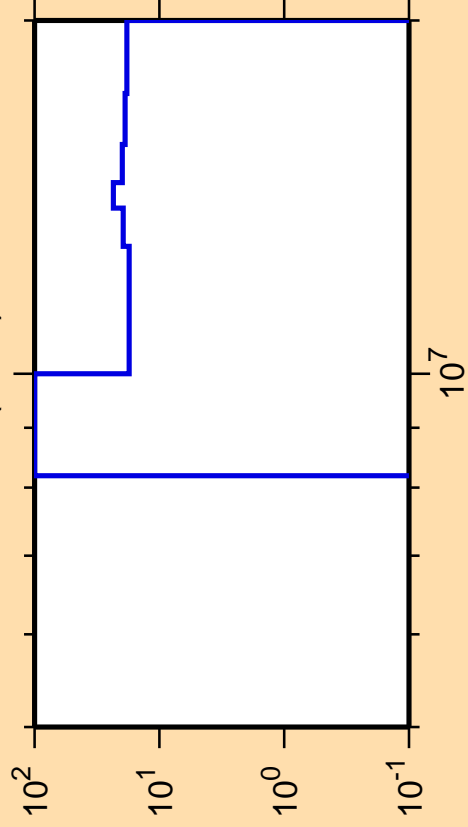


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.


$\Delta\sigma/\sigma$ vs. E for $^{57}\text{Fe}(n,\text{inel.})$

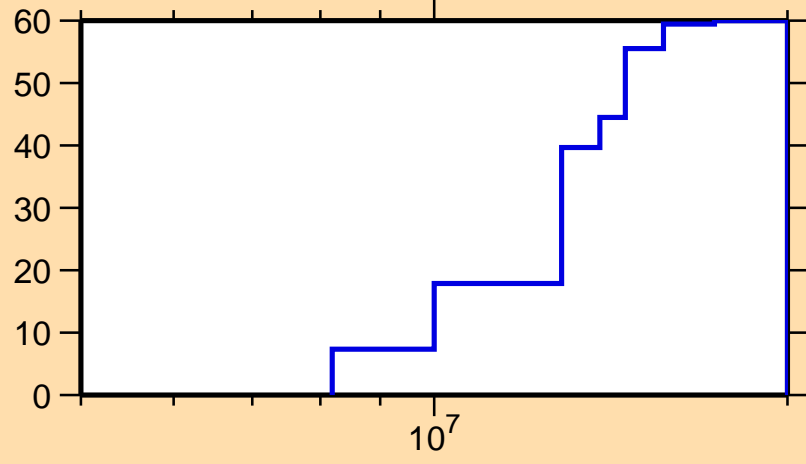

Correlation Matrix

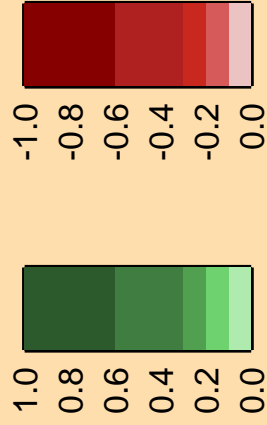

$\Delta\sigma/\sigma$ vs. E for $^{57}\text{Fe}(n,np)$


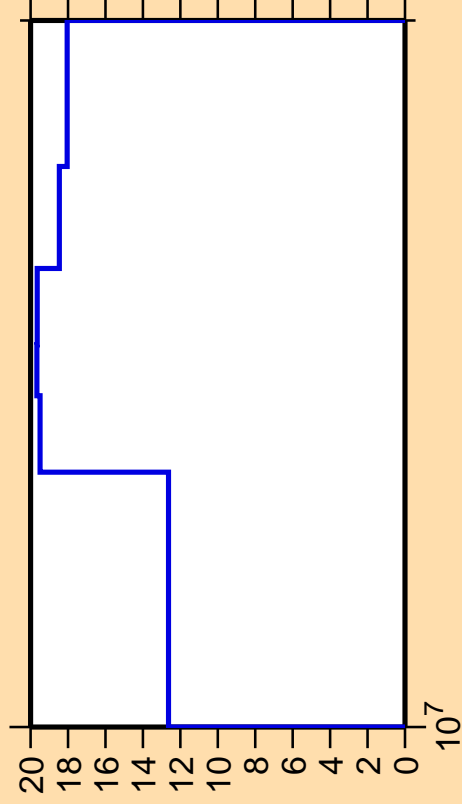


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).





Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{57}\text{Fe}(n,inel.)$

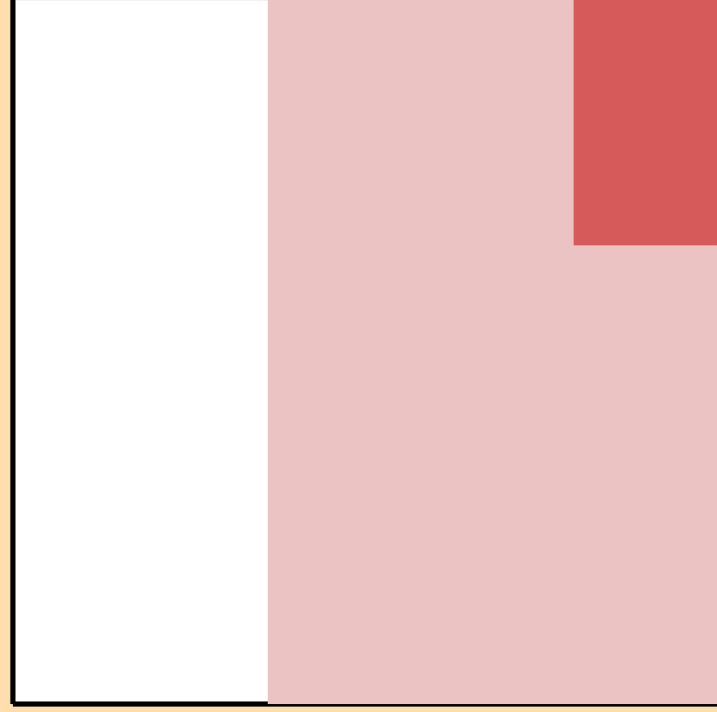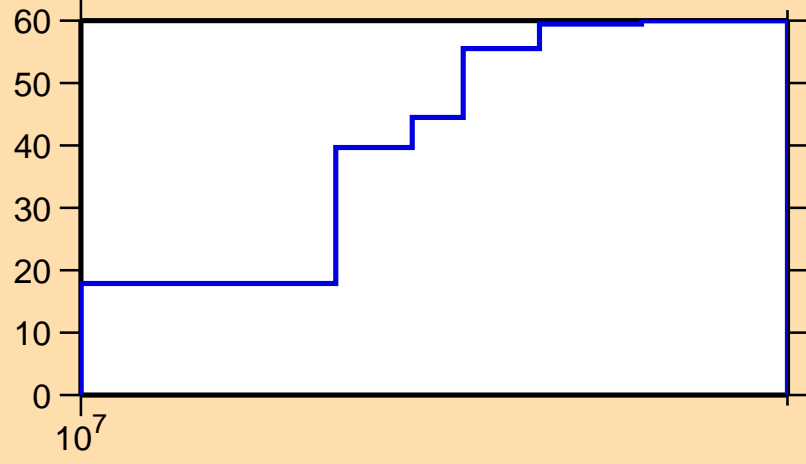


Correlation Matrix



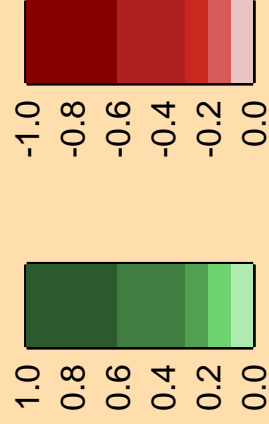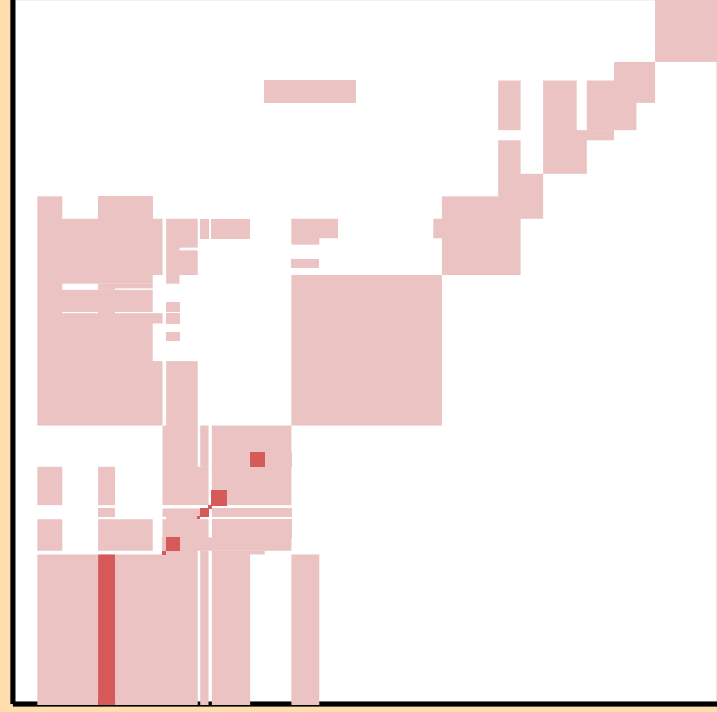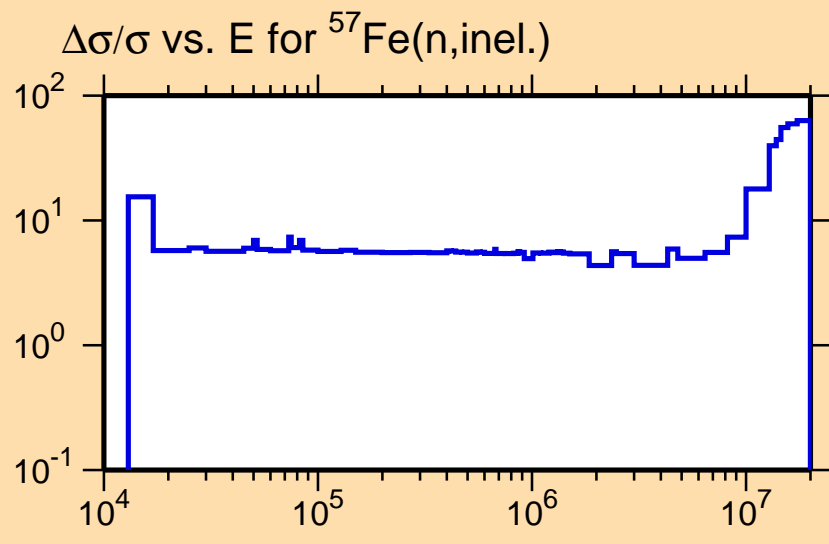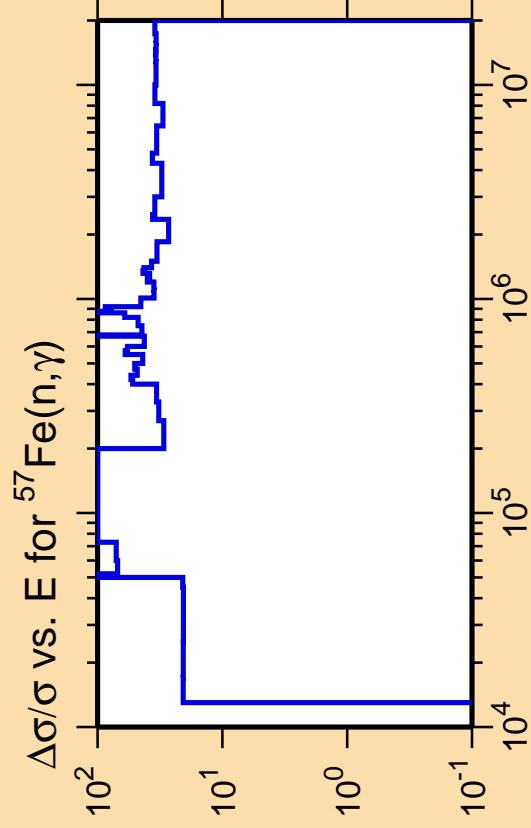

$\Delta\sigma/\sigma$ vs. E for $^{57}\text{Fe}(n,p)$


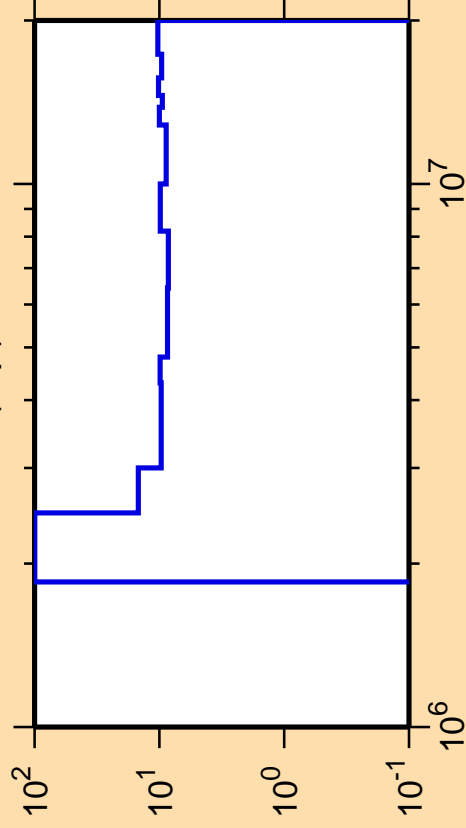


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

$\Delta\sigma/\sigma$ vs. E for $^{57}\text{Fe}(n,\text{inel.})$

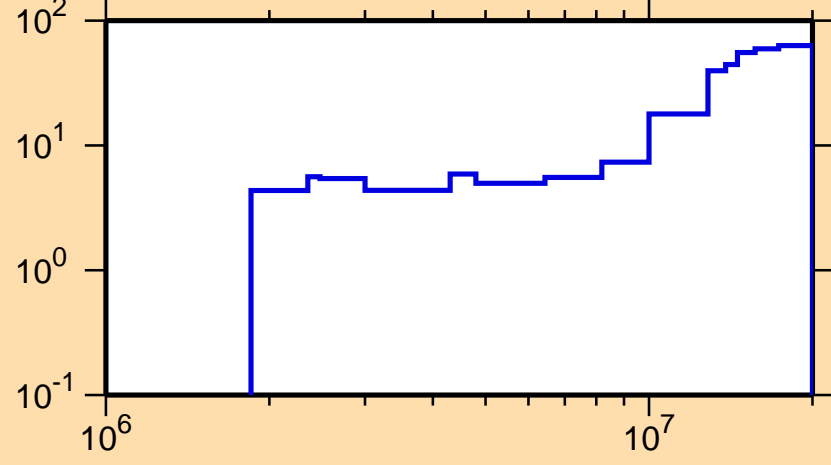

Correlation Matrix


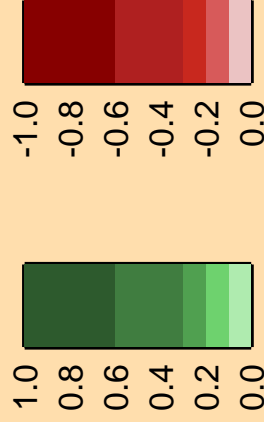


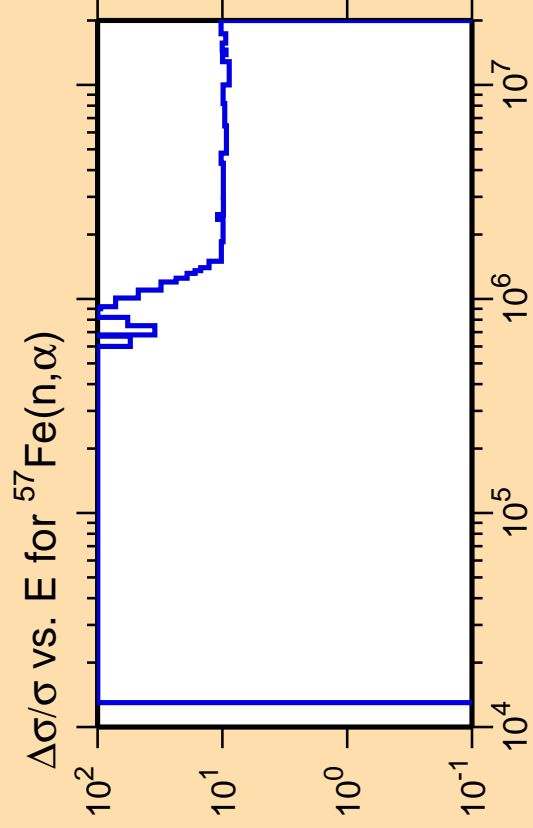

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

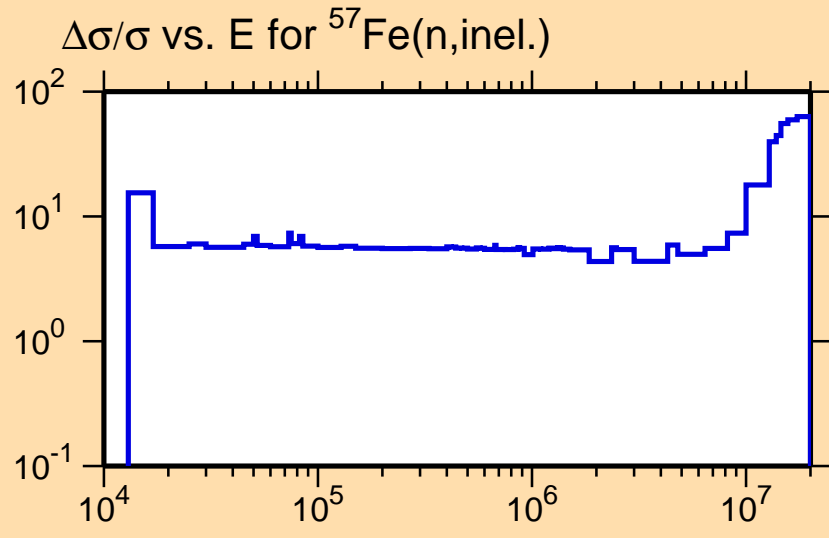

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{57}\text{Fe}(n,2n)$

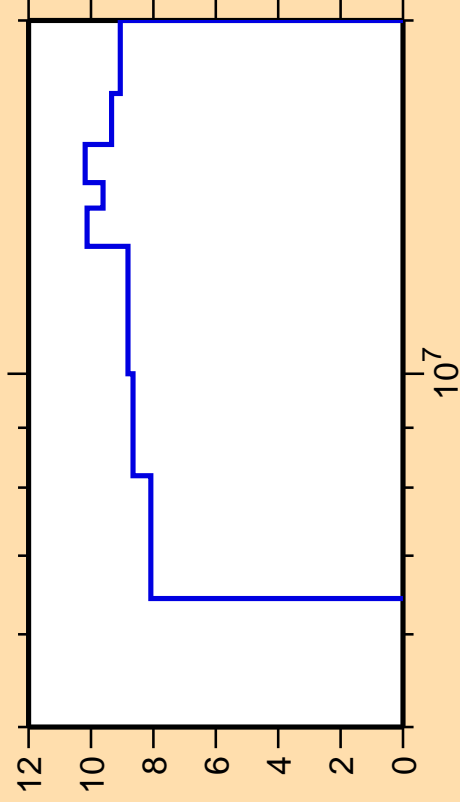


Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

σ vs. E for $^{57}\text{Fe}(n,2n)$

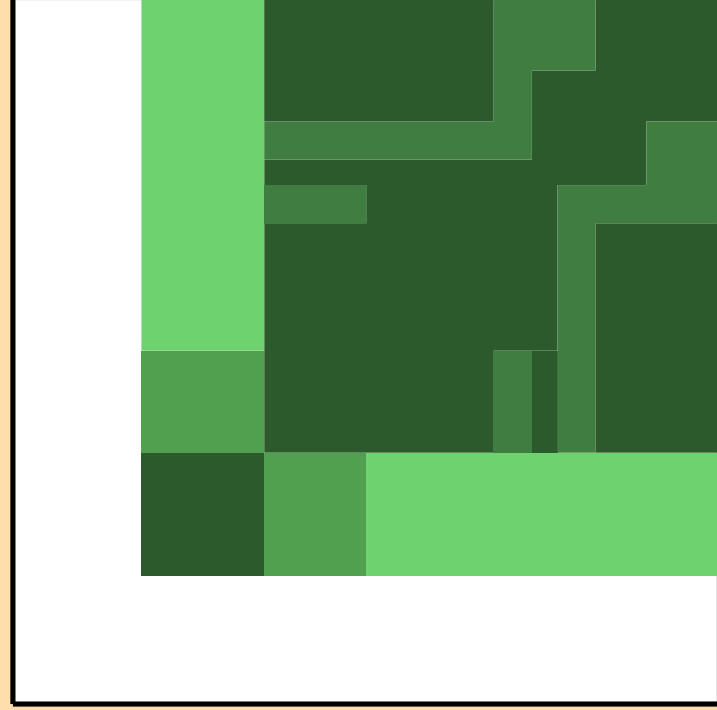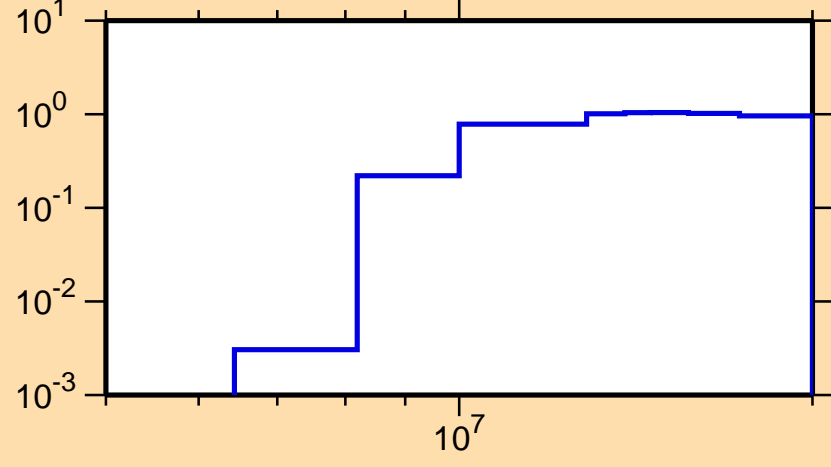

Correlation Matrix


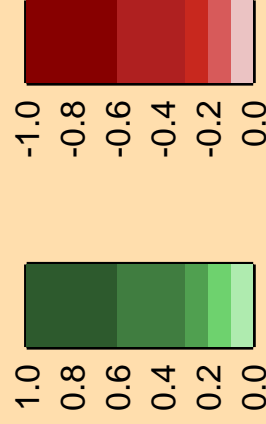


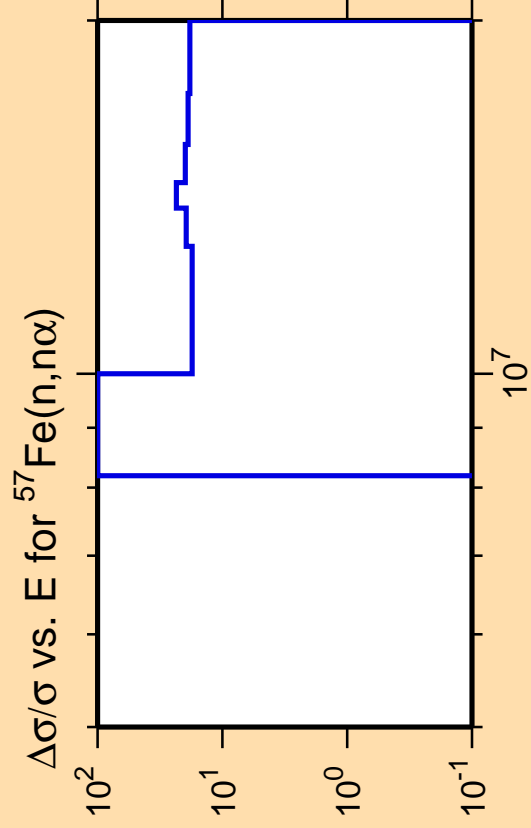

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

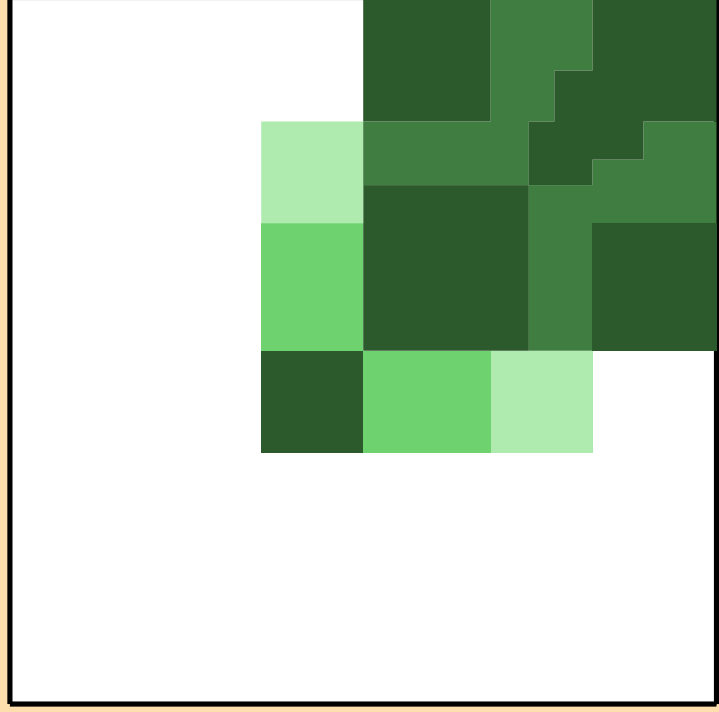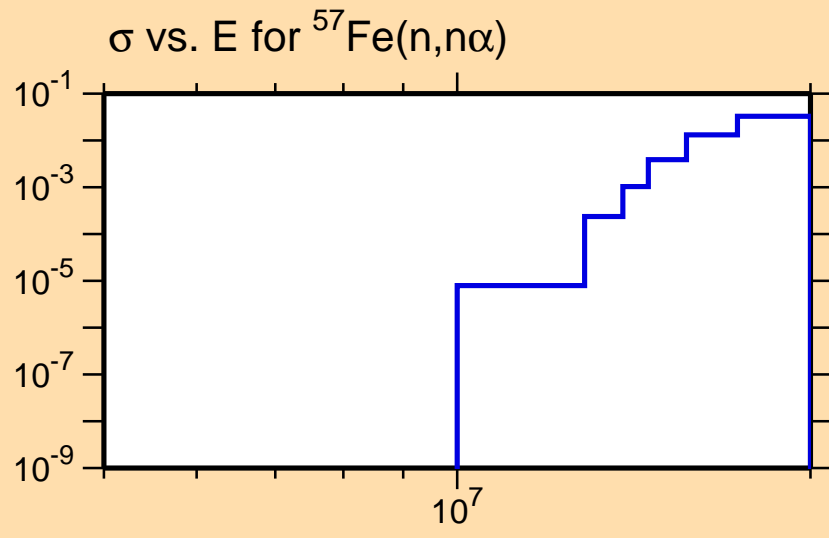

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{57}\text{Fe}(n,np)$

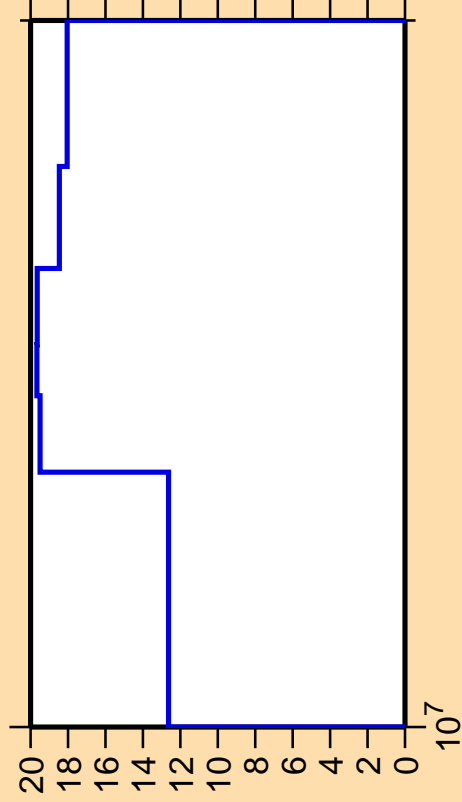


Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

σ vs. E for $^{57}\text{Fe}(n,np)$

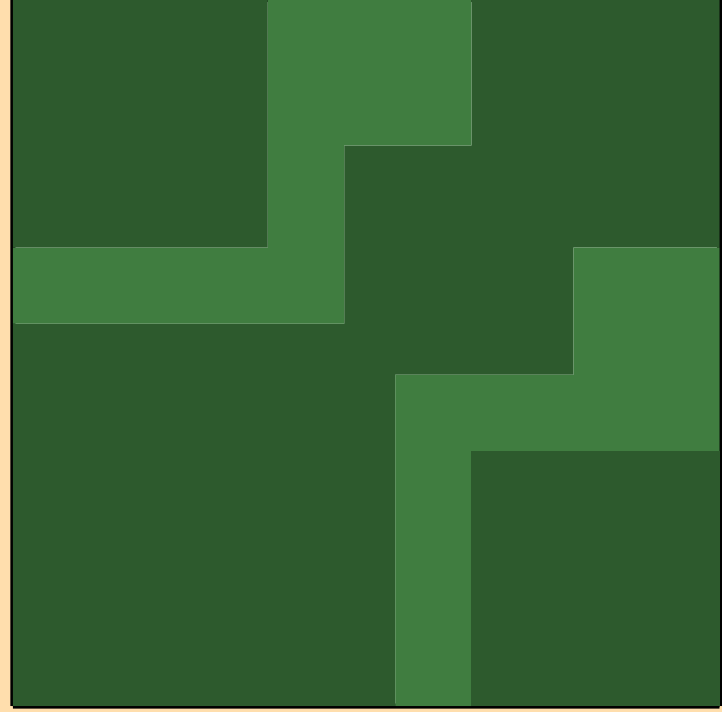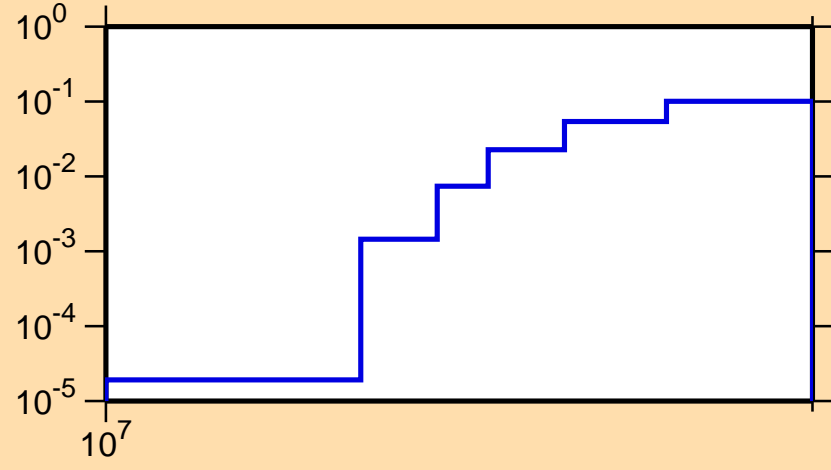

Correlation Matrix

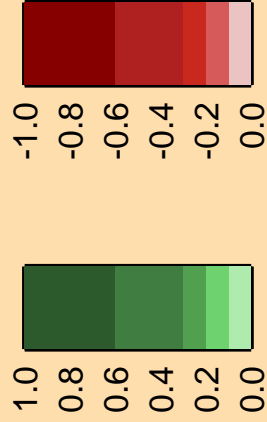


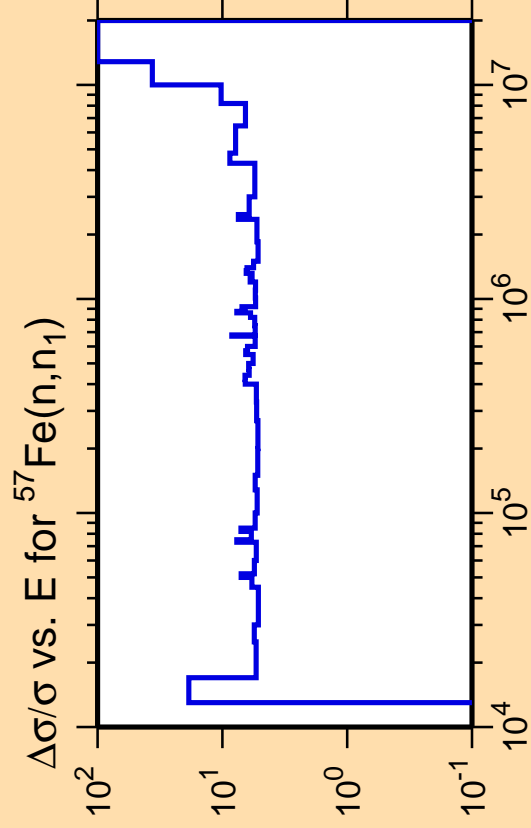


Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

σ vs. E for $^{57}\text{Fe}(n,n_1)$

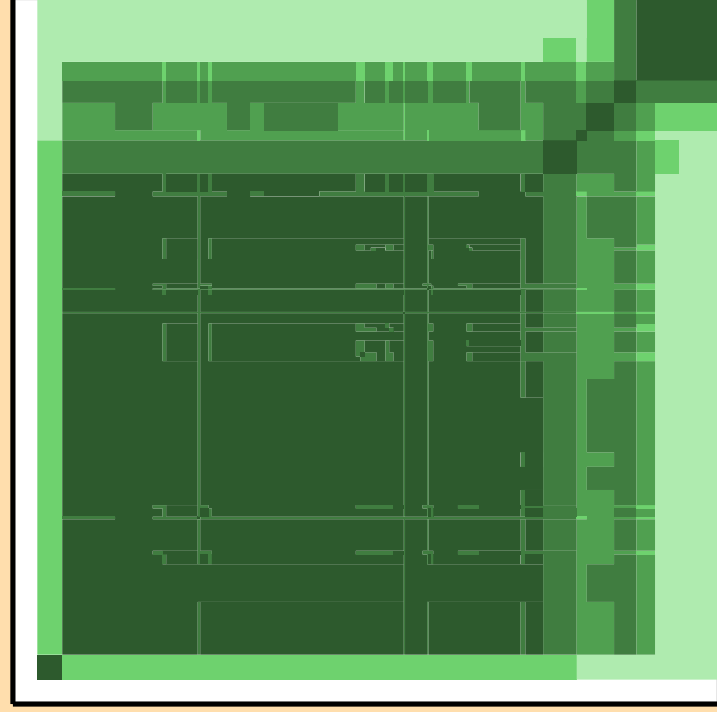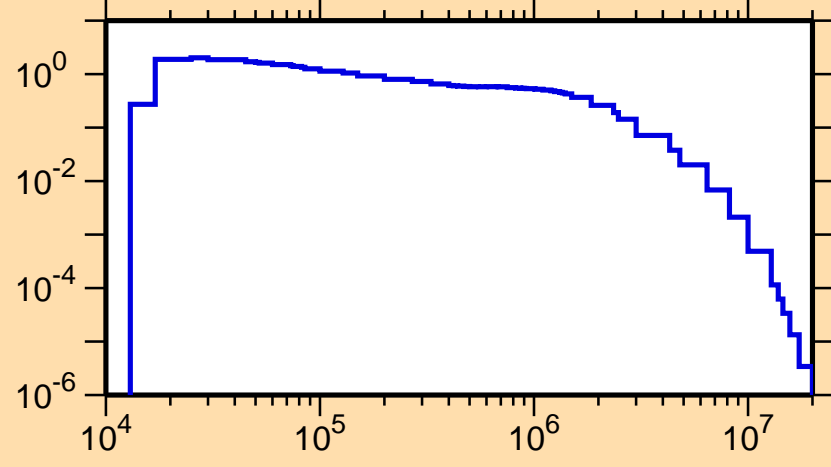

Correlation Matrix


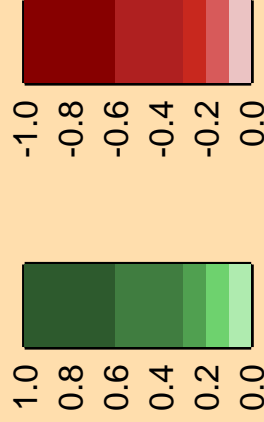


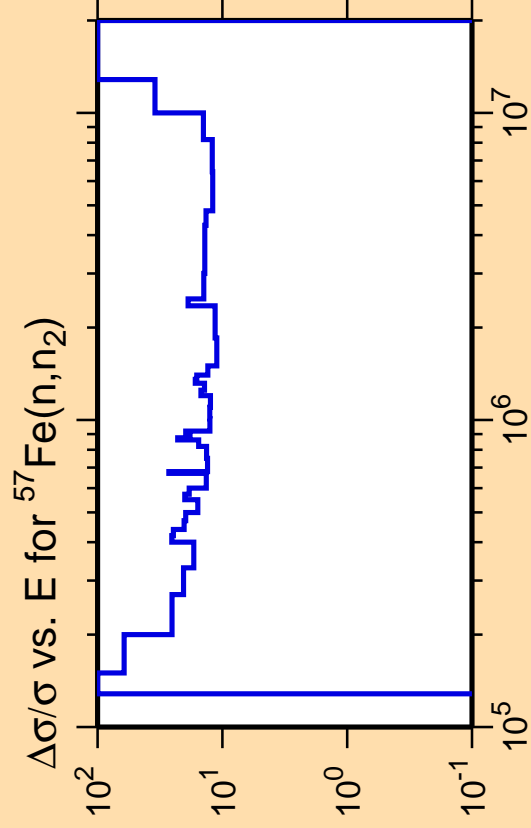

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

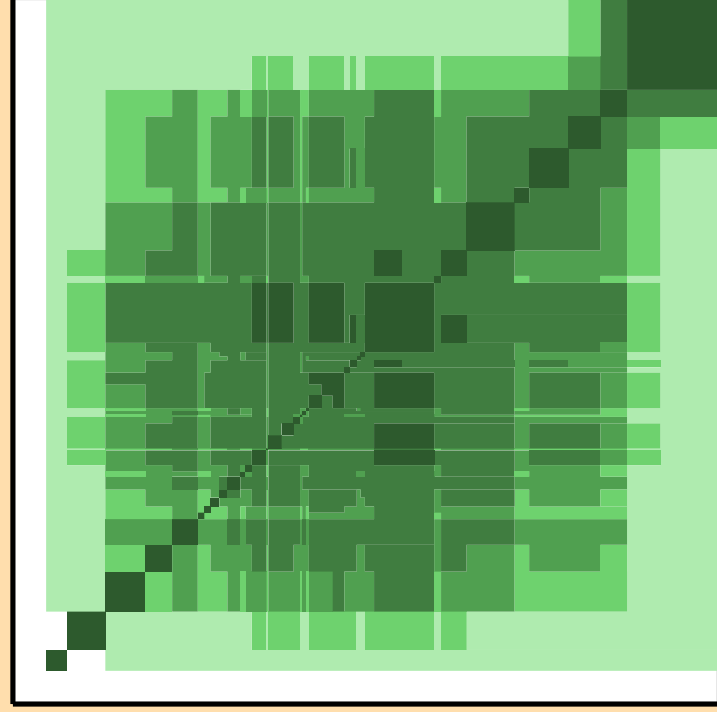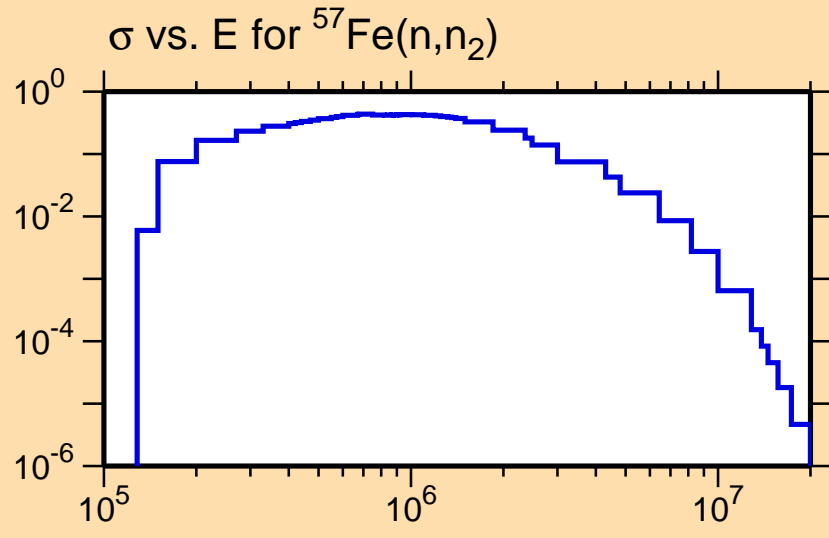

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{57}\text{Fe}(n,n_3)$

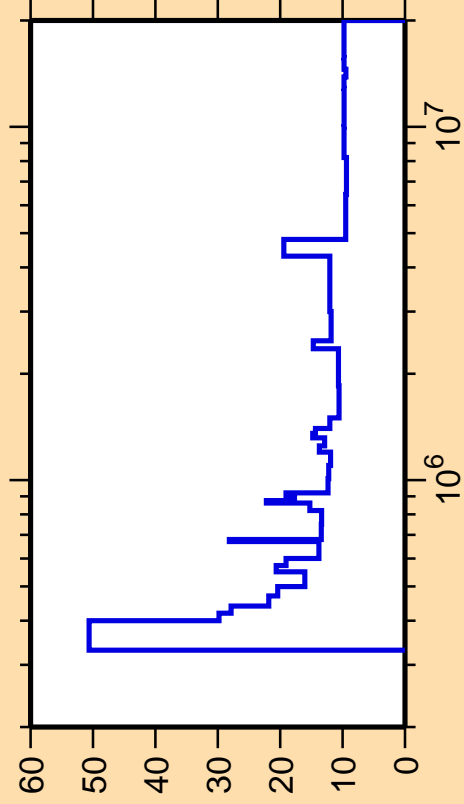


Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

σ vs. E for $^{57}\text{Fe}(n,n_3)$

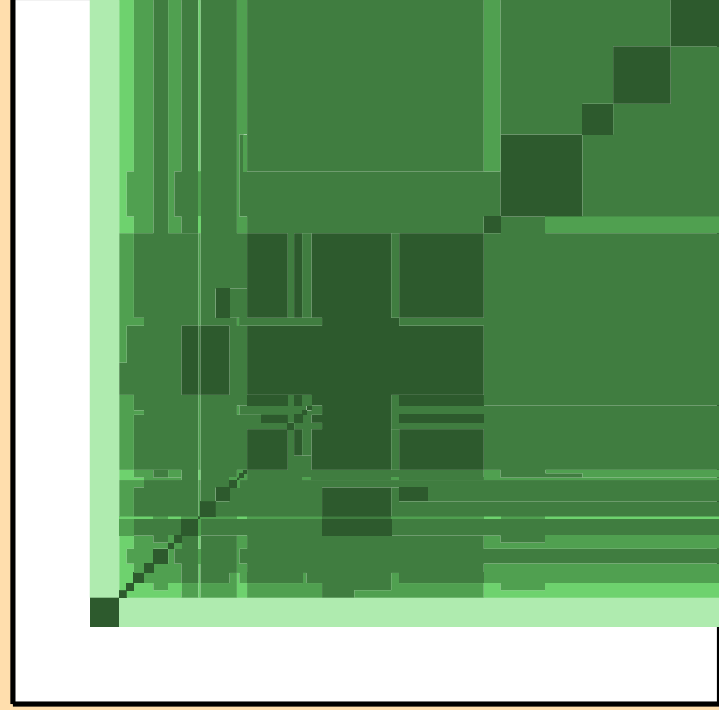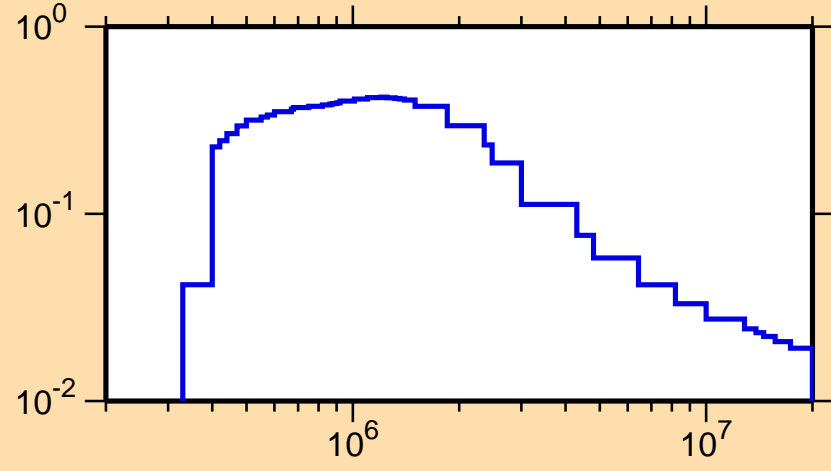

Correlation Matrix


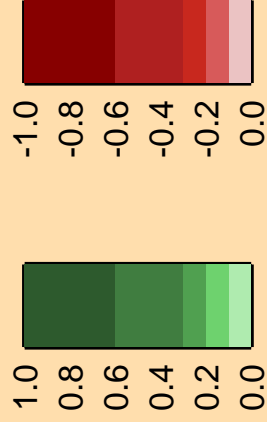


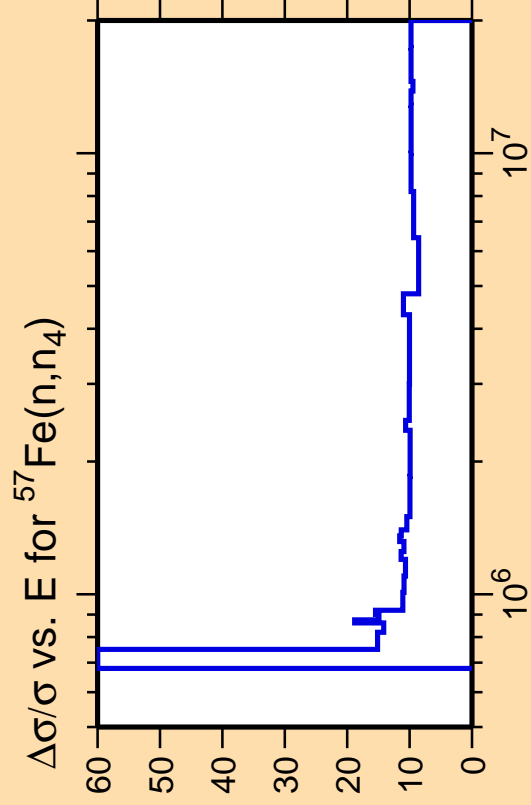

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

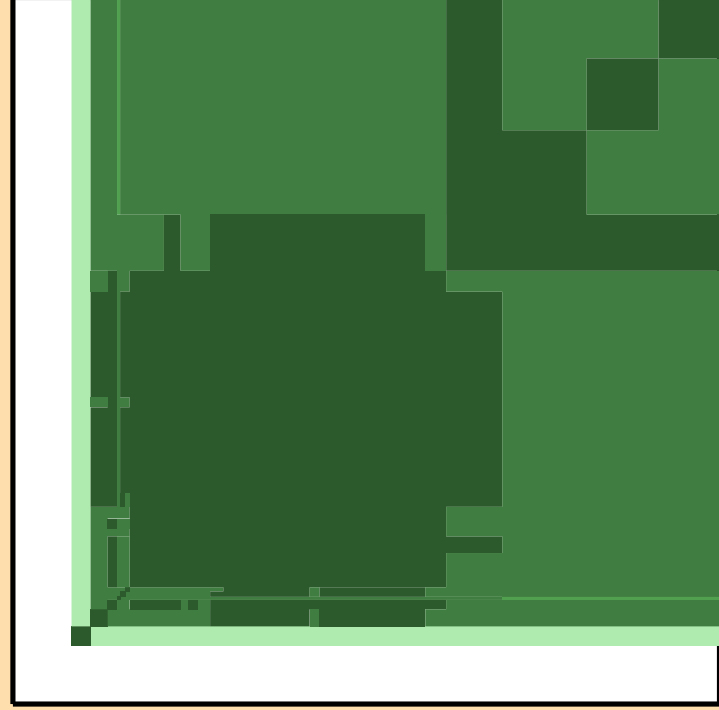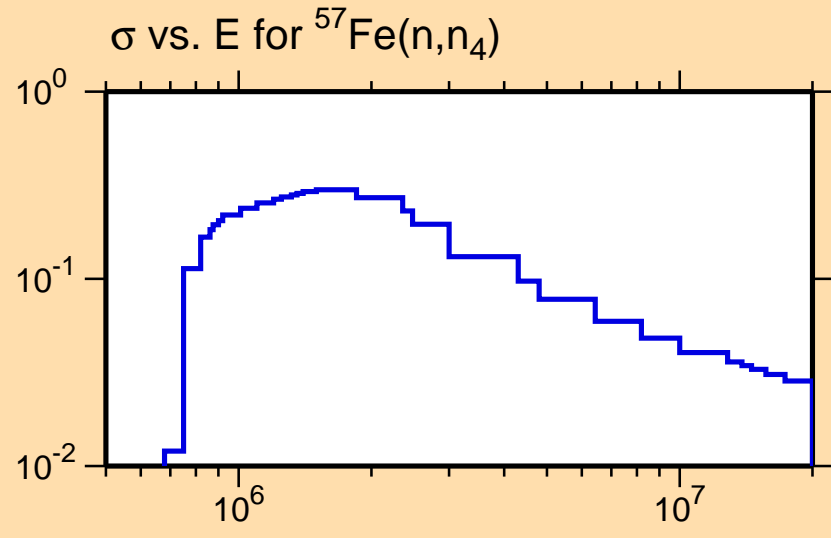

Correlation Matrix





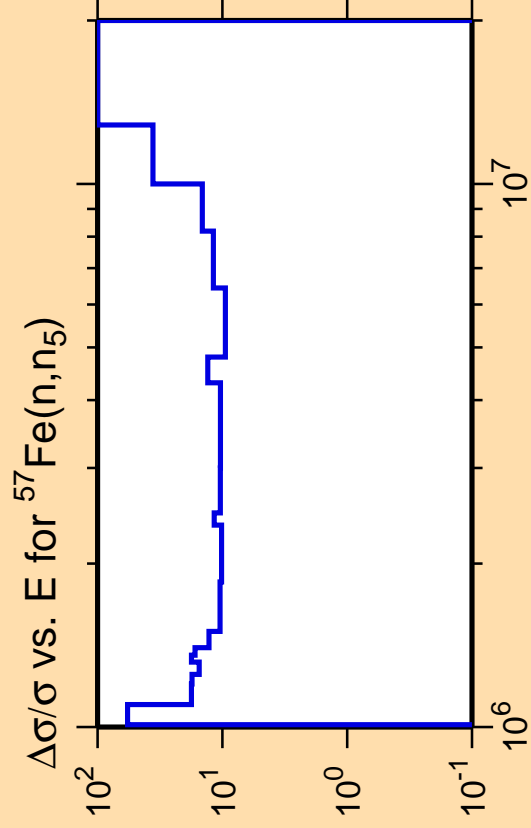

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

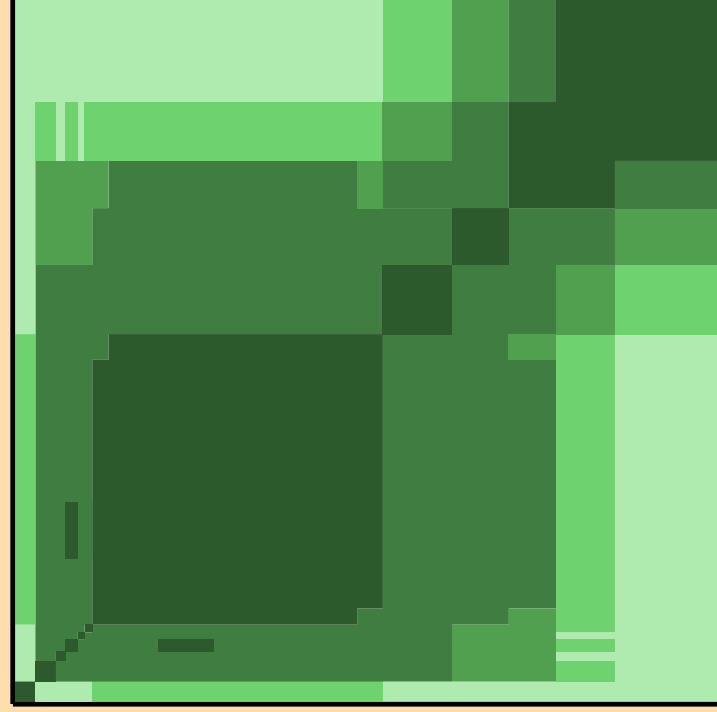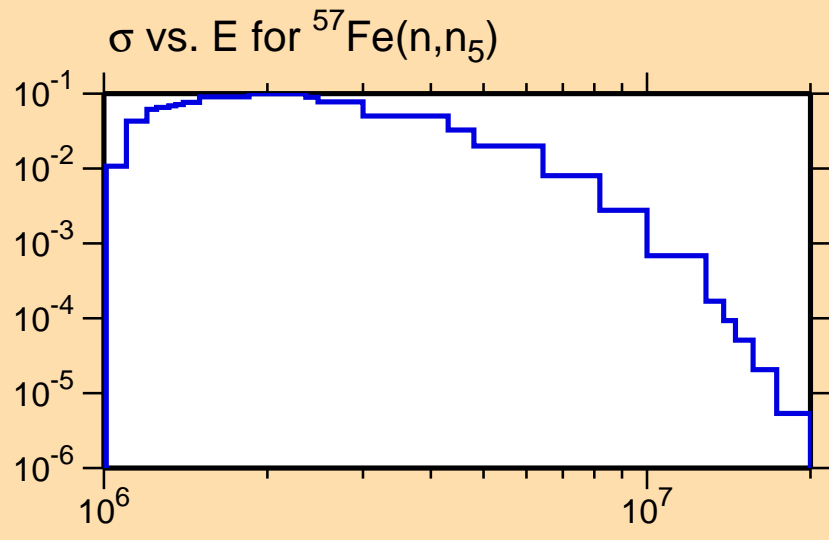

Correlation Matrix





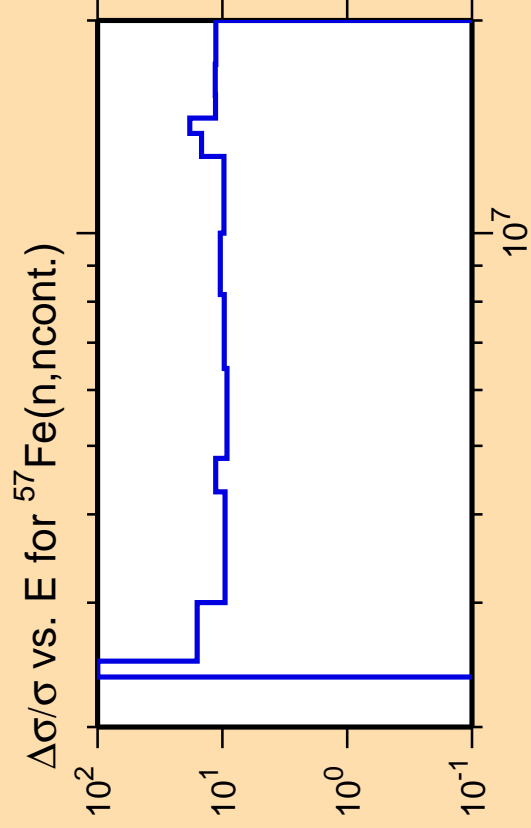

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

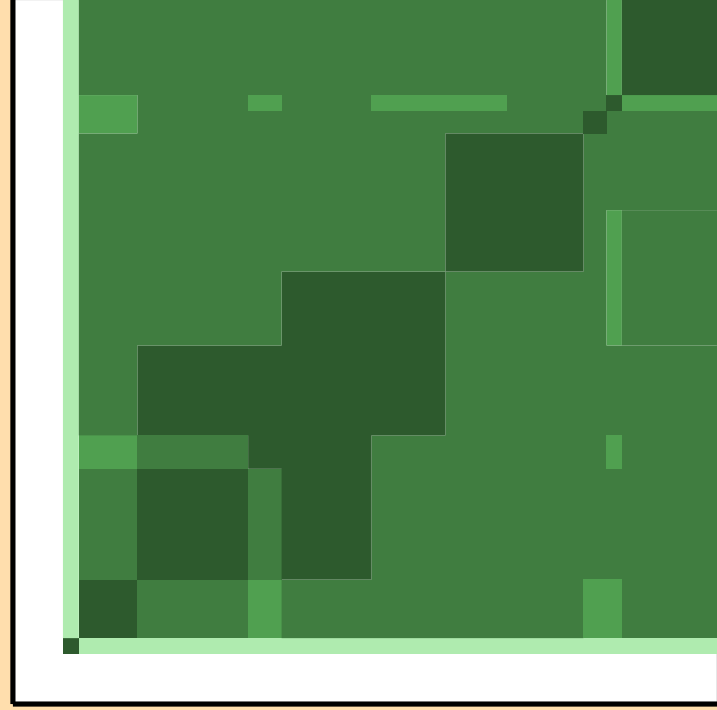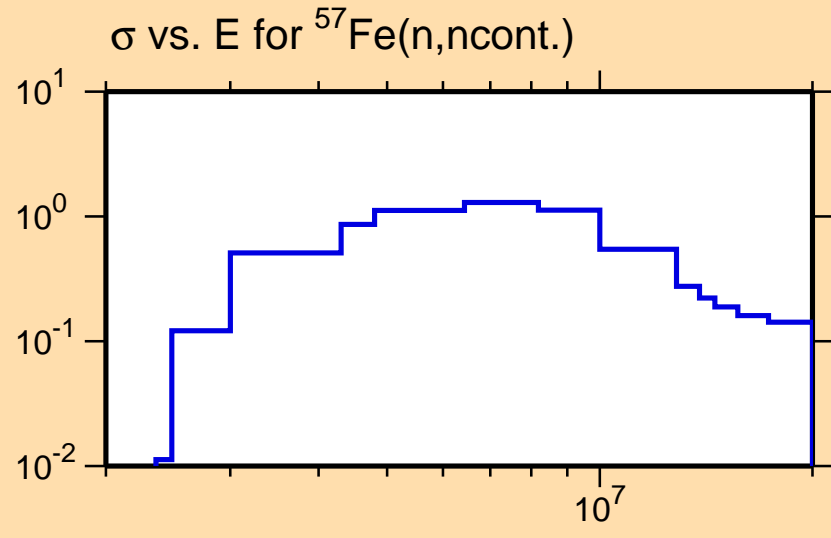

Correlation Matrix





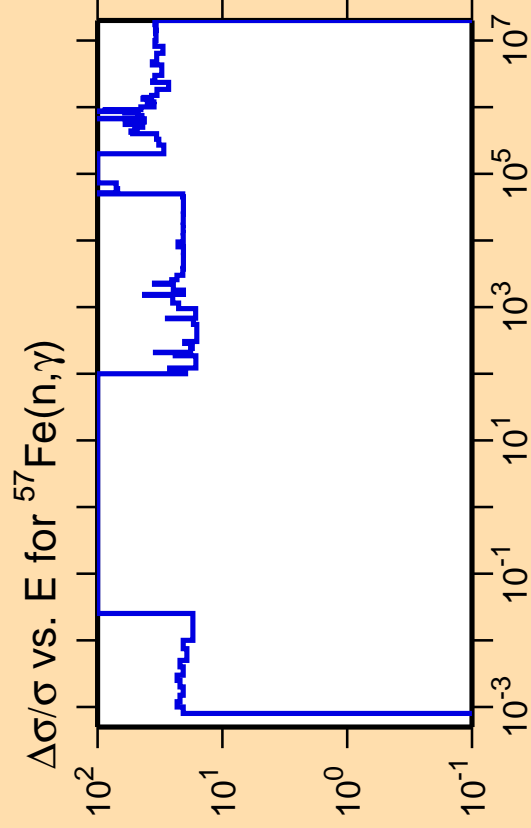

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

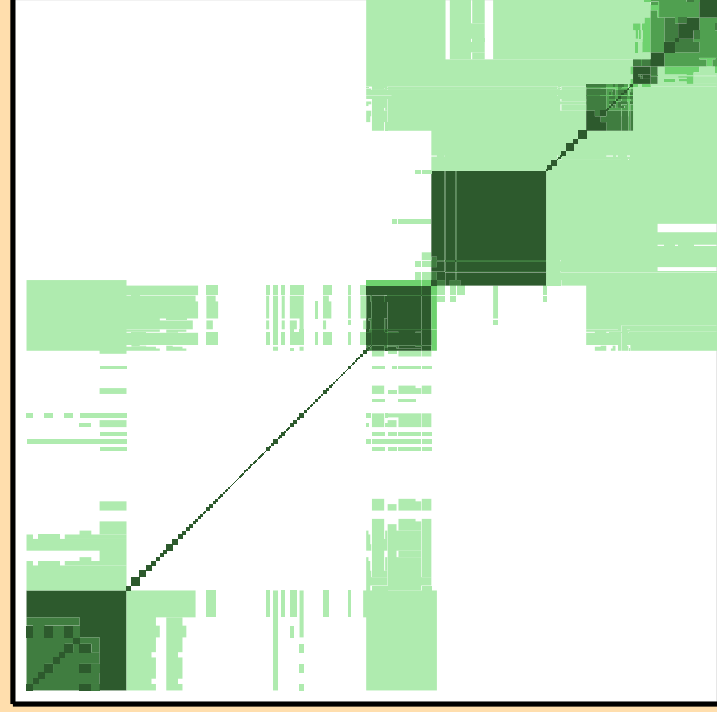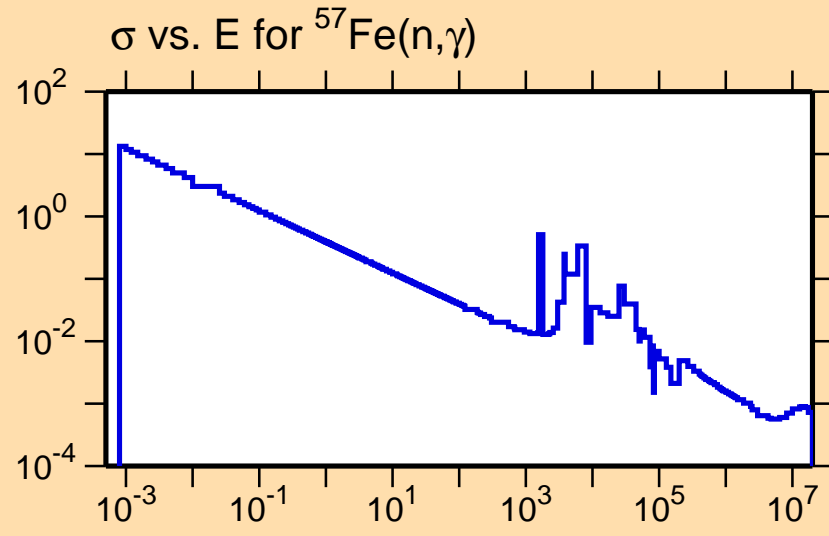

Correlation Matrix





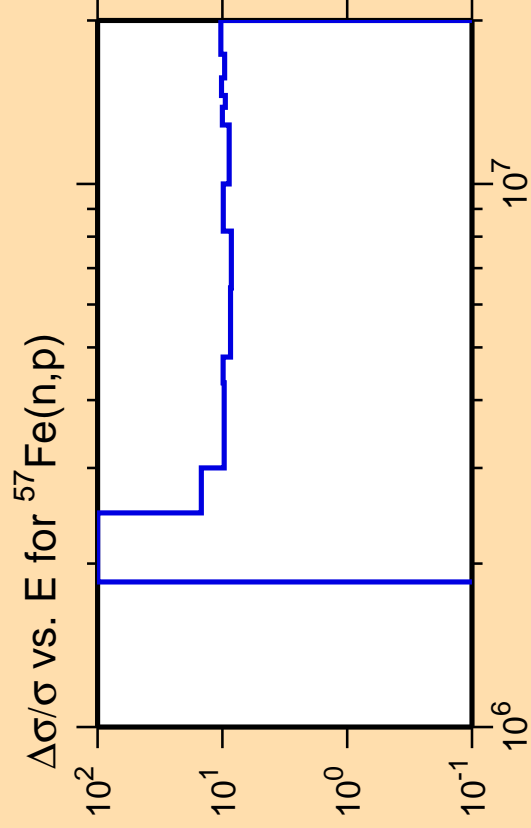

Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

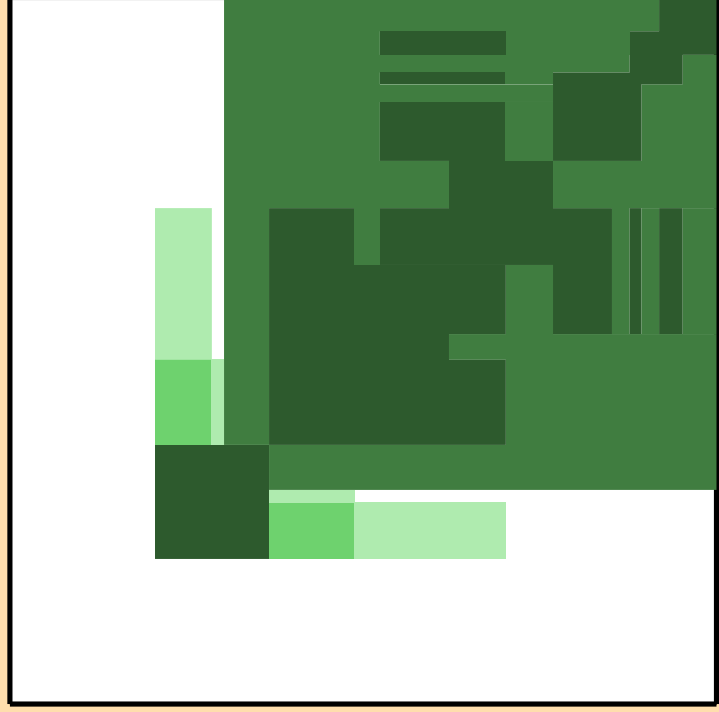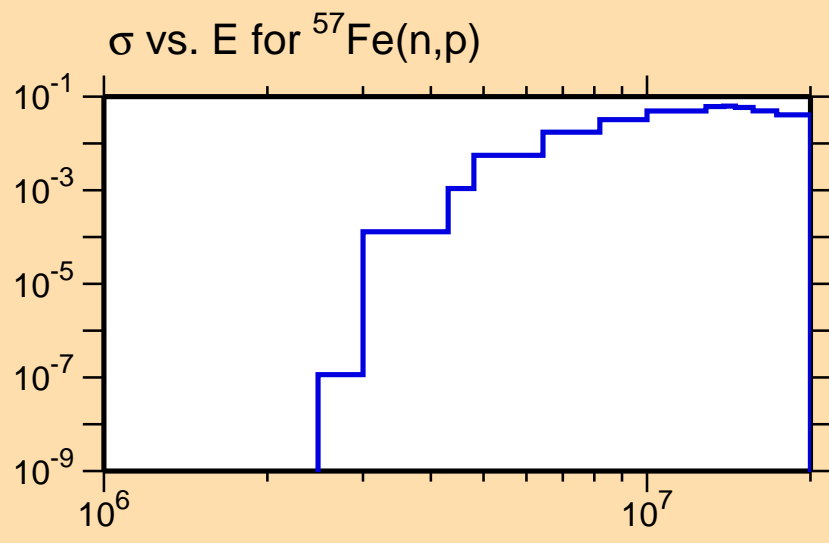

Correlation Matrix





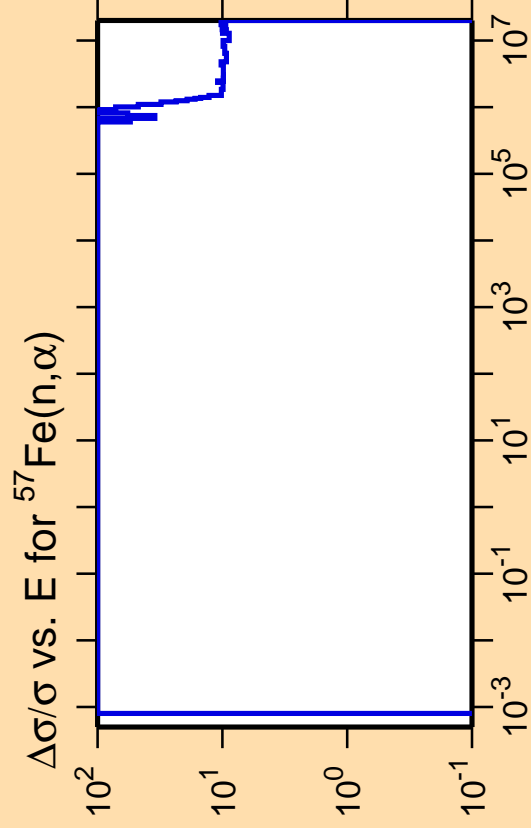

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

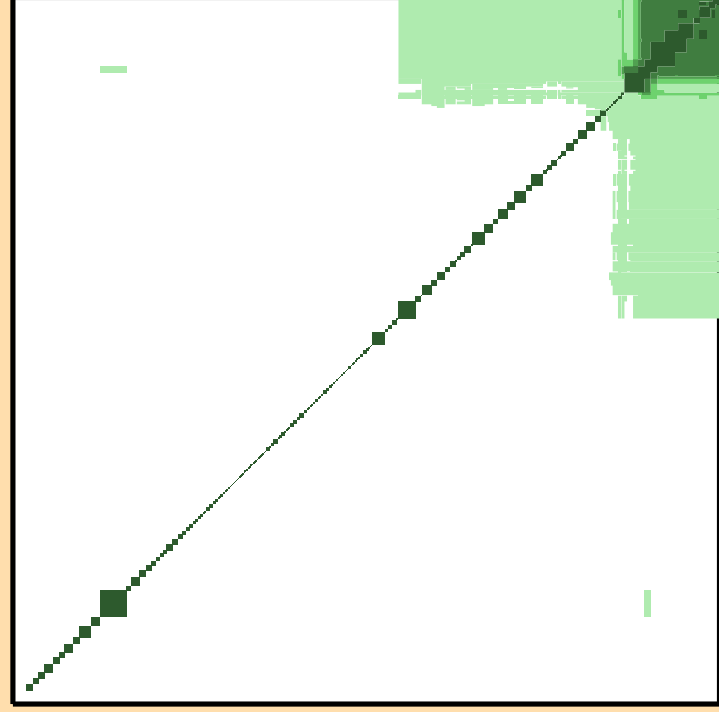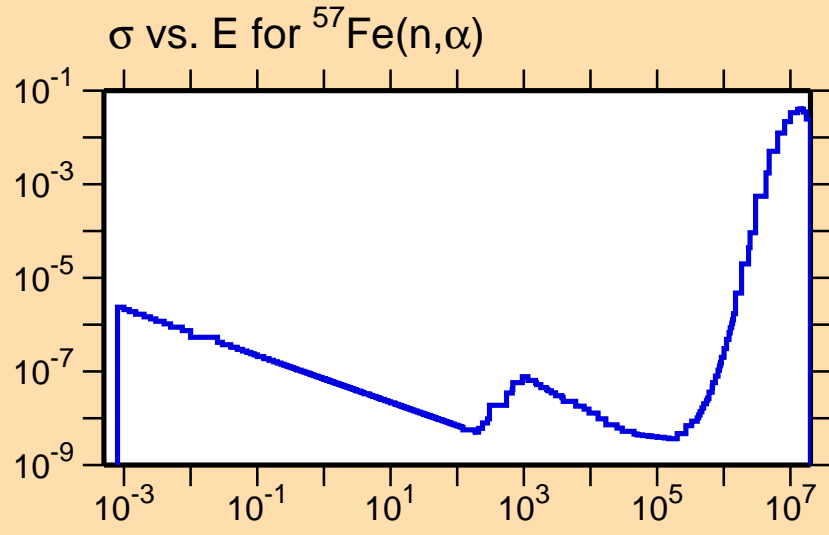

Correlation Matrix

