

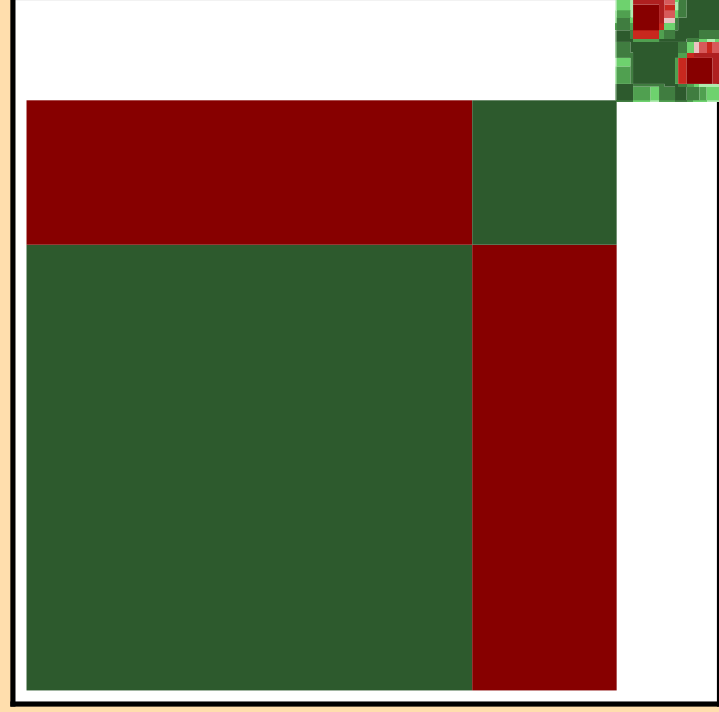


Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

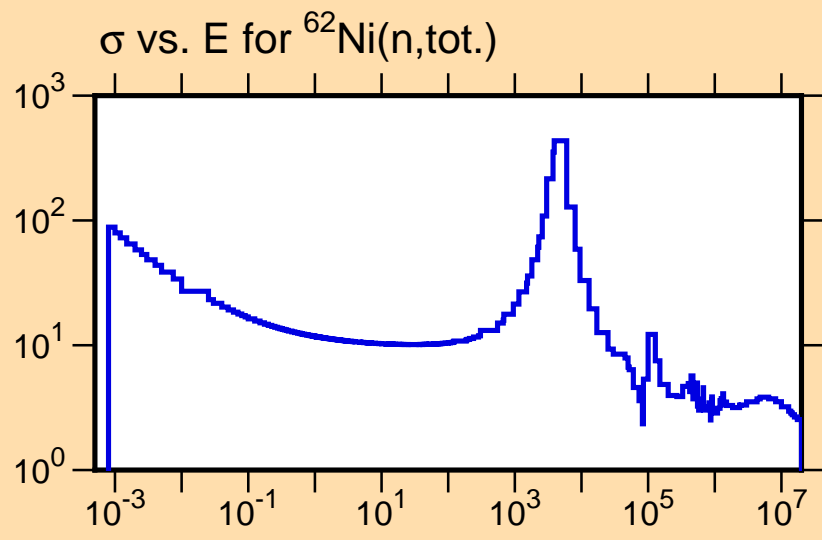

Correlation Matrix

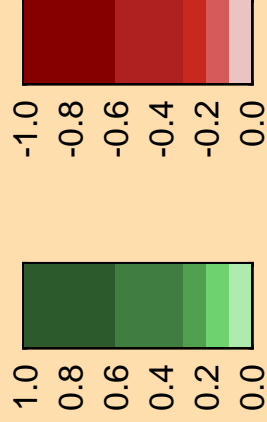


$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,\text{el.})$

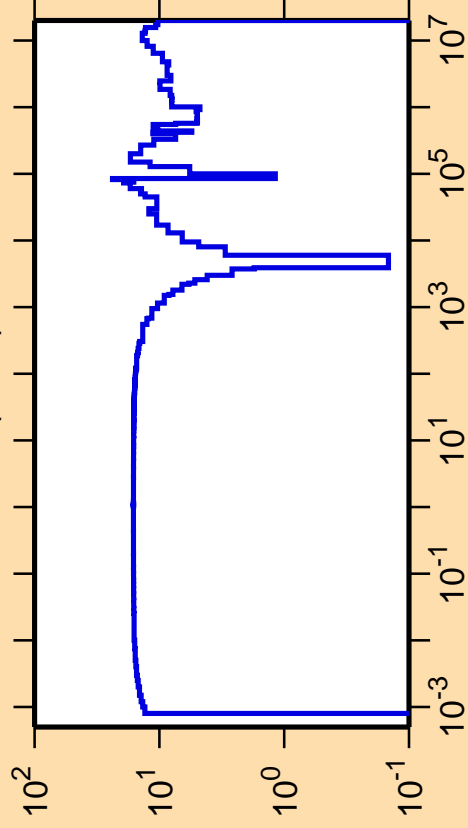


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,\text{tot.})$

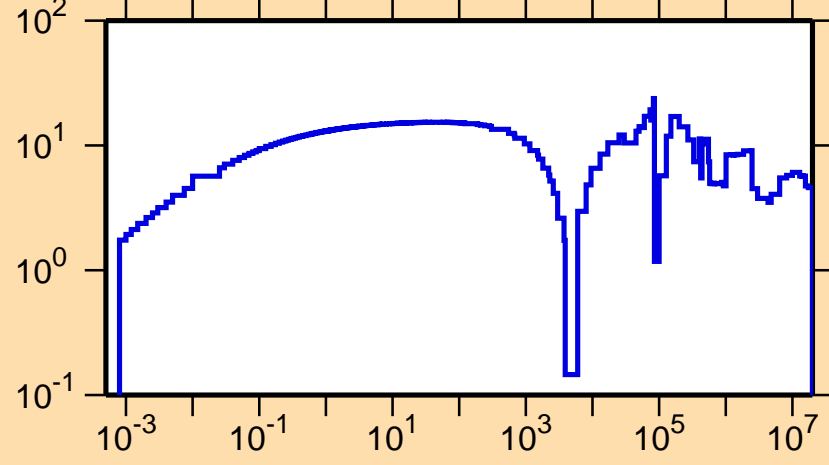



Correlation Matrix

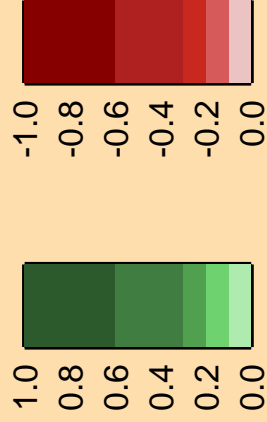

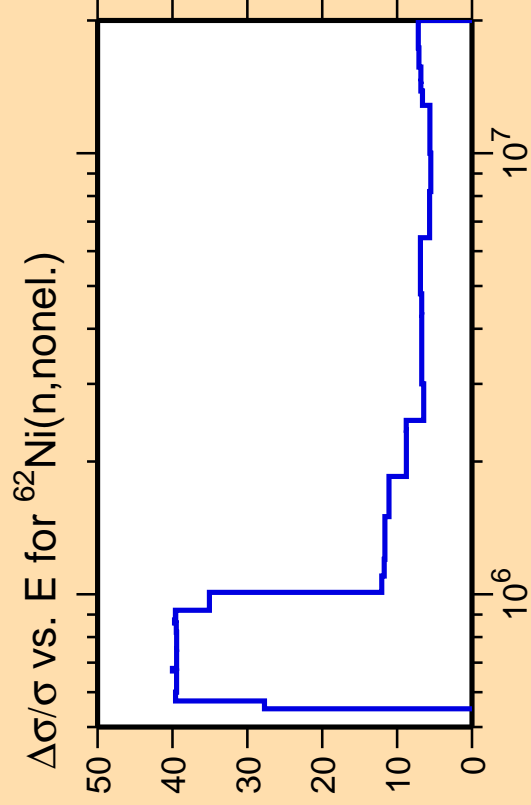


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

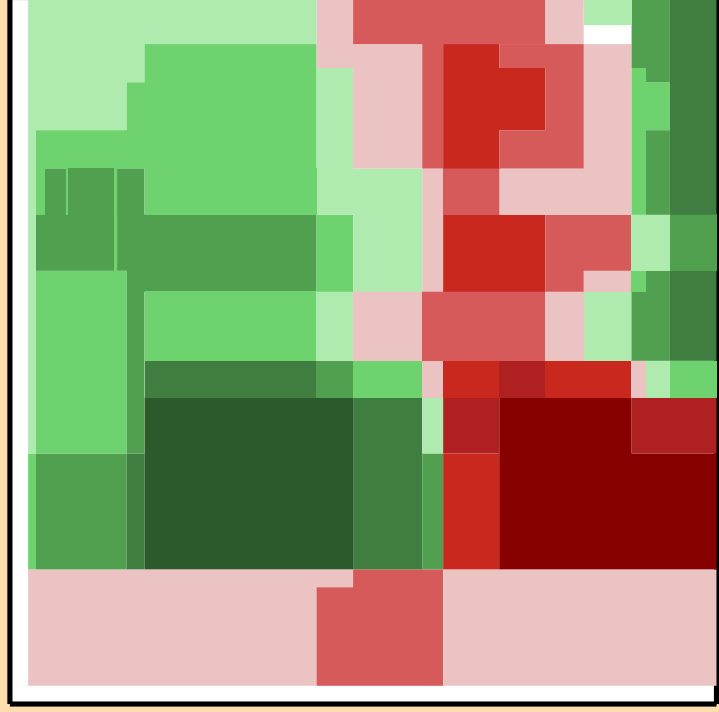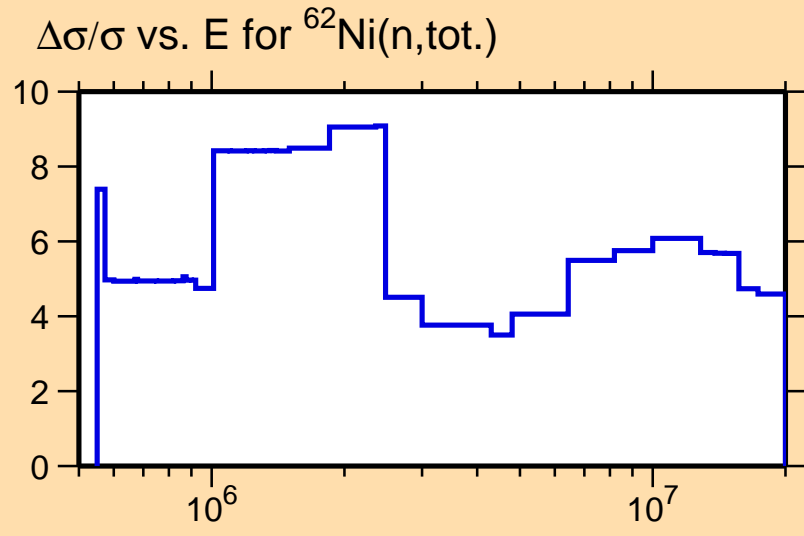

Correlation Matrix

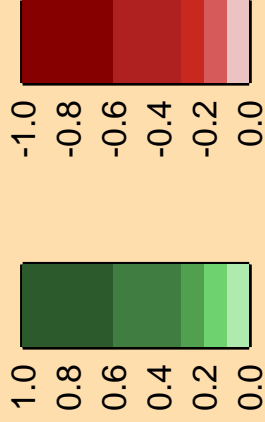



$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,\text{inel.})$

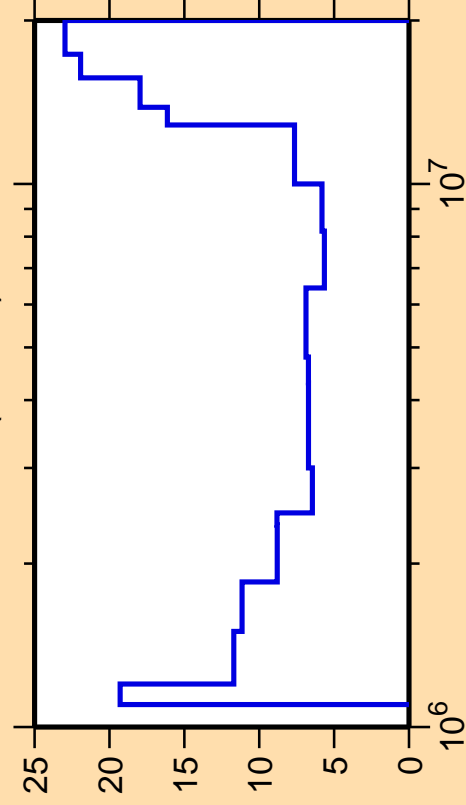

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,\text{tot.})$

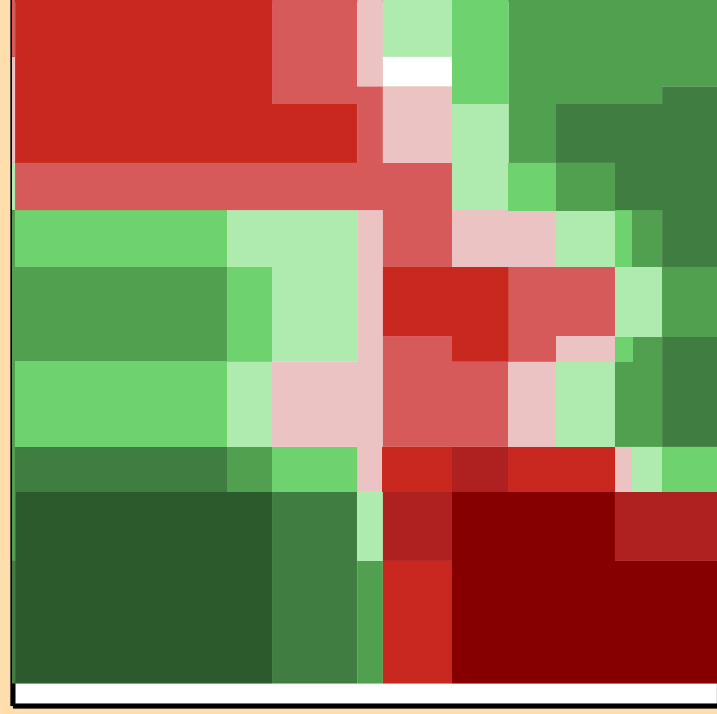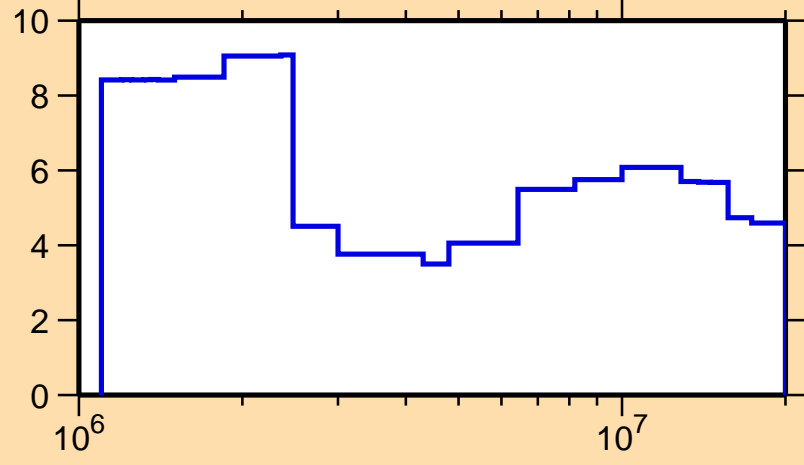

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,2n)$

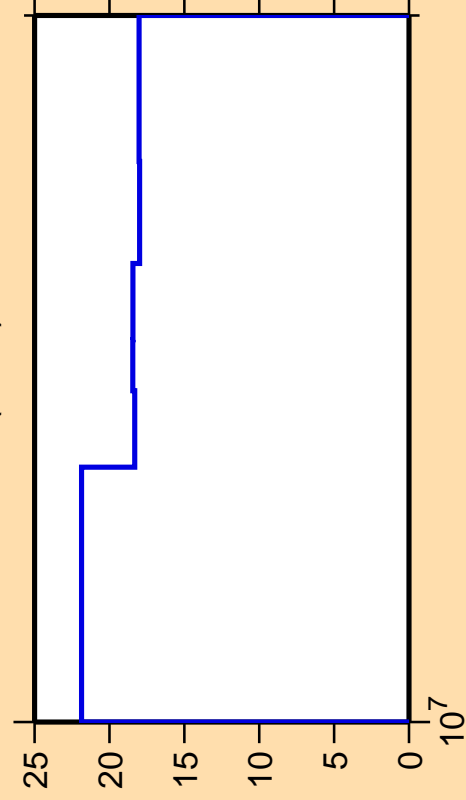

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,\text{tot.})$

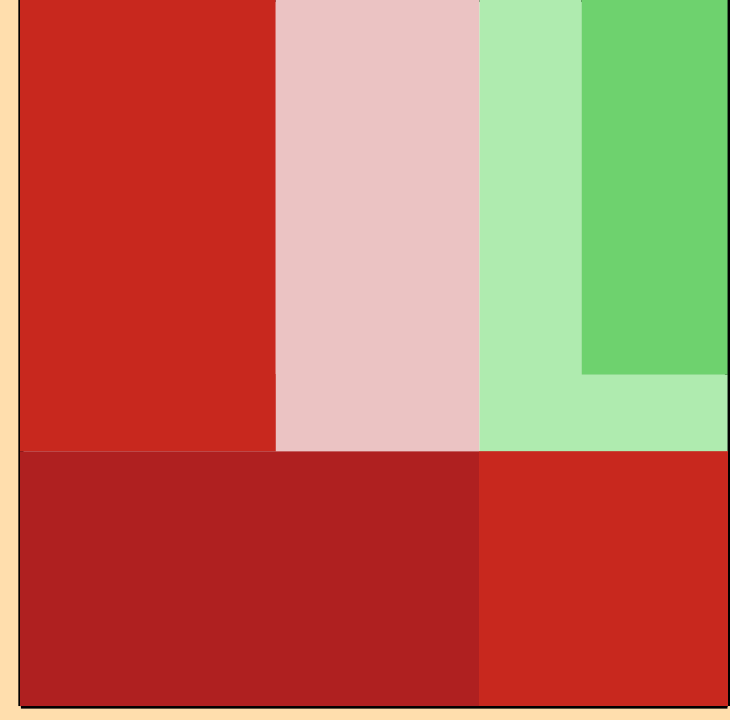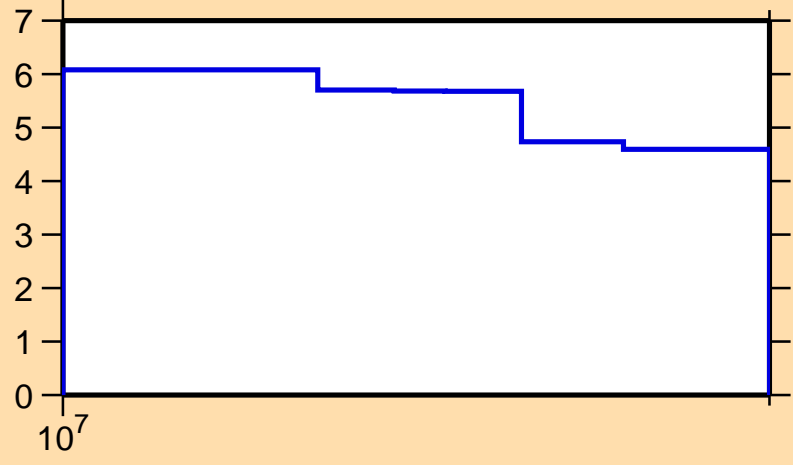



Correlation Matrix



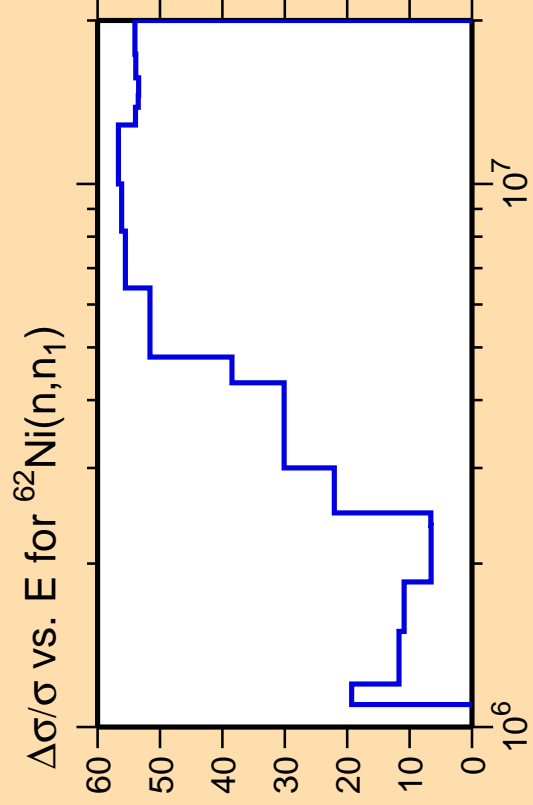


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

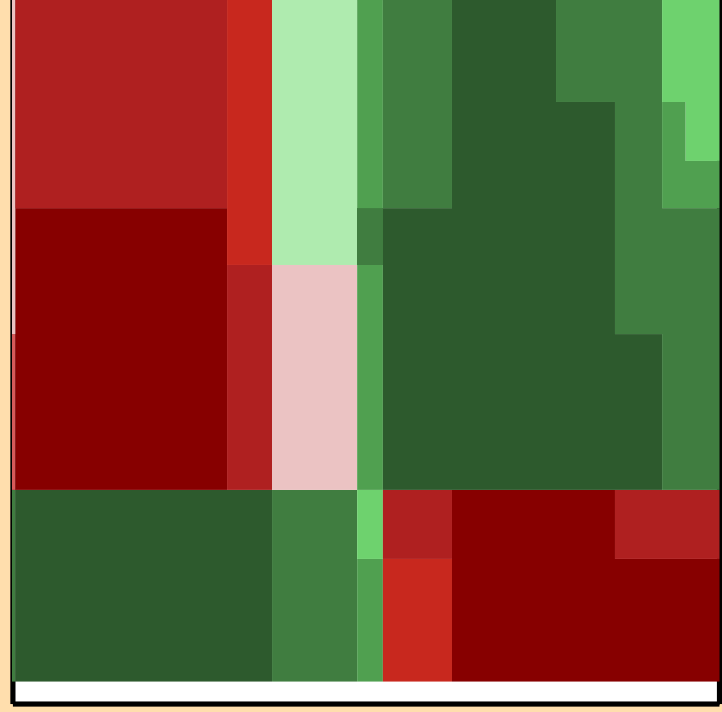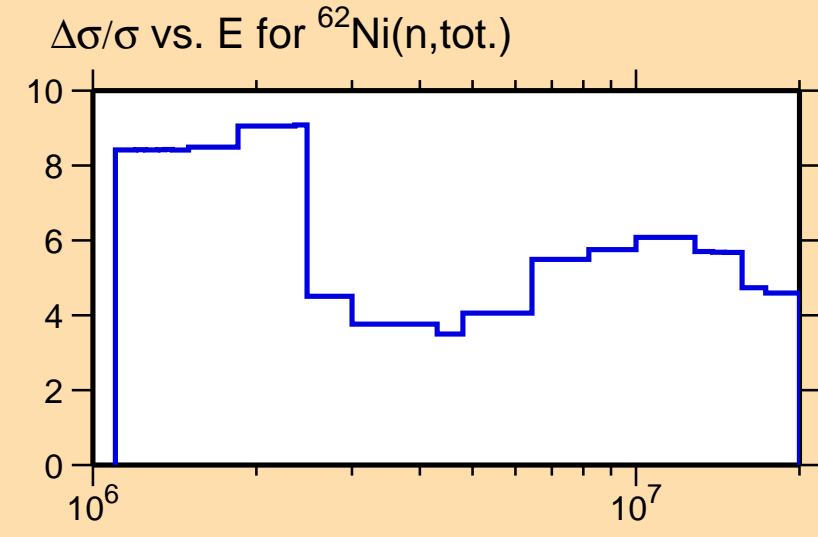

Correlation Matrix

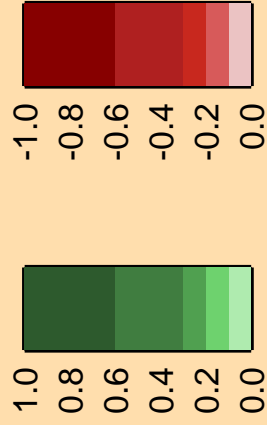


$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,n\text{cont.})$

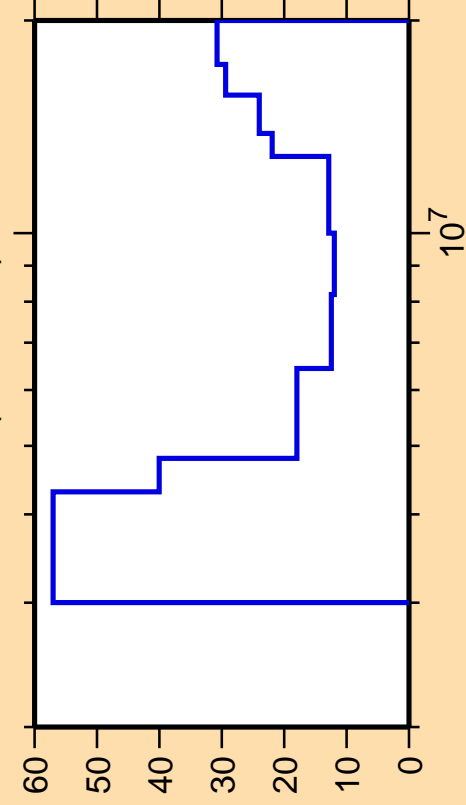

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,\text{tot.})$

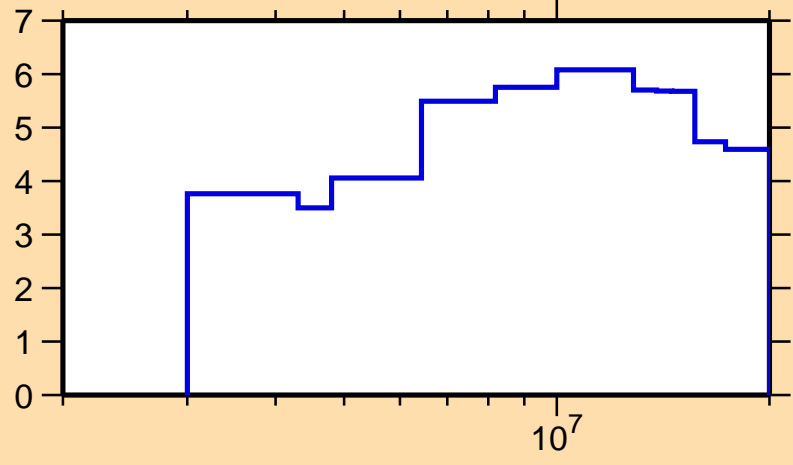

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,\gamma)$


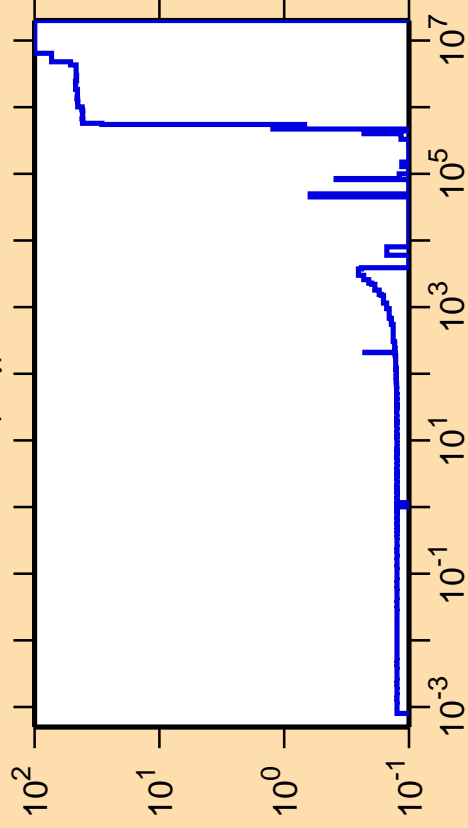


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.


$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,\text{tot.})$

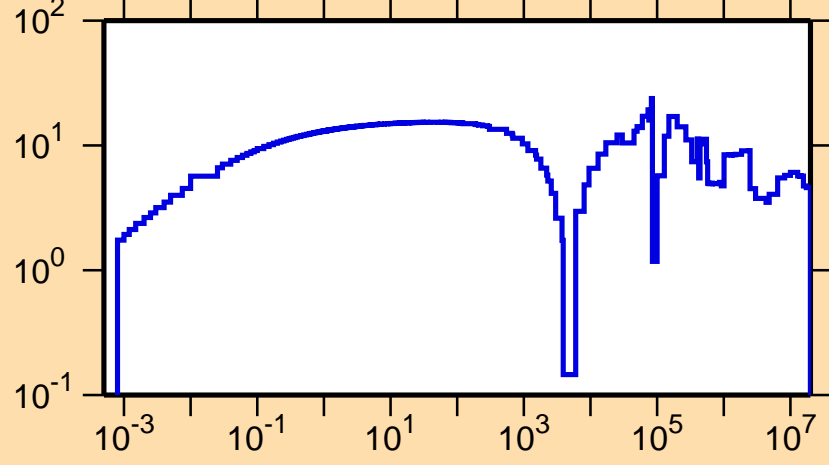

Correlation Matrix

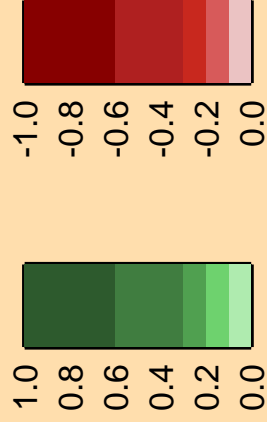



$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,p)$

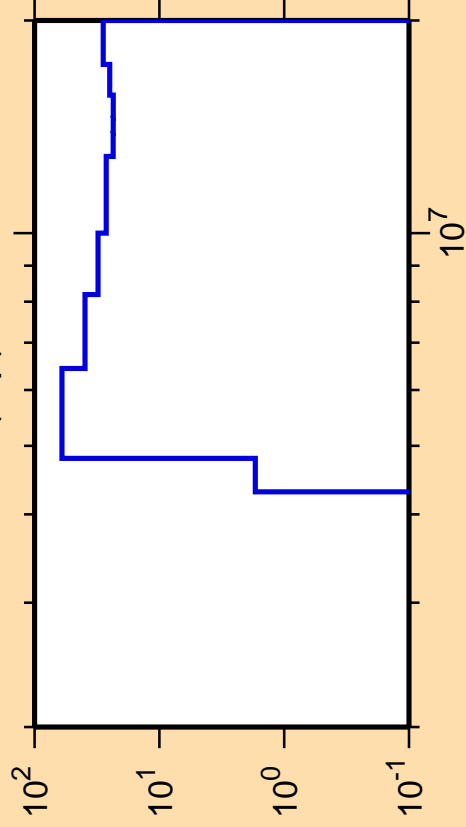


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,\text{tot.})$

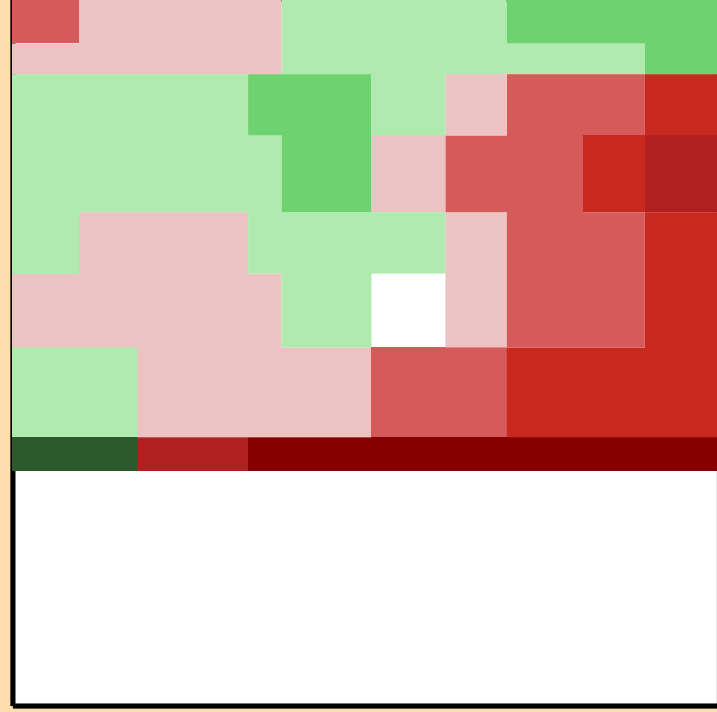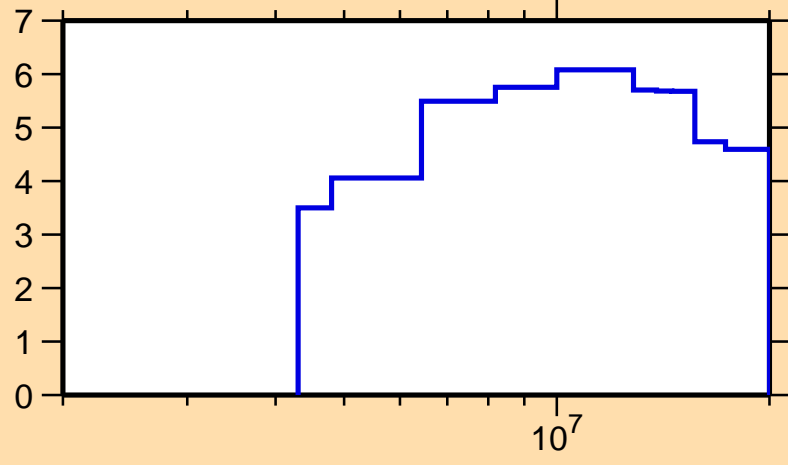

Correlation Matrix

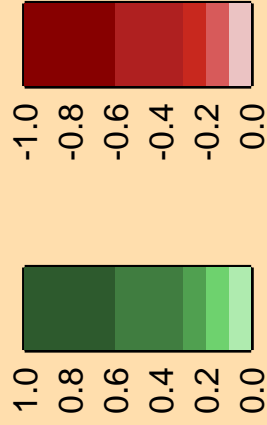


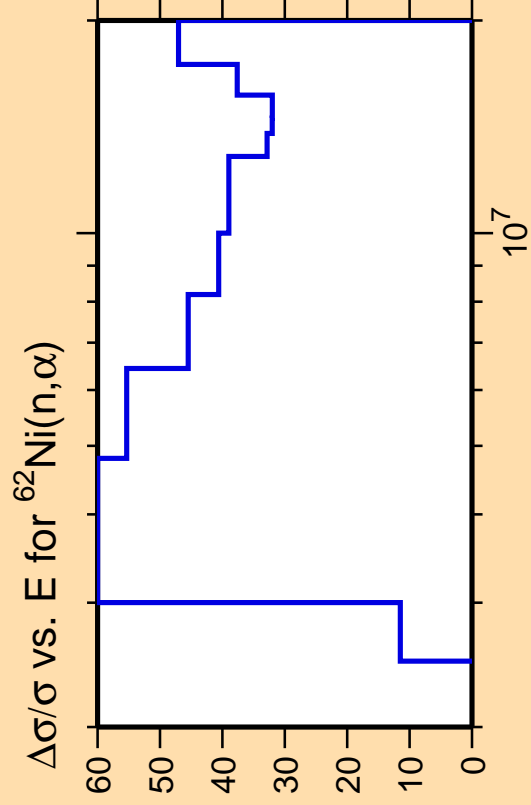


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.


$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,\text{tot.})$

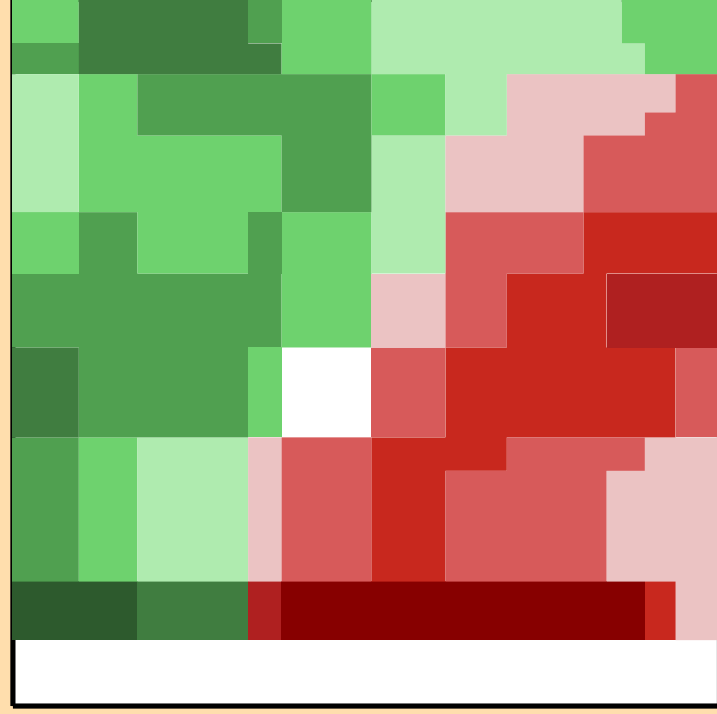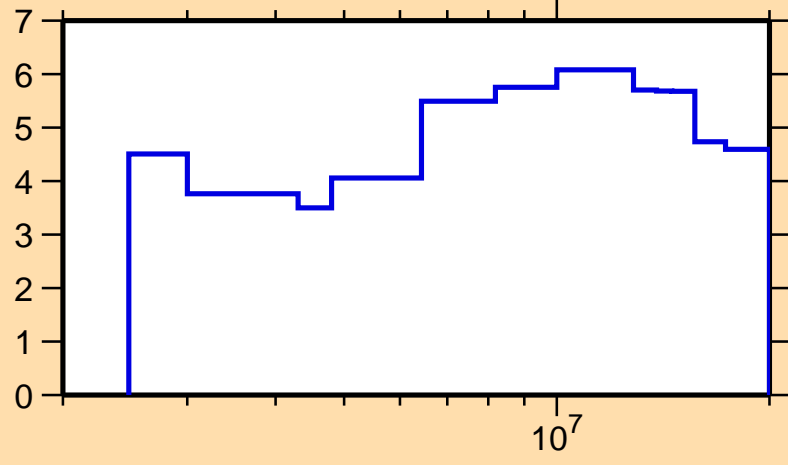

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,\text{el.})$

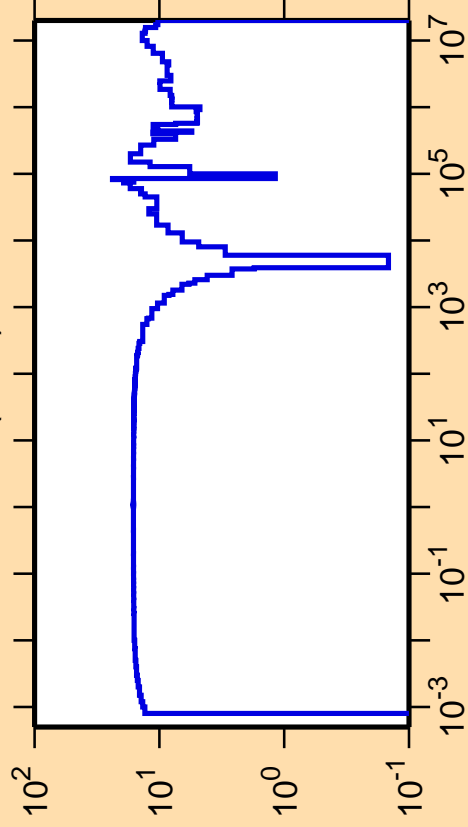


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


σ vs. E for $^{62}\text{Ni}(n,\text{el.})$

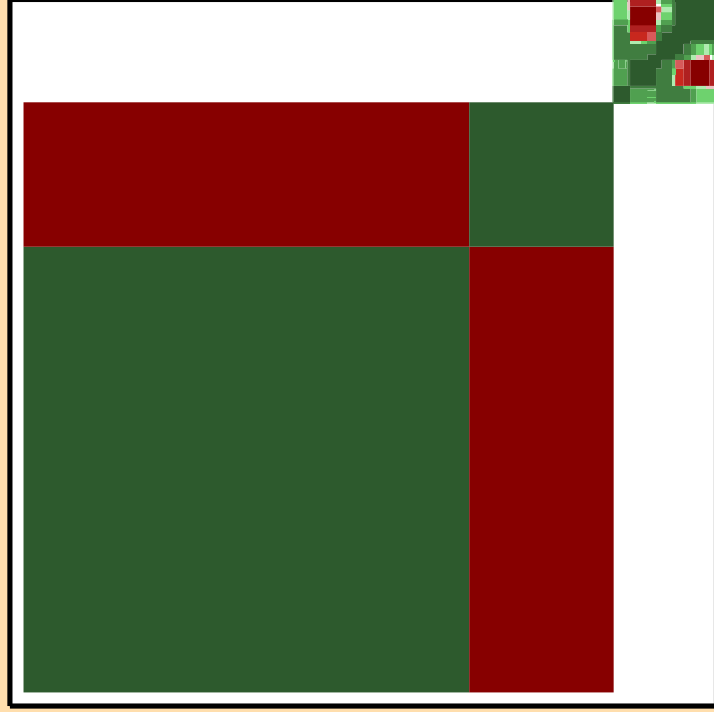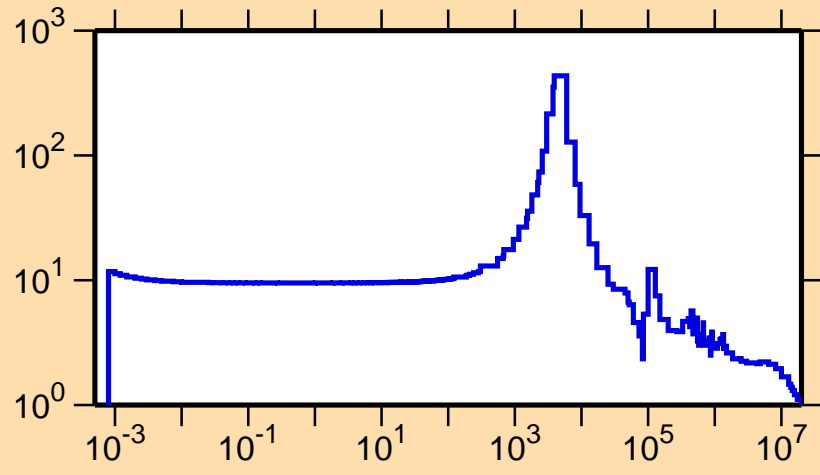

Correlation Matrix

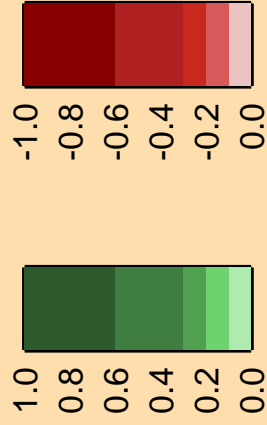



$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,\text{nonel.})$

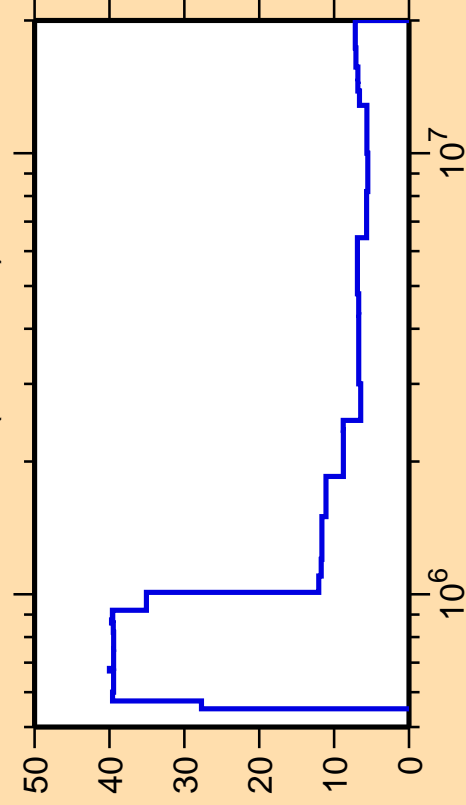


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,\text{el.})$

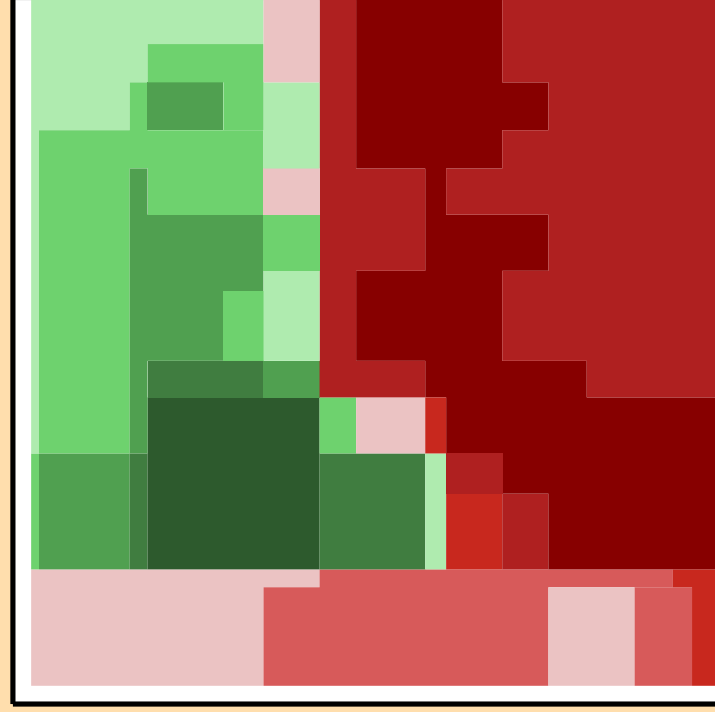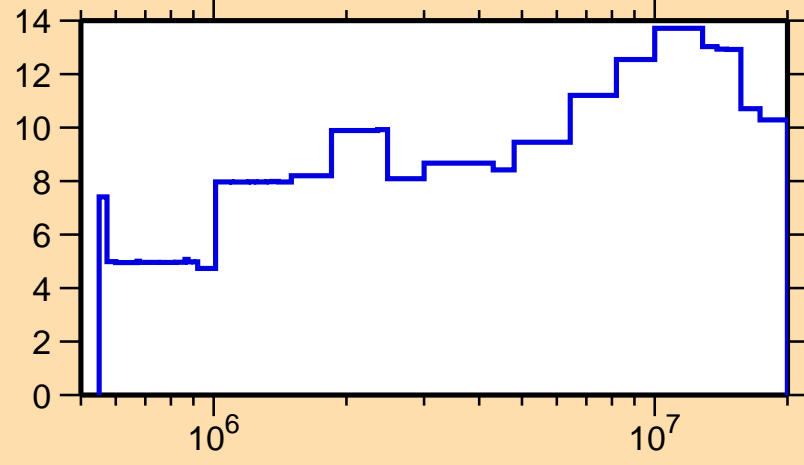

Correlation Matrix

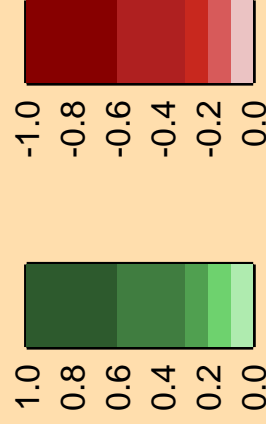



$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,\text{inel.})$

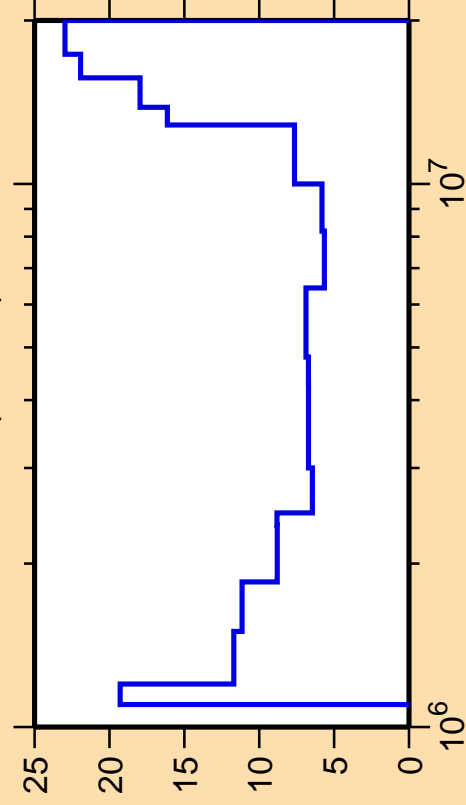


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,\text{el.})$

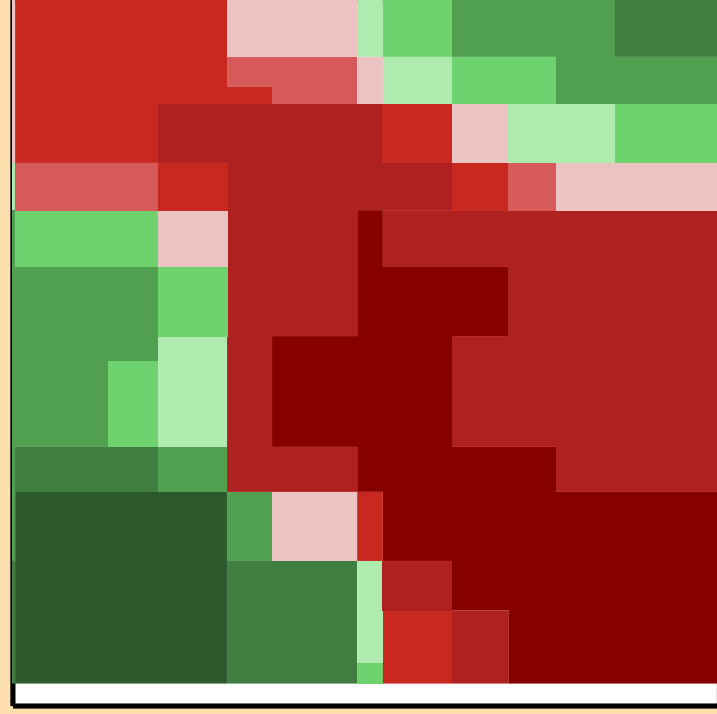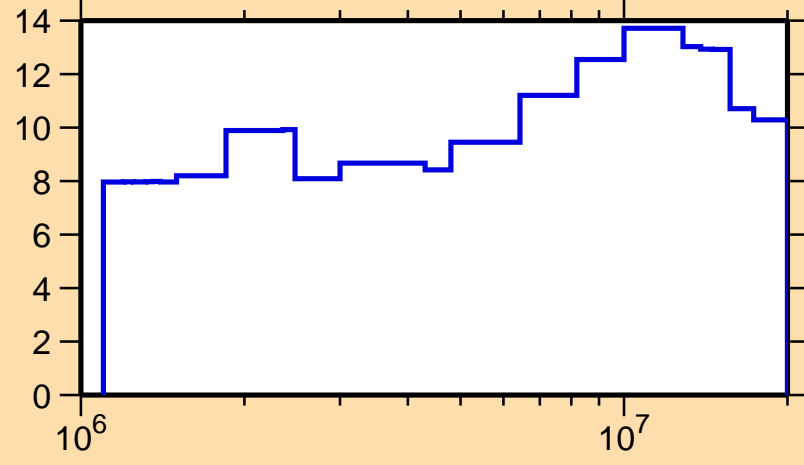

Correlation Matrix

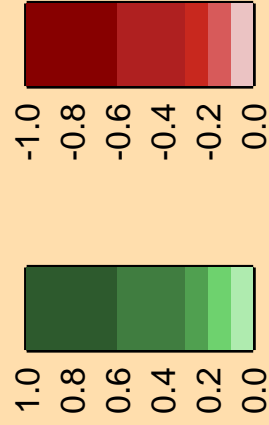



$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,2n)$

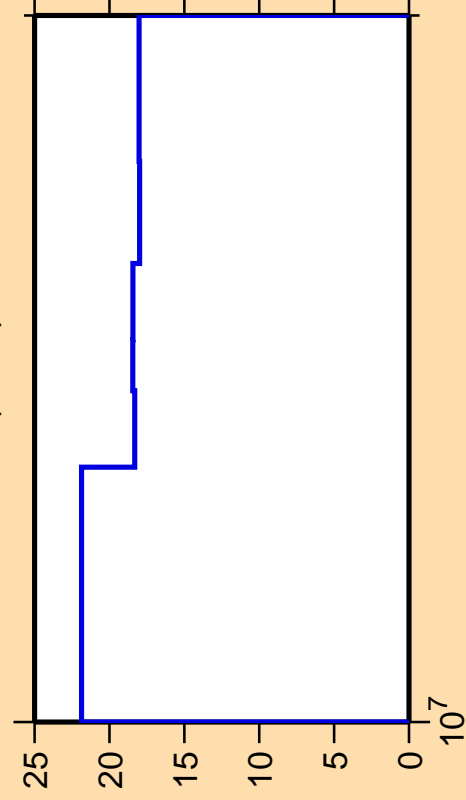

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,\text{el.})$

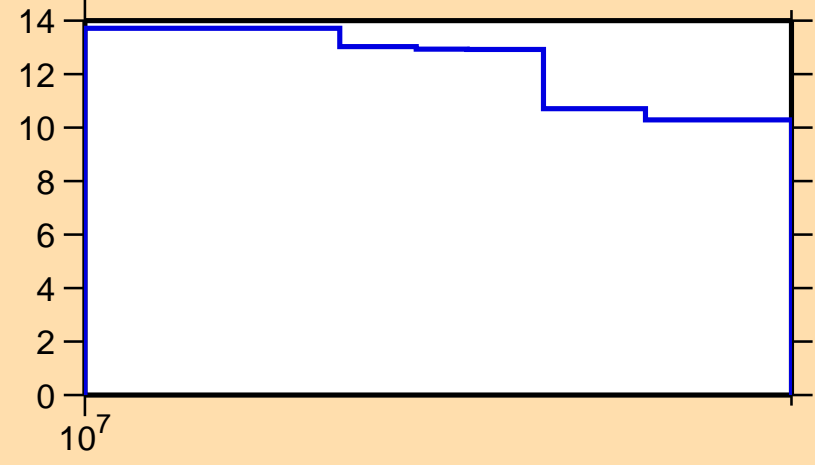



Correlation Matrix



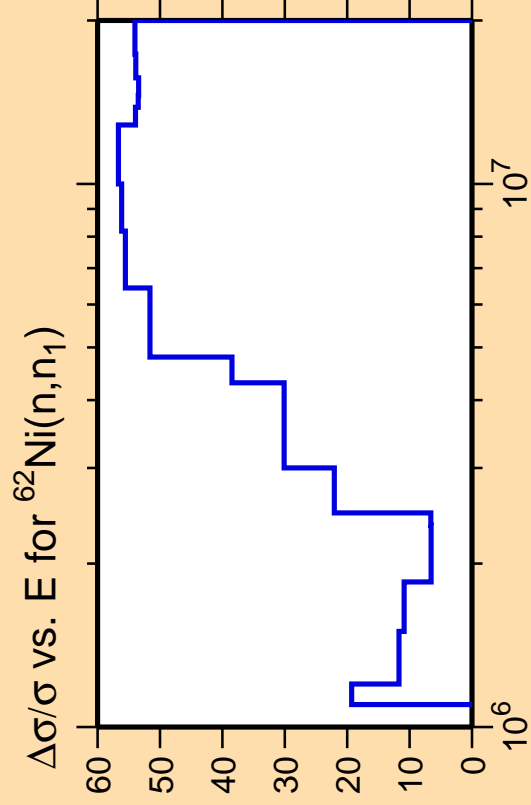

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

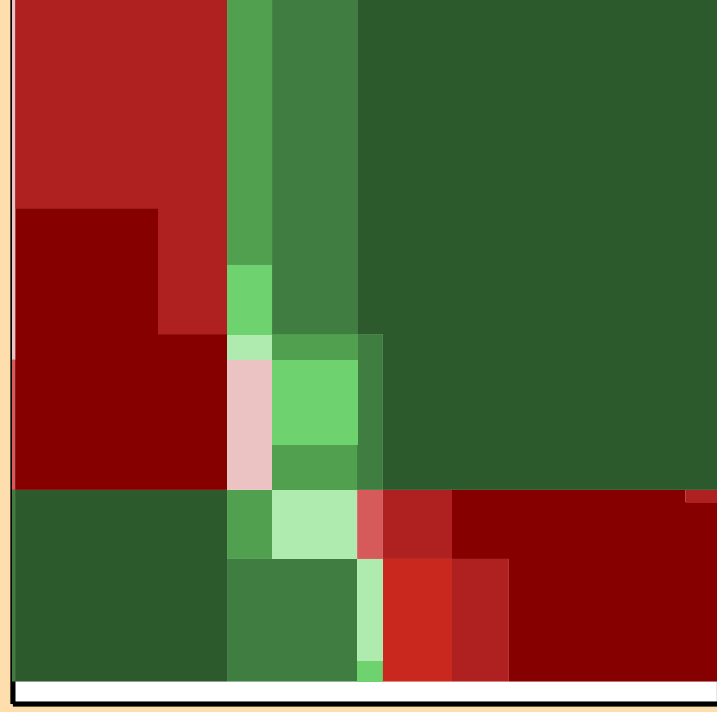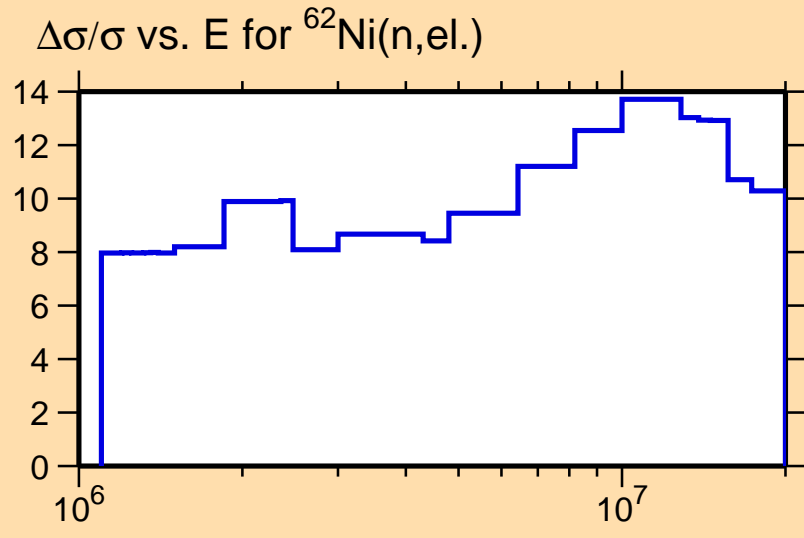

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,n\text{cont.})$

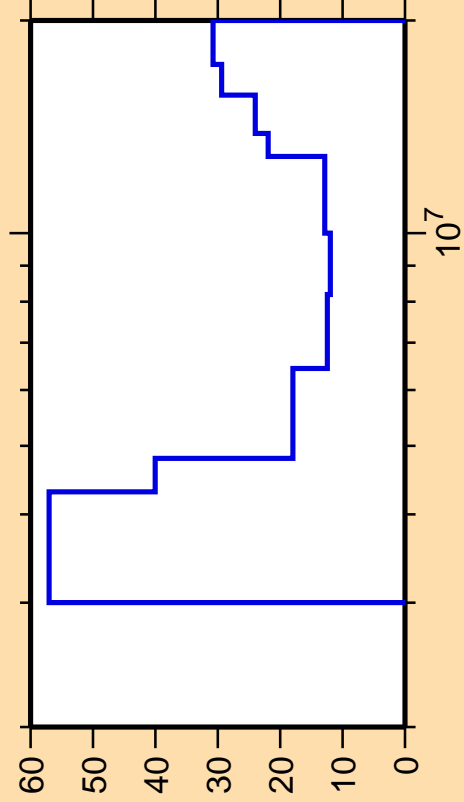

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,\text{el.})$

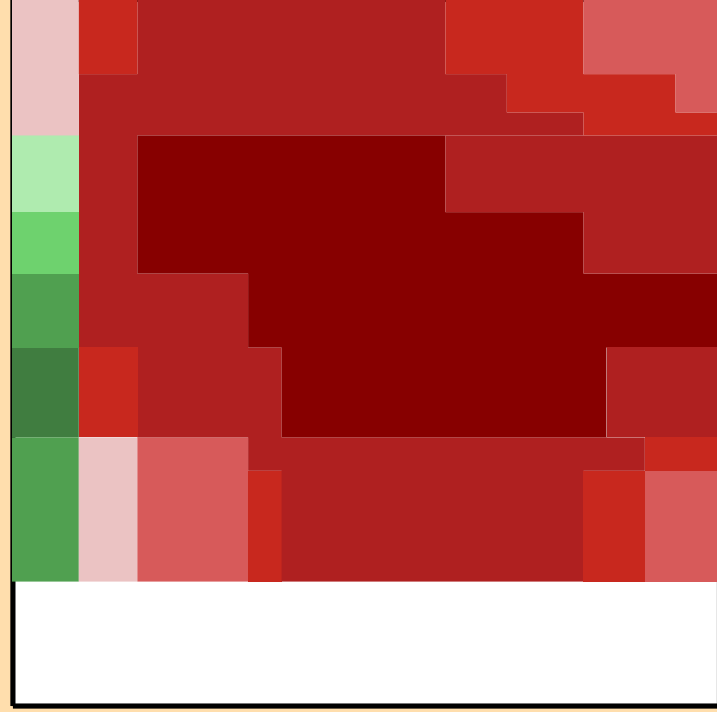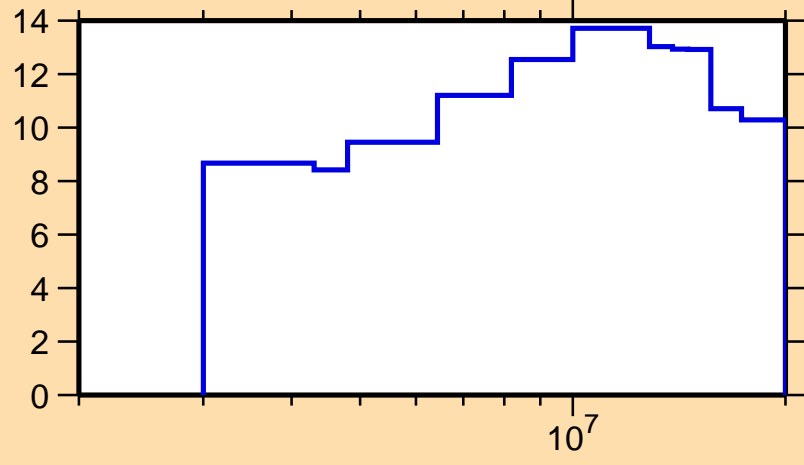

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,\gamma)$


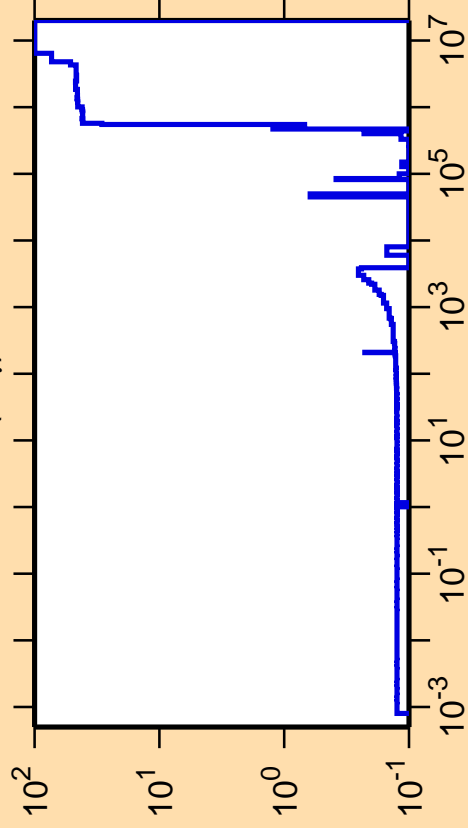


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.


$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,\text{el.})$

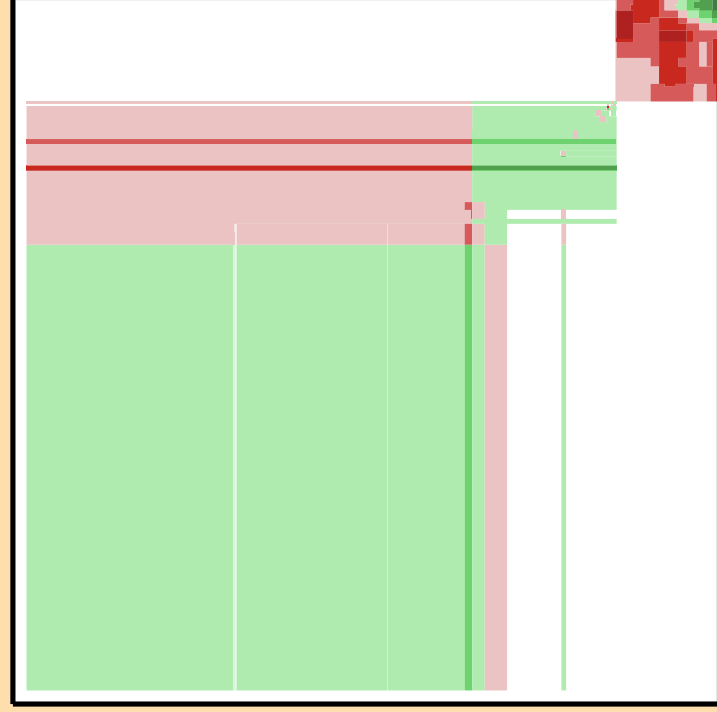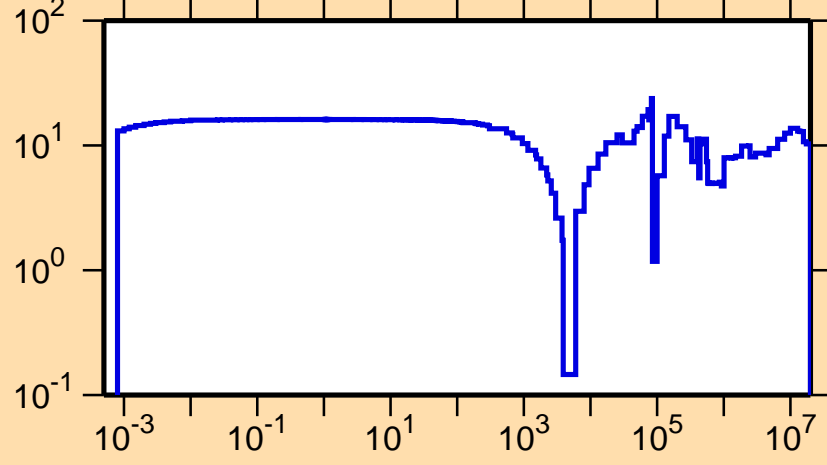

Correlation Matrix

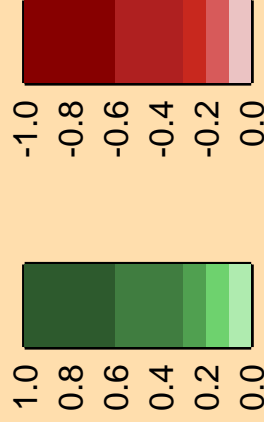



$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,p)$

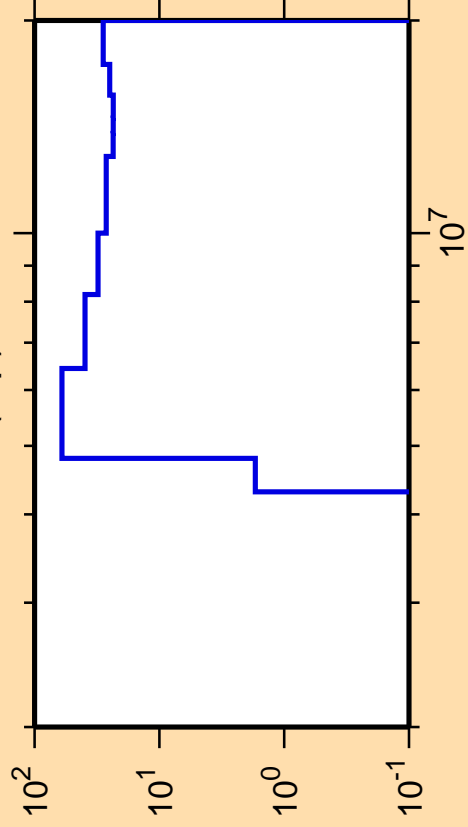


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,\text{el.})$

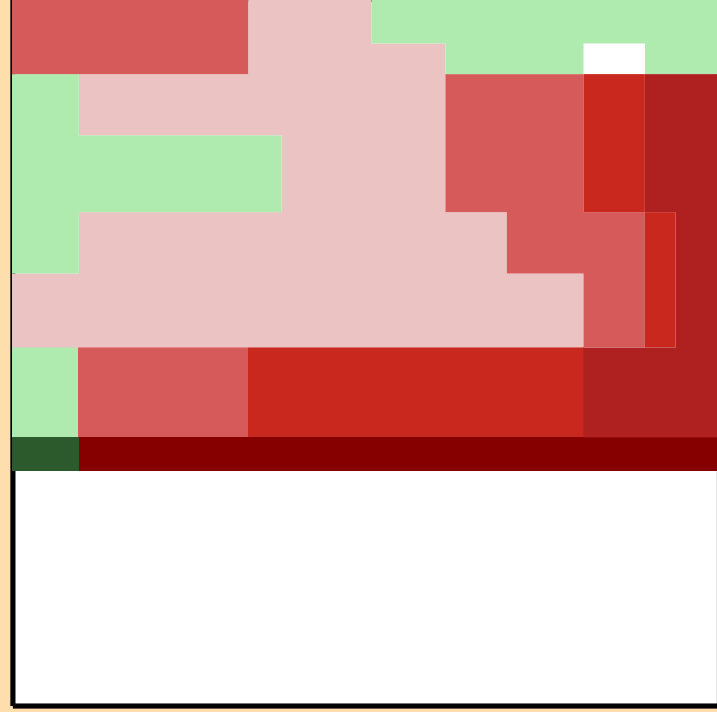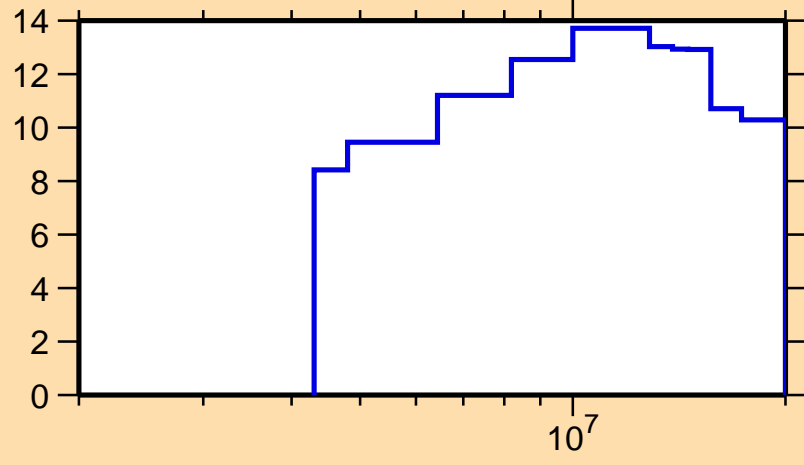

Correlation Matrix


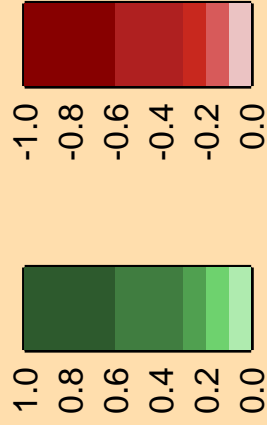


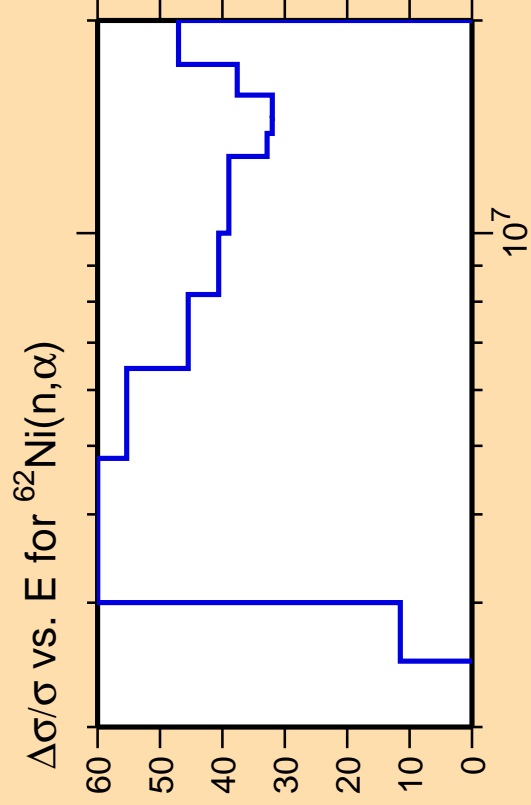

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

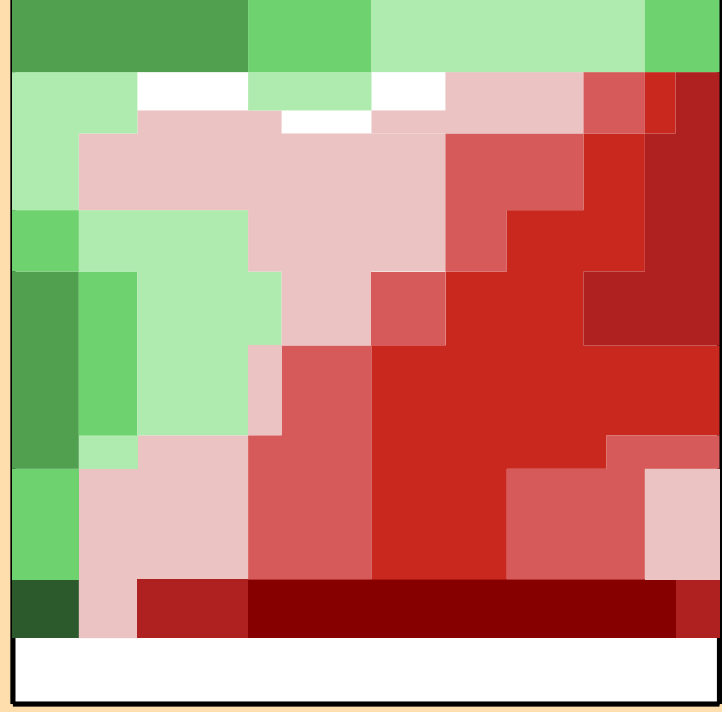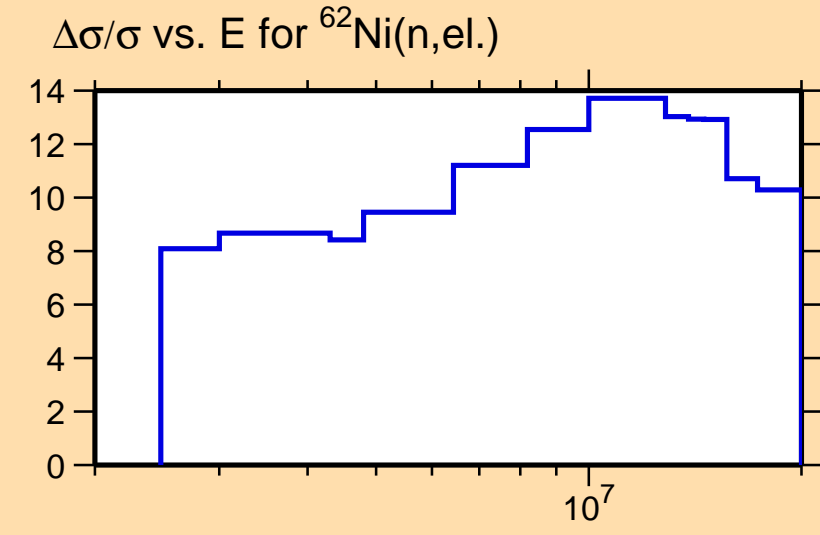

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,\text{nonel.})$

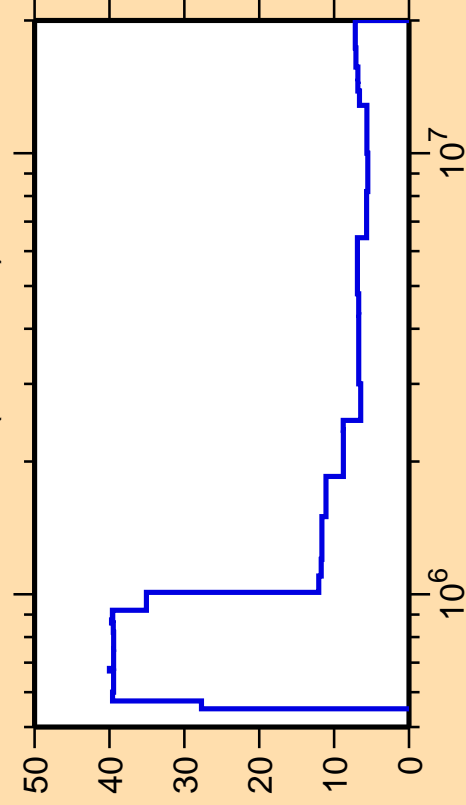


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


σ vs. E for $^{62}\text{Ni}(n,\text{nonel.})$

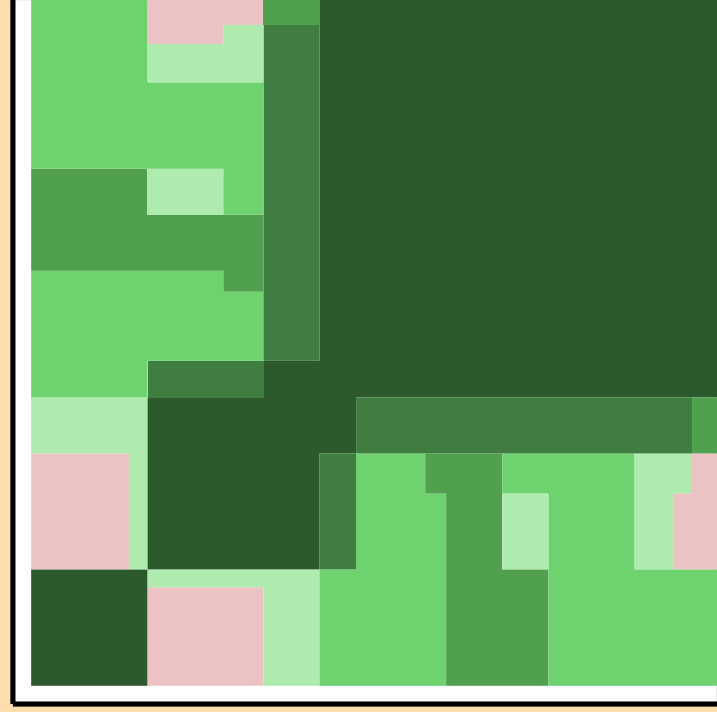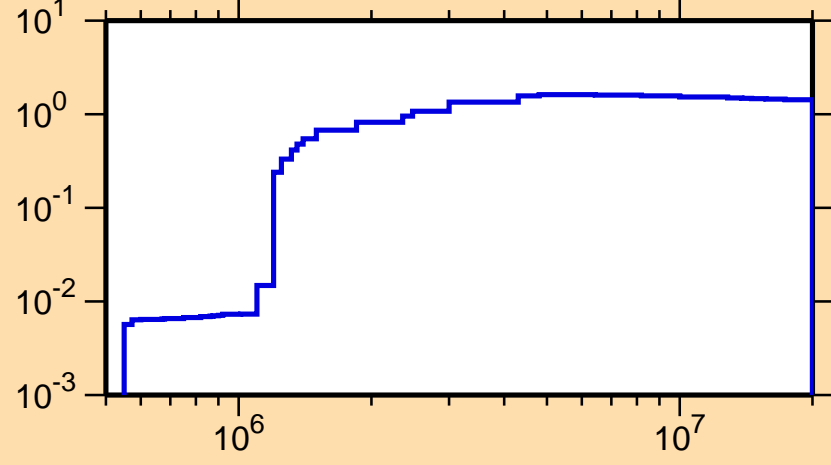

Correlation Matrix

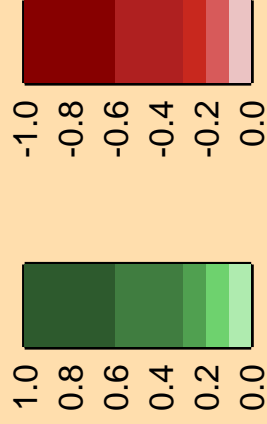



$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,\text{inel.})$

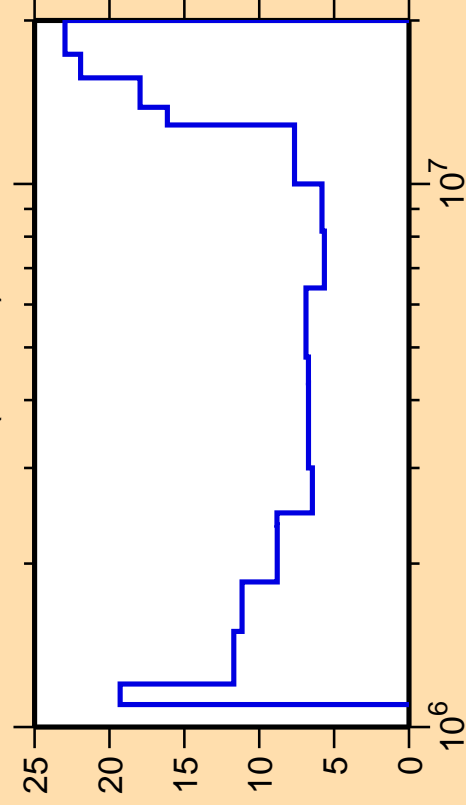

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,\text{nonel.})$

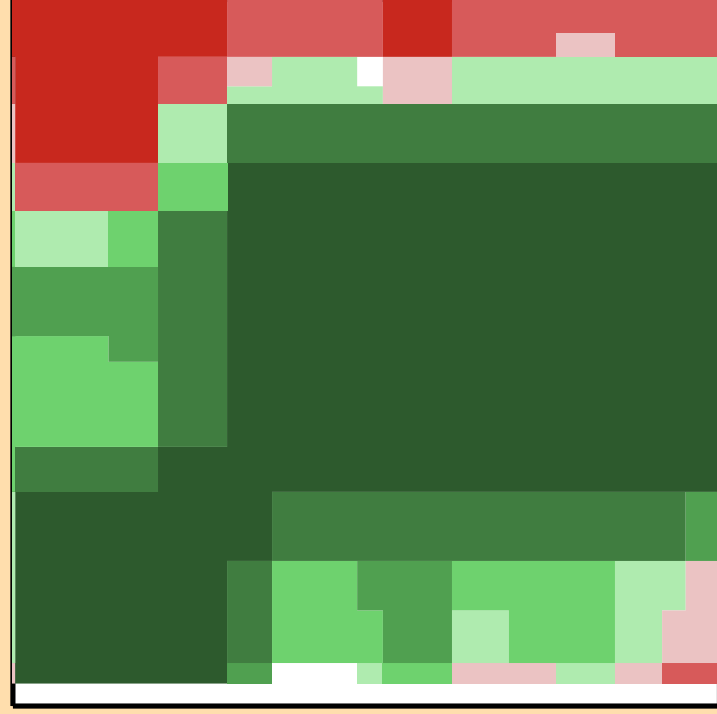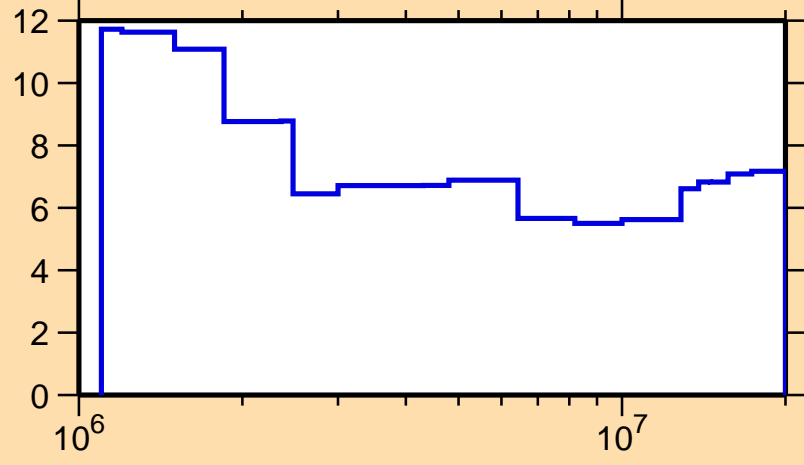

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,2n)$

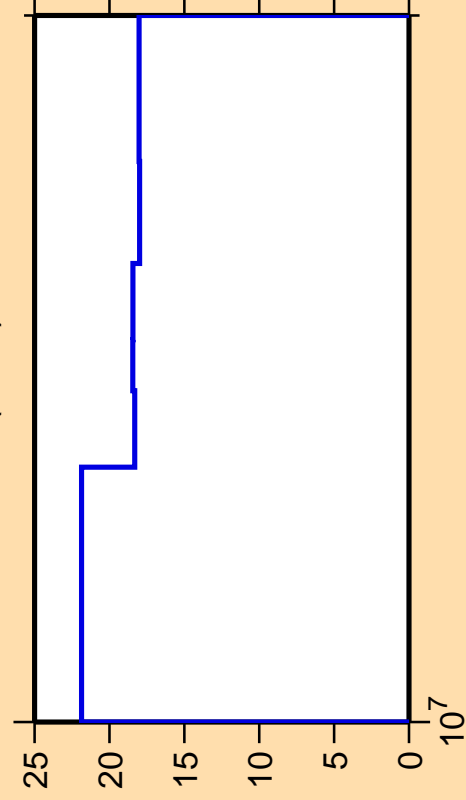


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,\text{nonel.})$

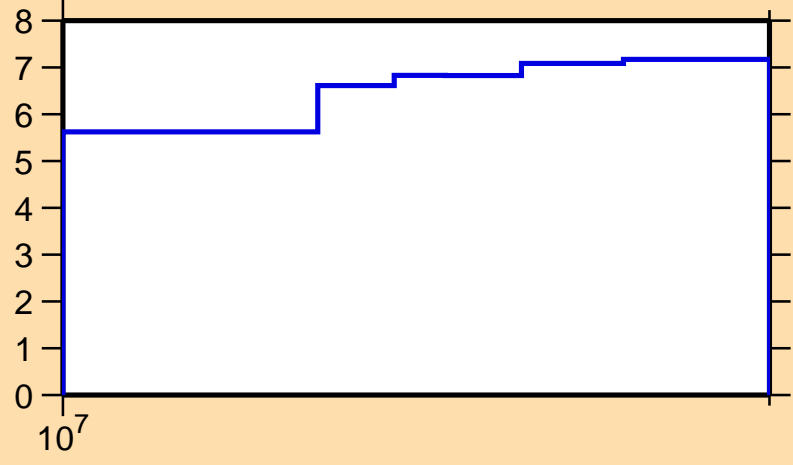



Correlation Matrix

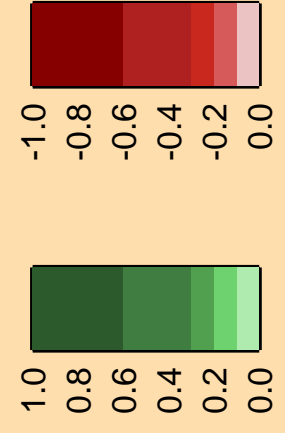

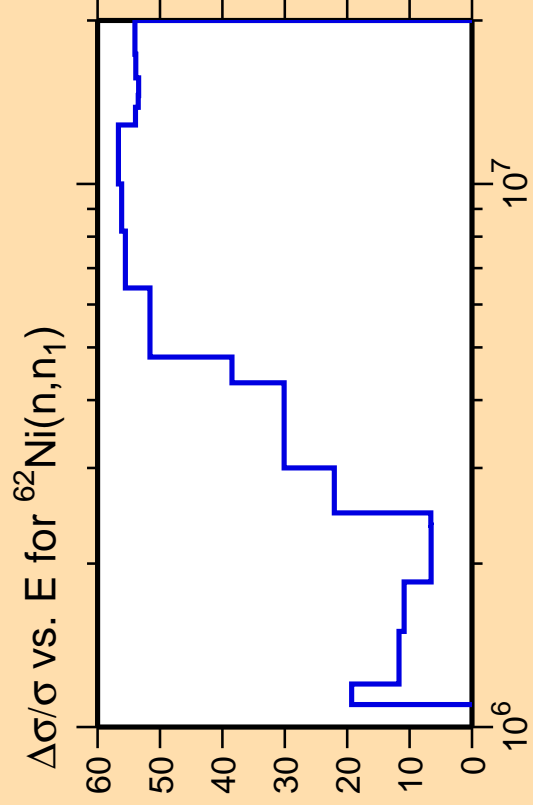

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

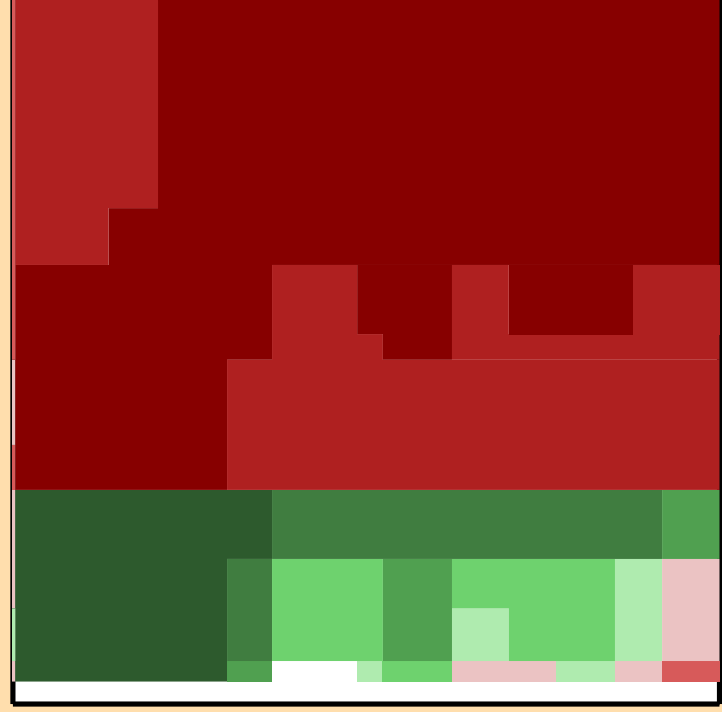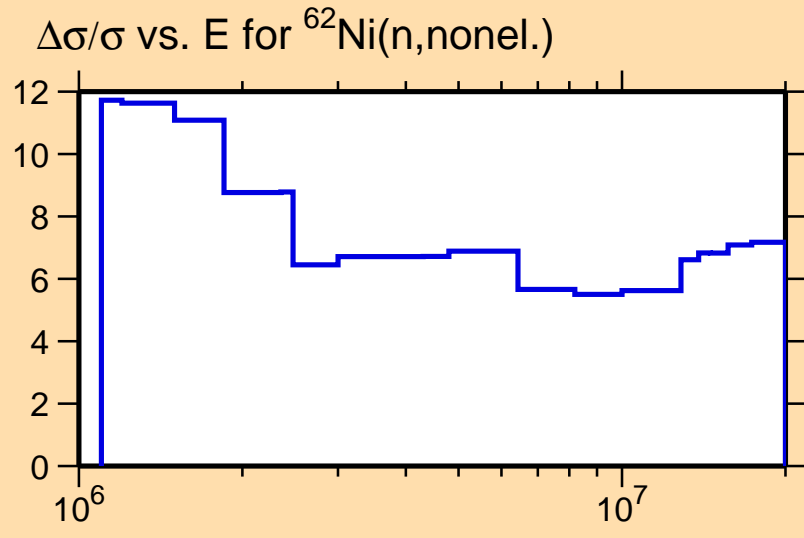

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,n\text{cont.})$

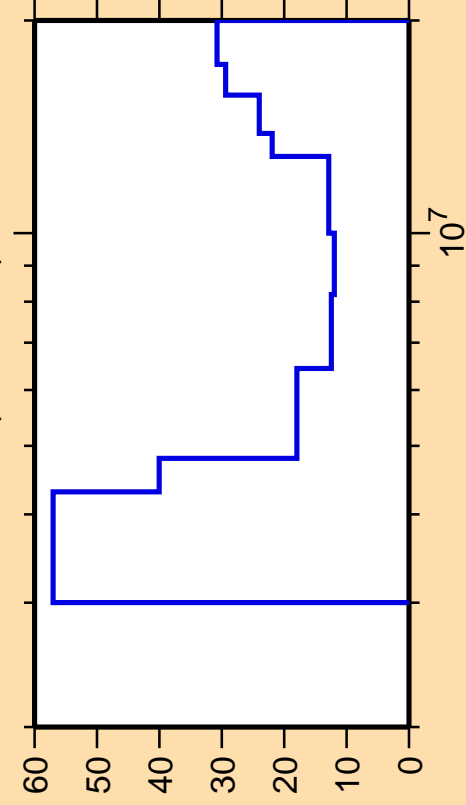

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,\text{nonel.})$

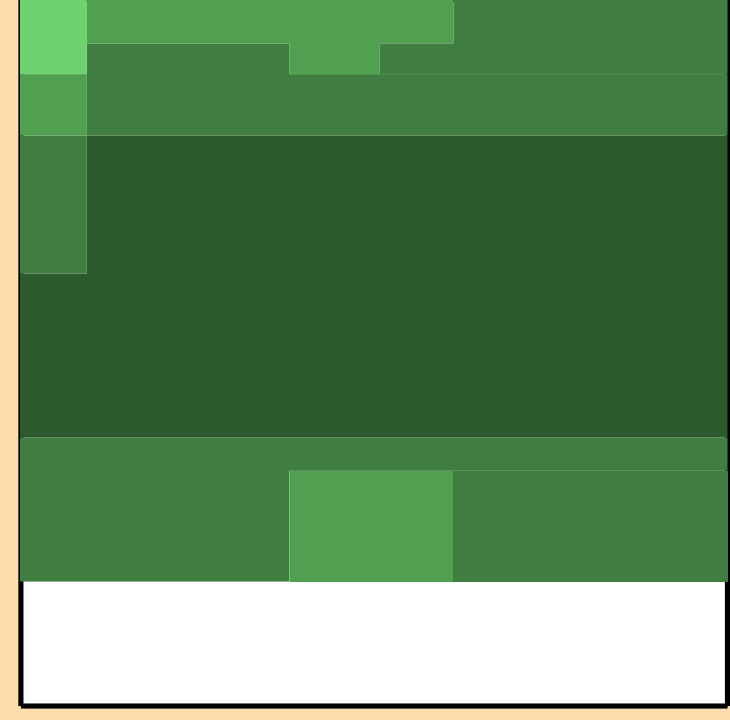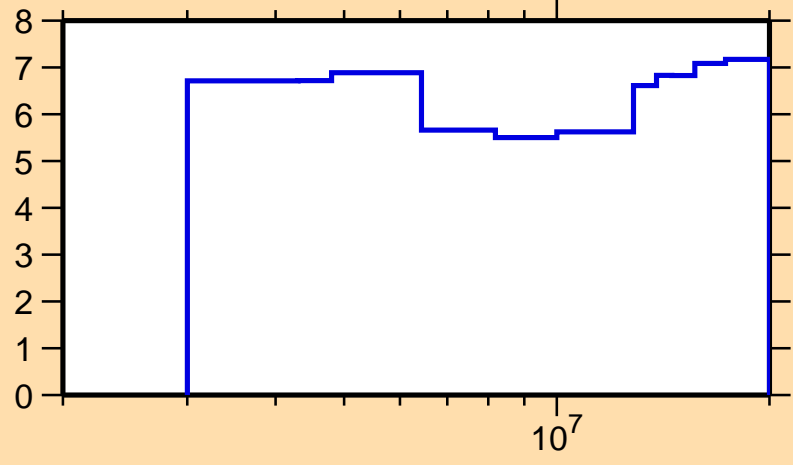

Correlation Matrix





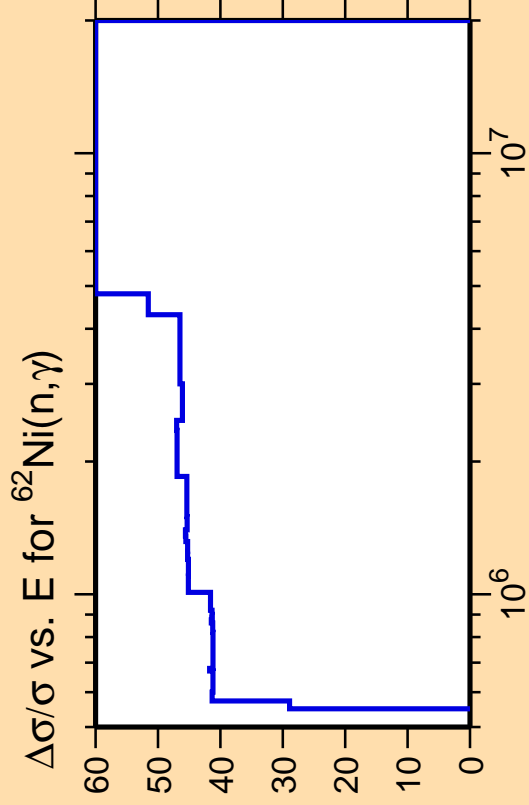

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

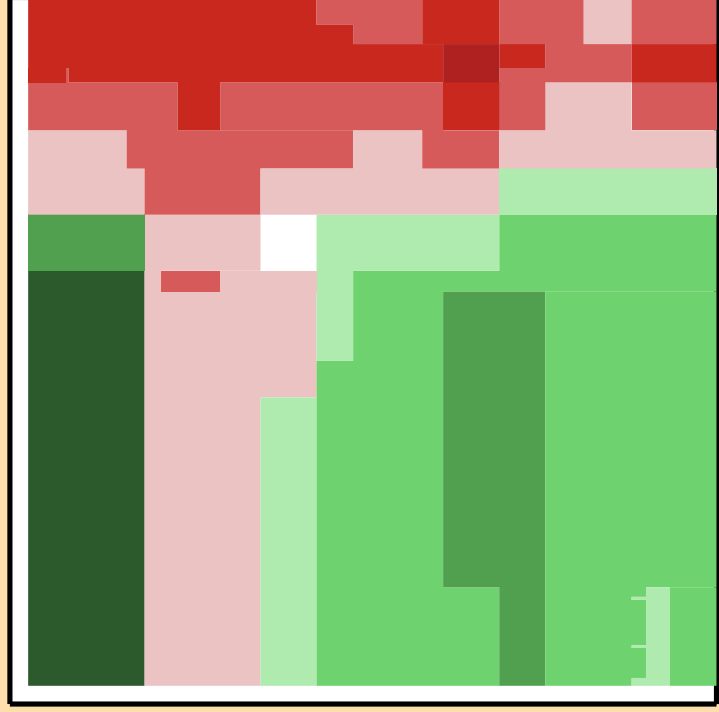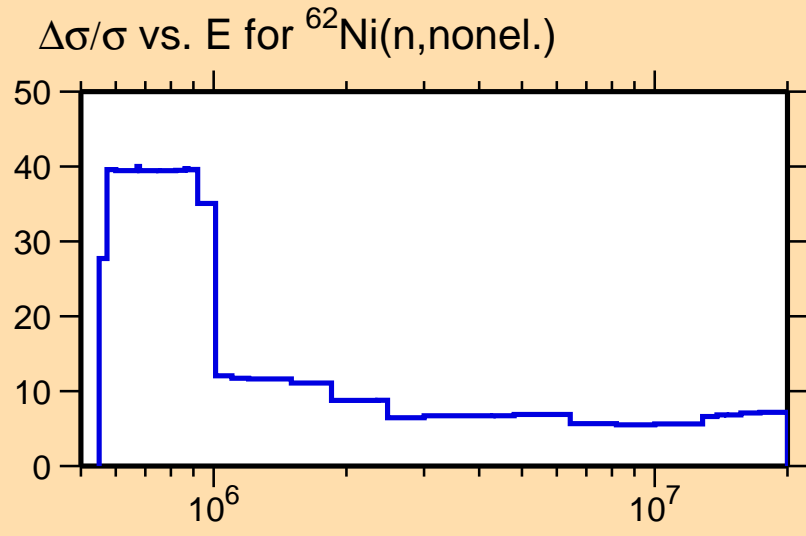

Correlation Matrix




$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,p)$

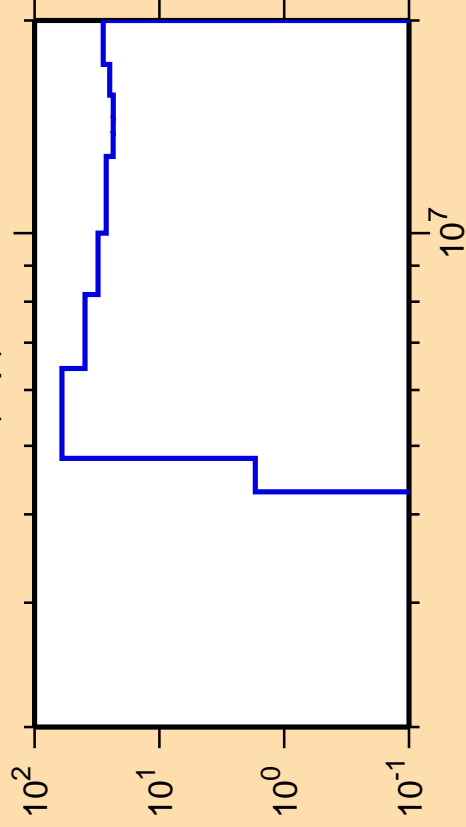


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,\text{nonel.})$

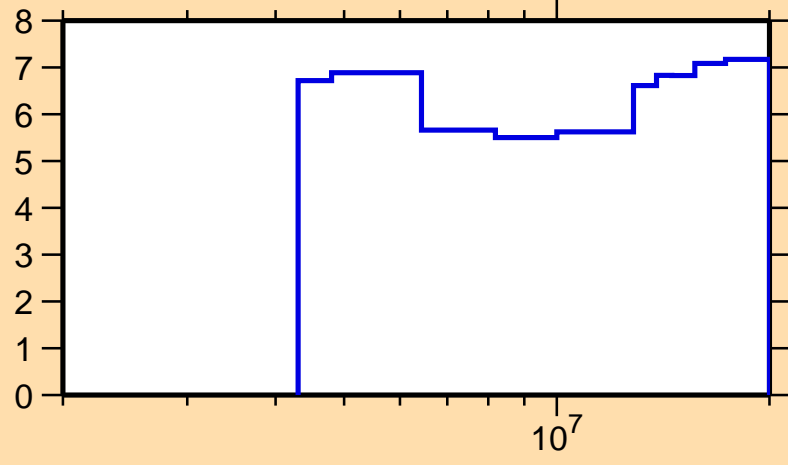

Correlation Matrix

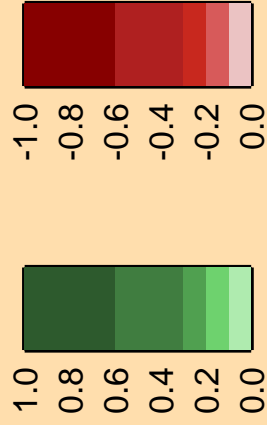


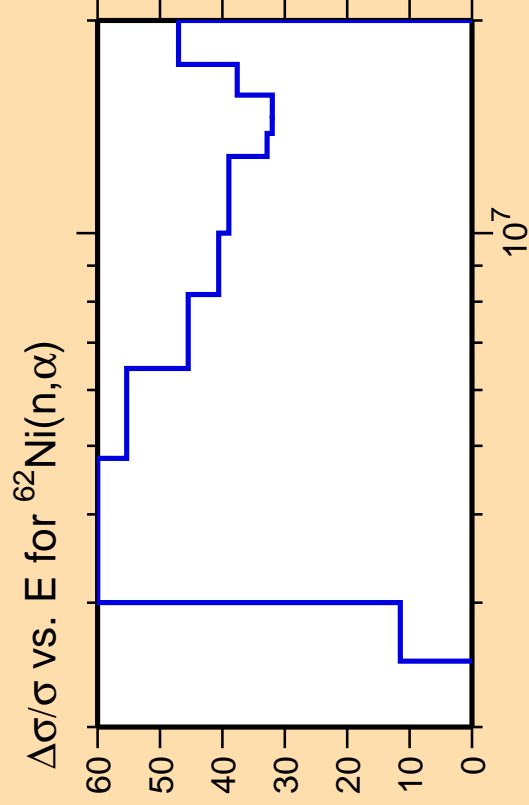


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.


$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,\text{nonel.})$

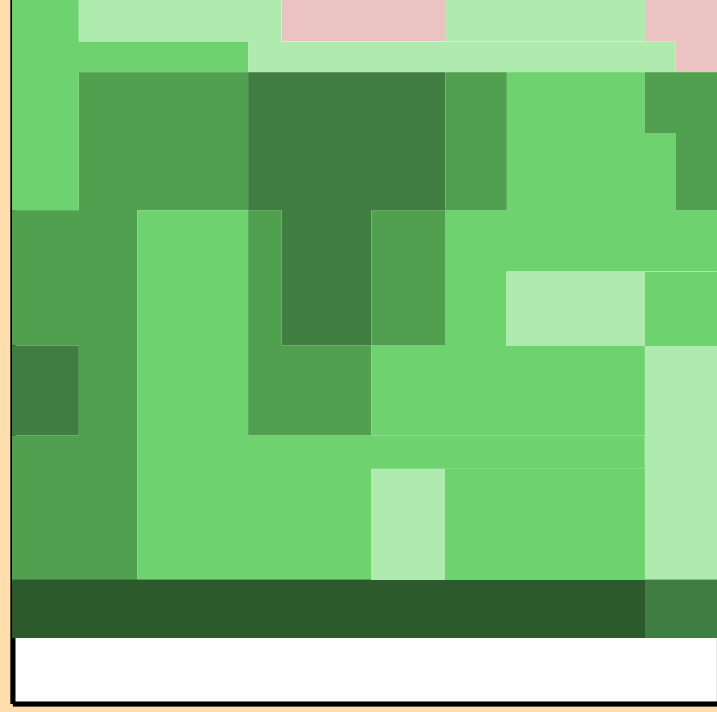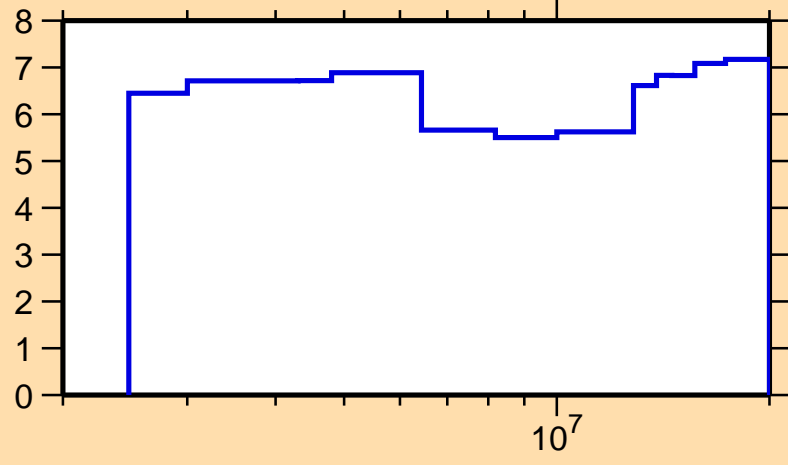

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,\text{inel.})$

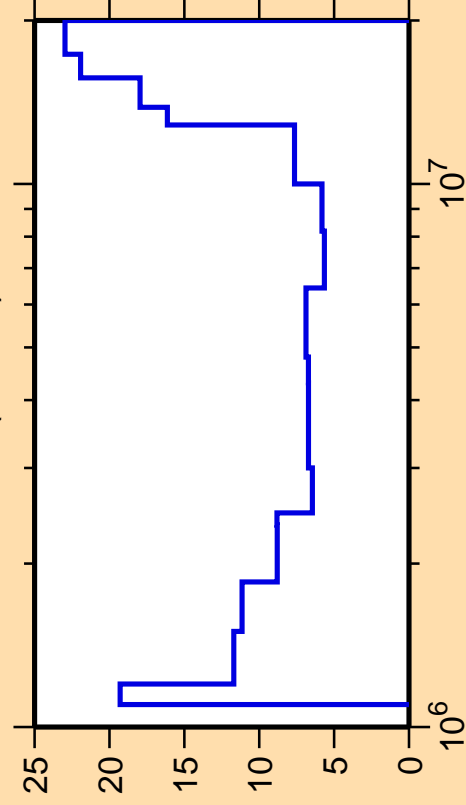

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


σ vs. E for $^{62}\text{Ni}(n,\text{inel.})$

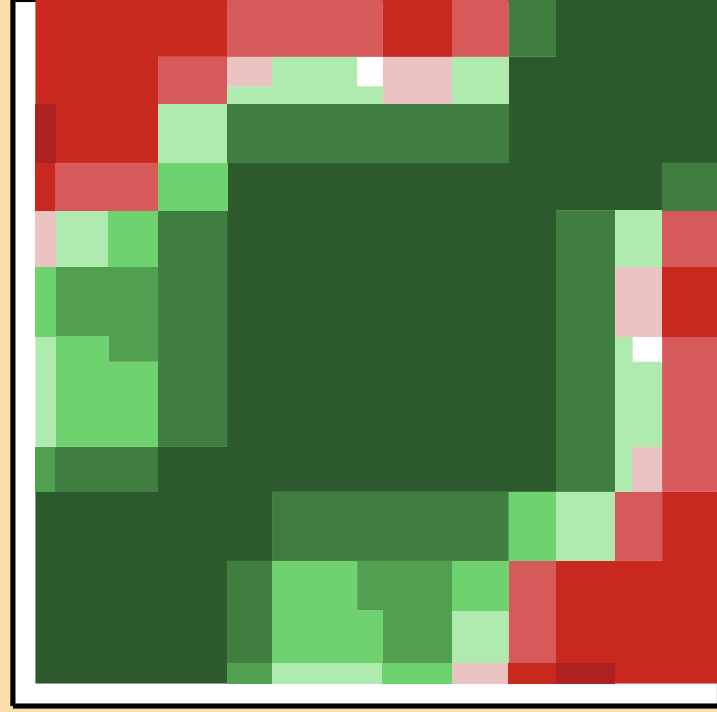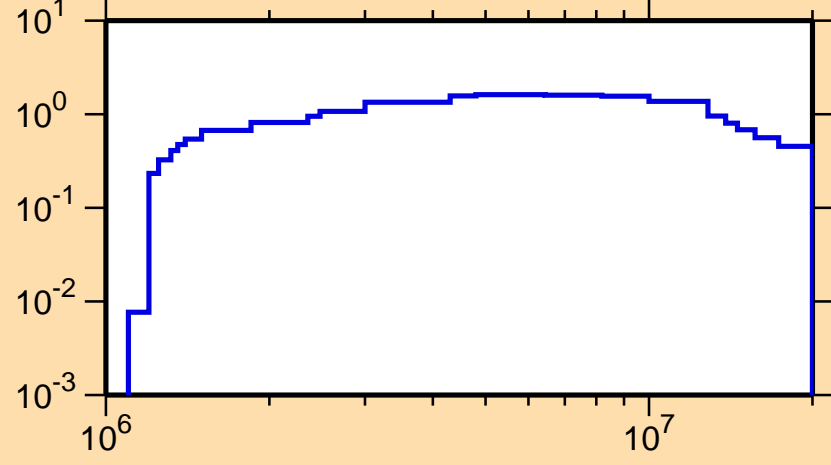

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,2n)$

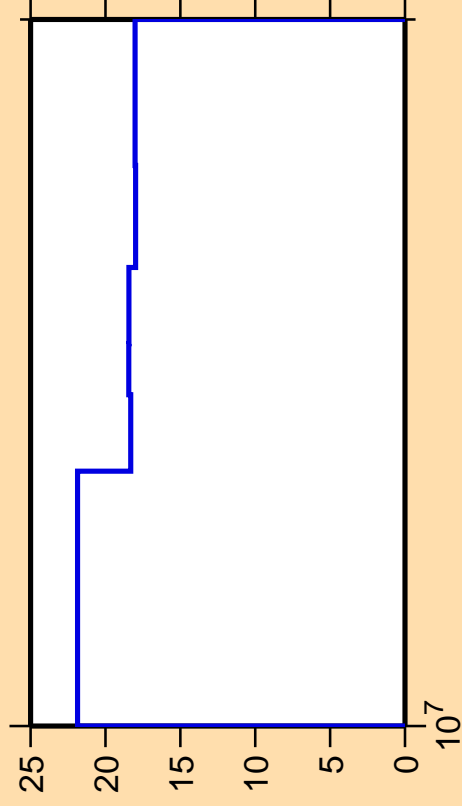


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,\text{inel.})$

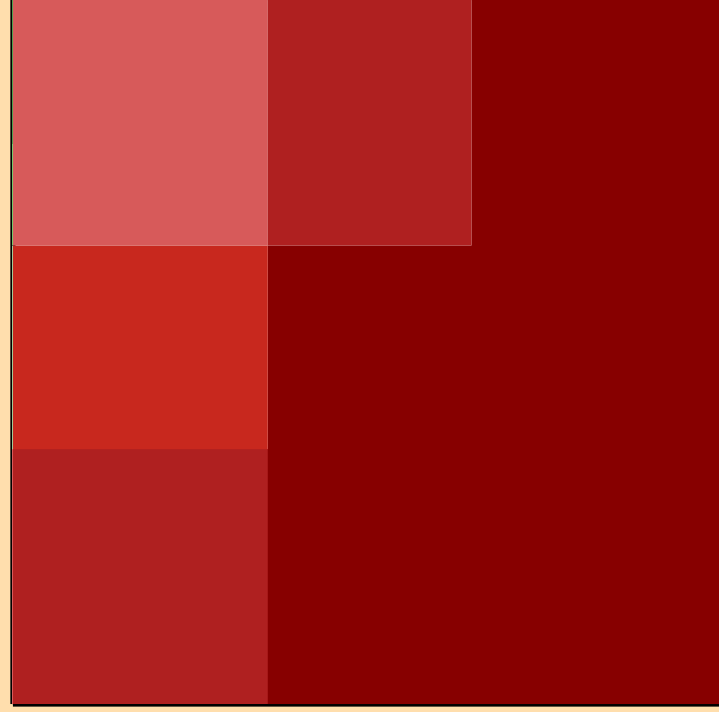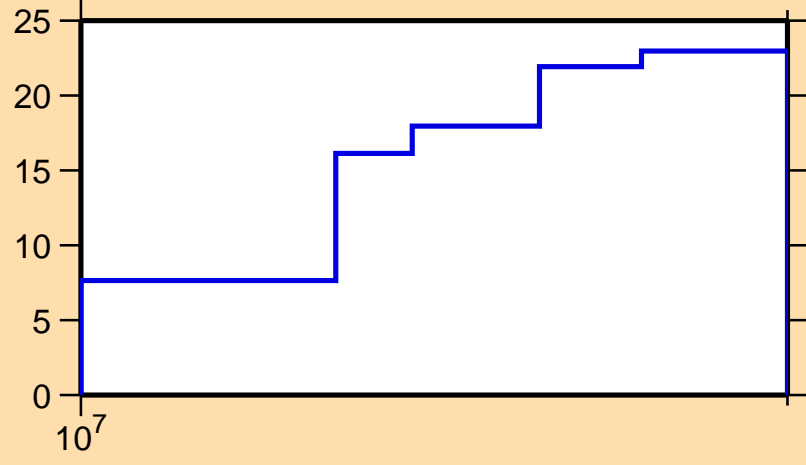

Correlation Matrix


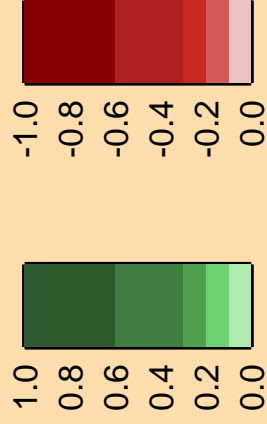


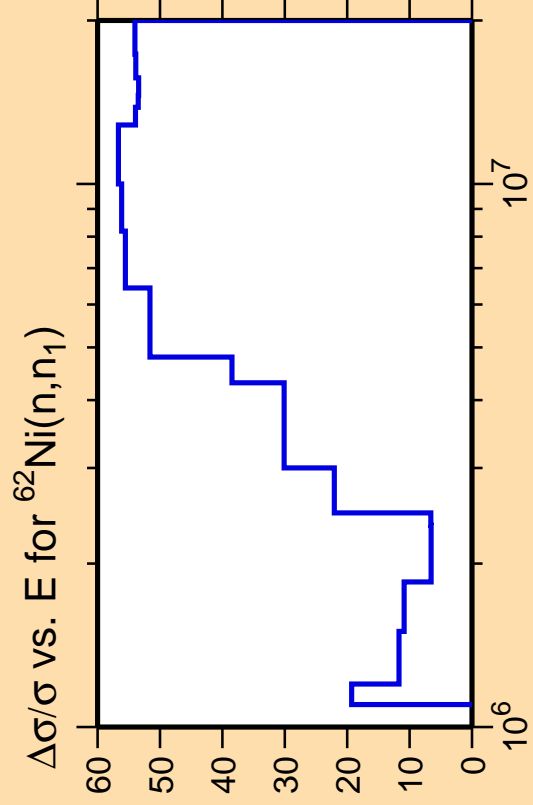


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,\text{inel.})$

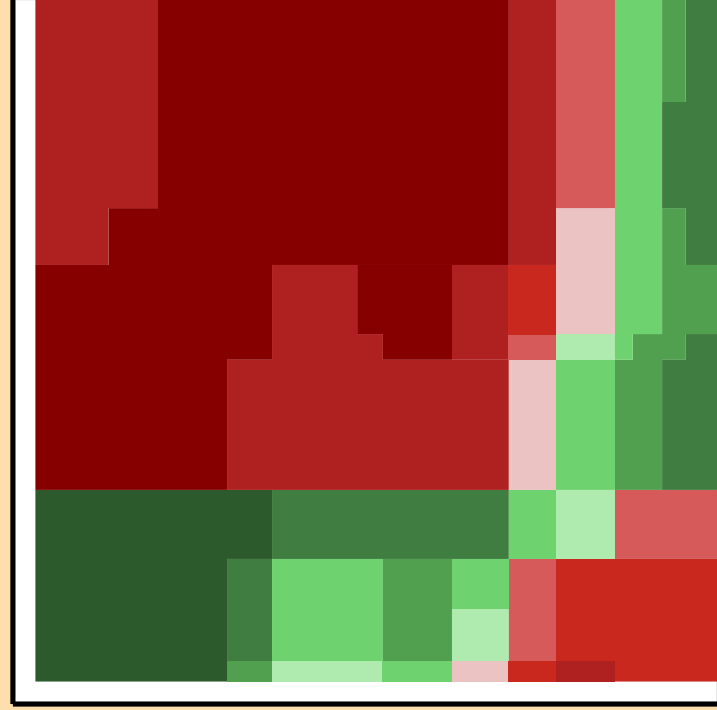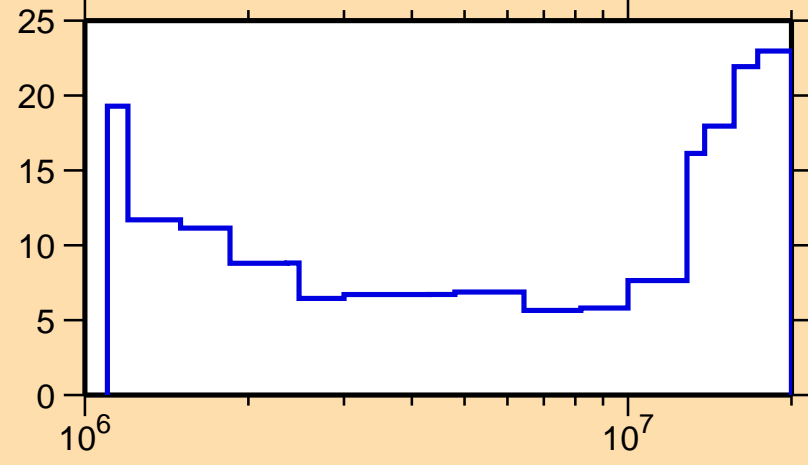

Correlation Matrix

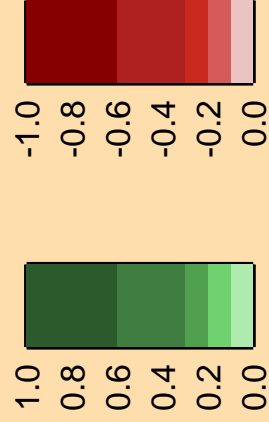



$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,n\text{cont.})$

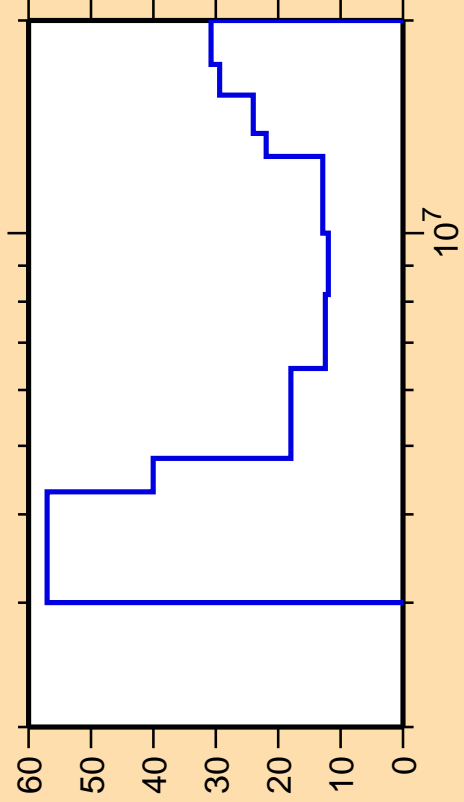


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,\text{inel.})$

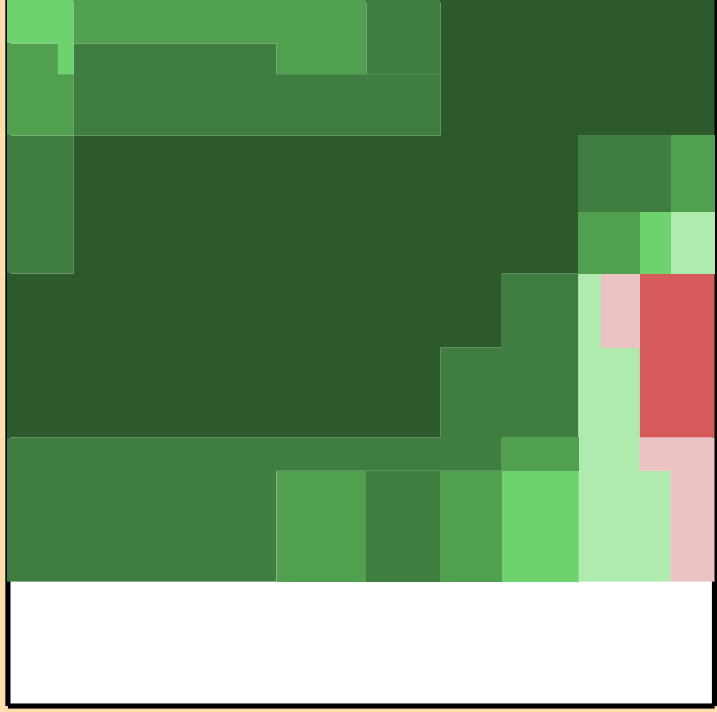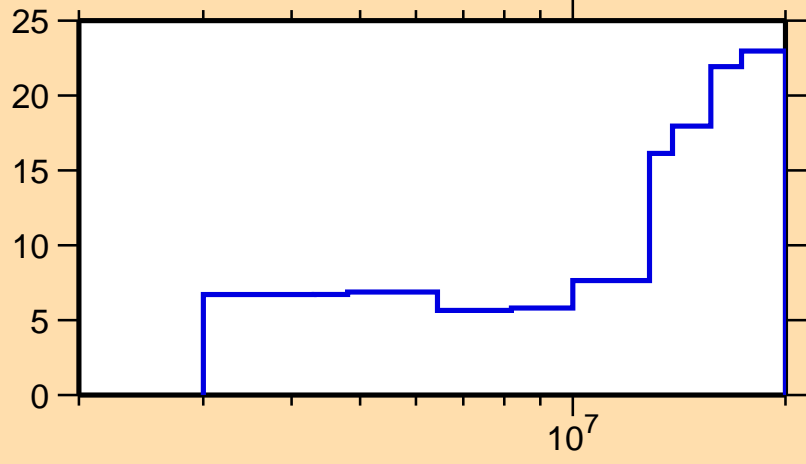

Correlation Matrix


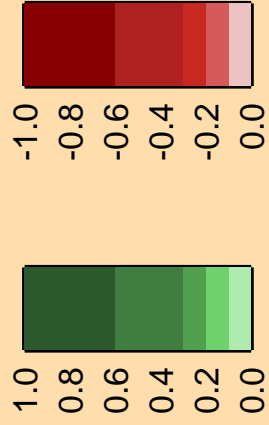


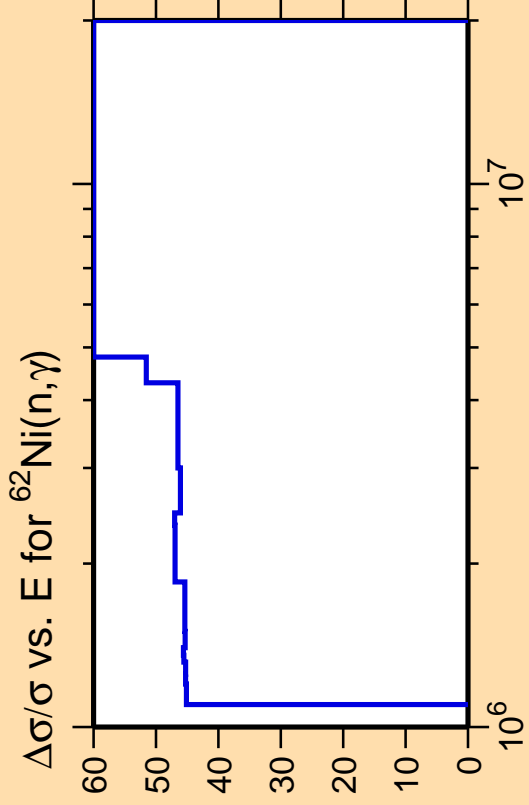

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

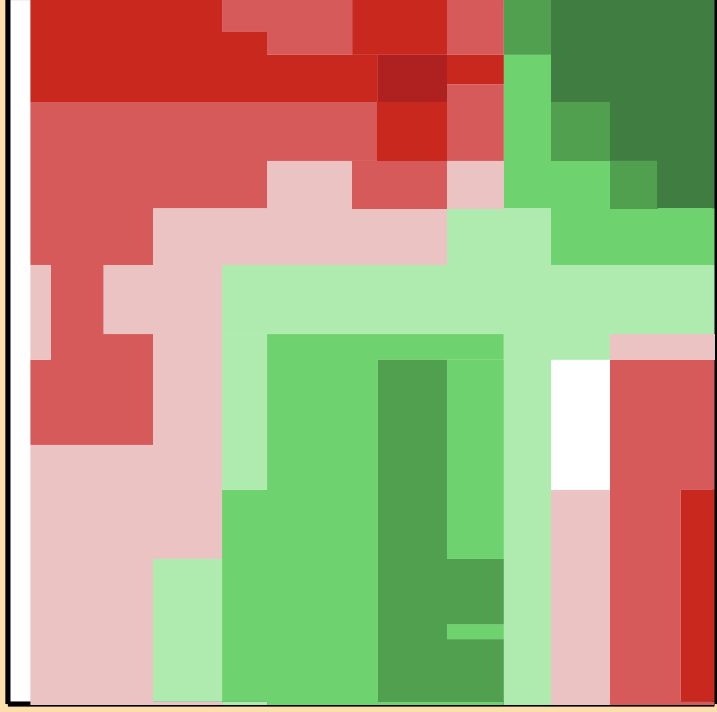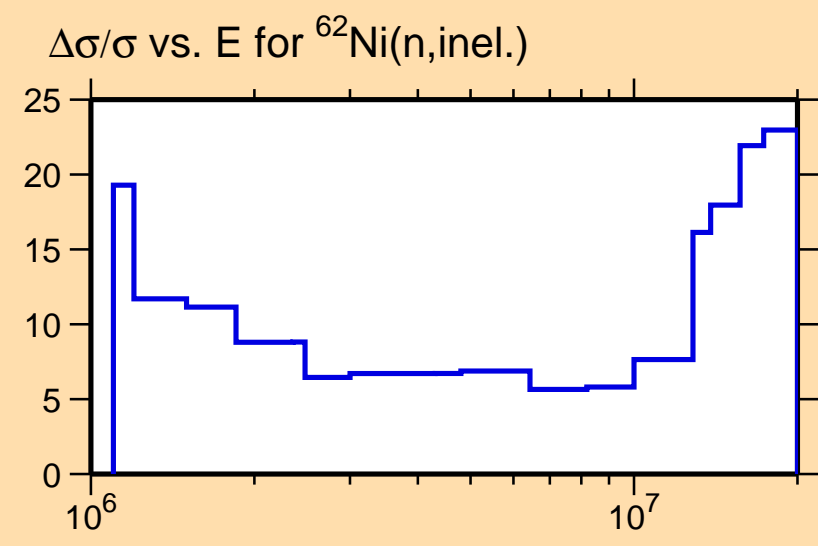

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,p)$

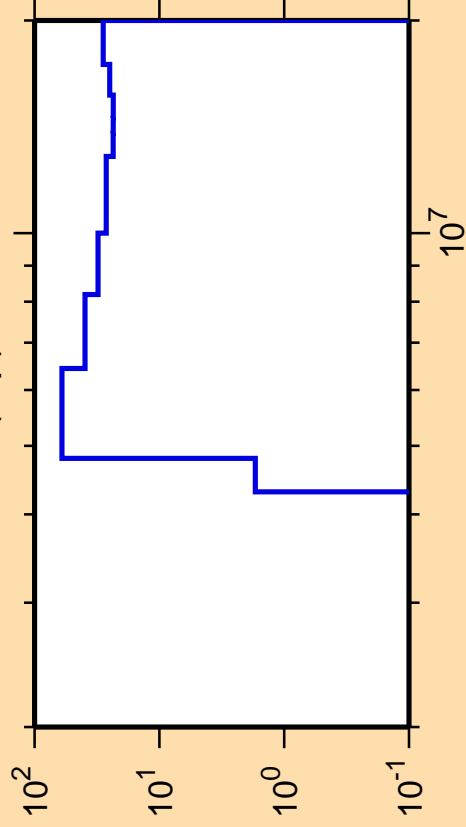

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,\text{inel.})$

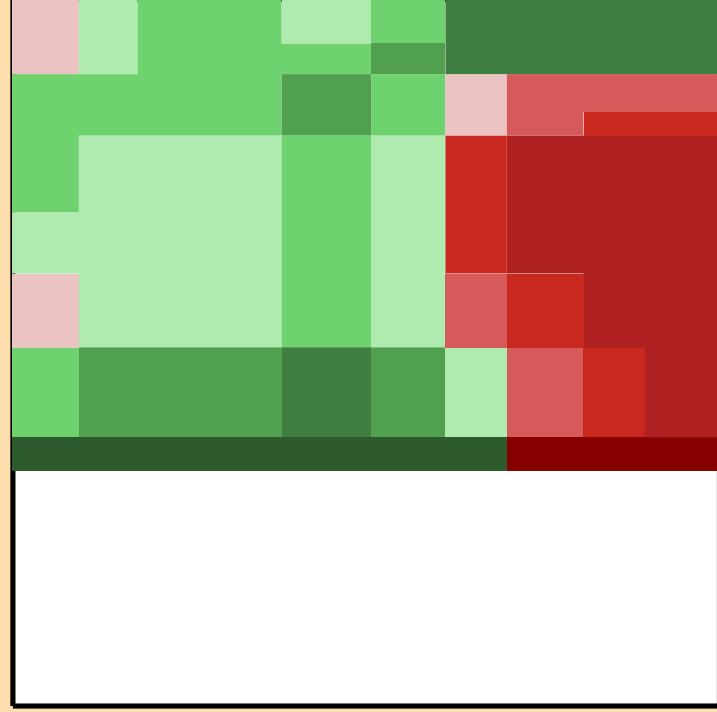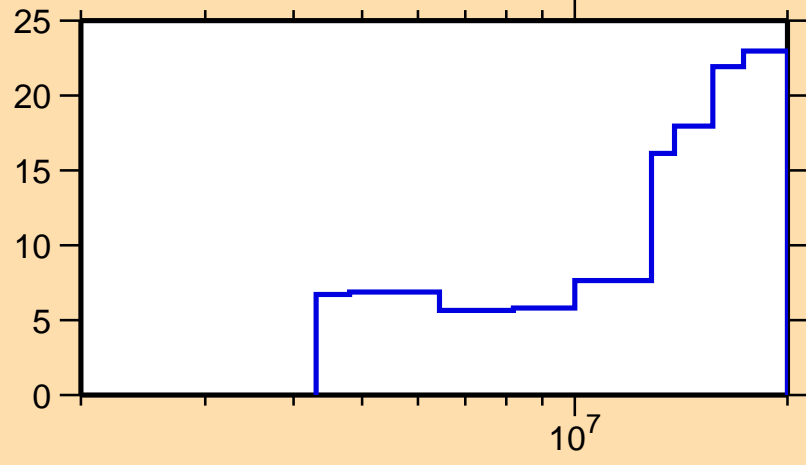

Correlation Matrix





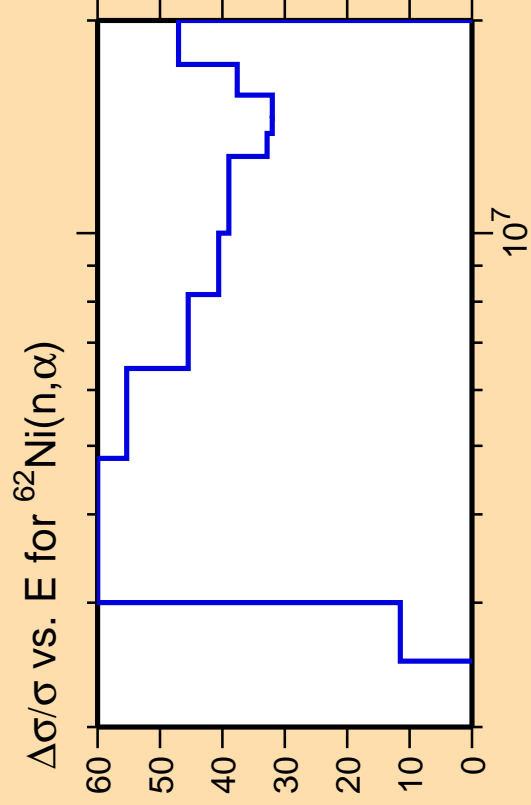

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

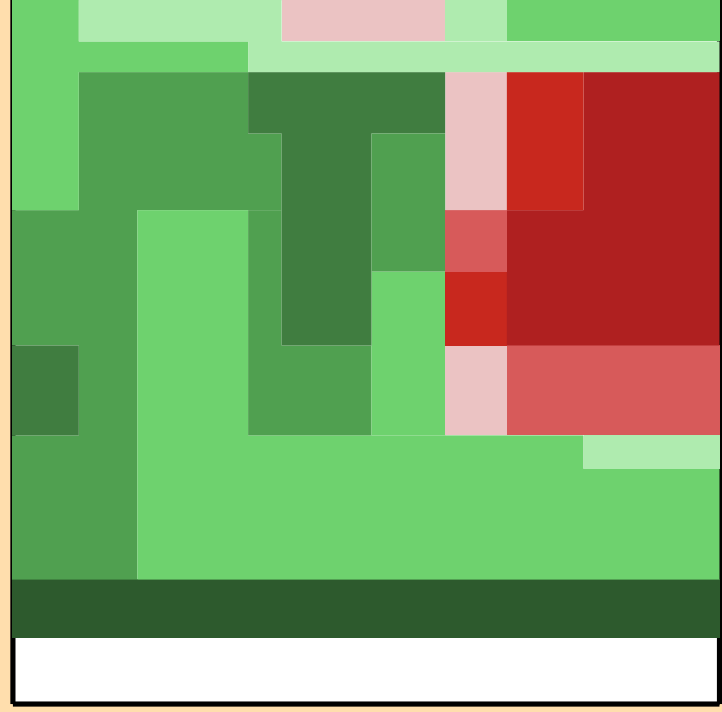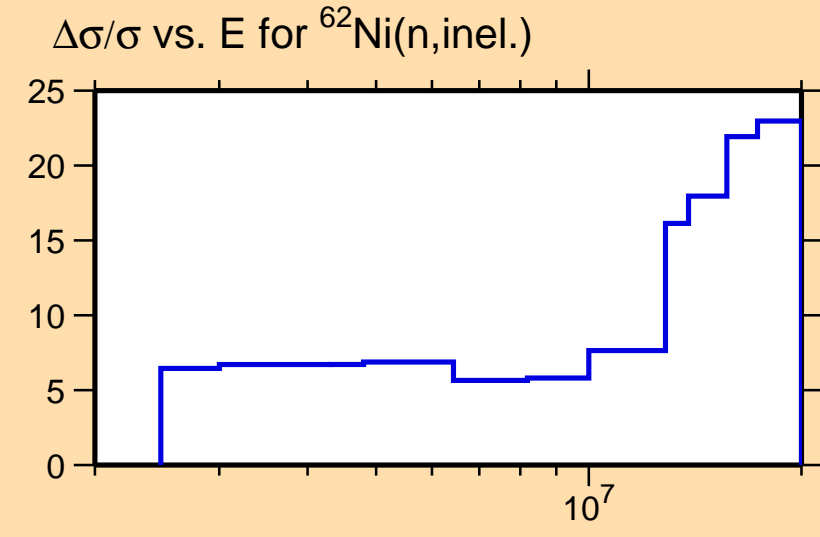

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,2n)$

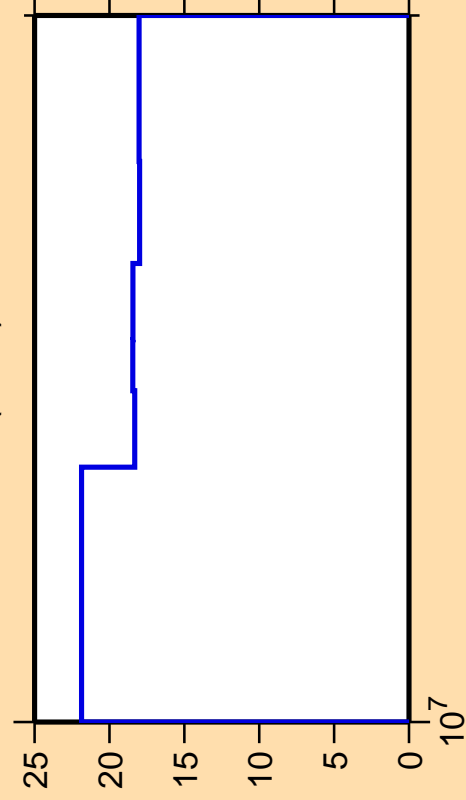

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


σ vs. E for $^{62}\text{Ni}(n,2n)$

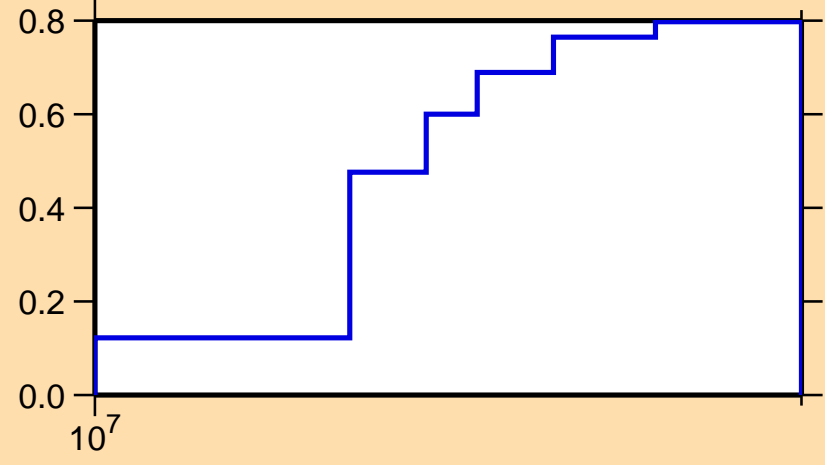

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,n_1)$

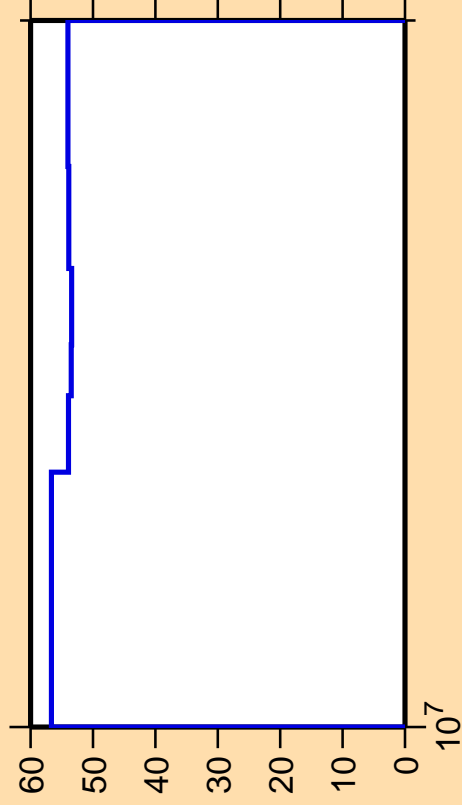

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,2n)$

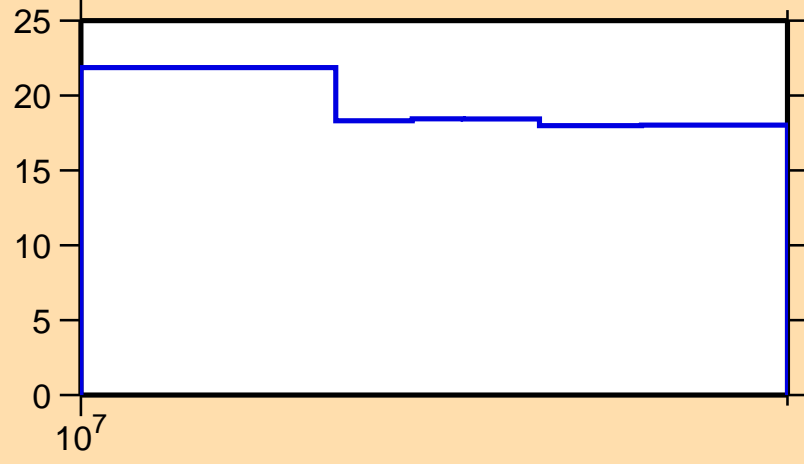

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,n\text{cont.})$

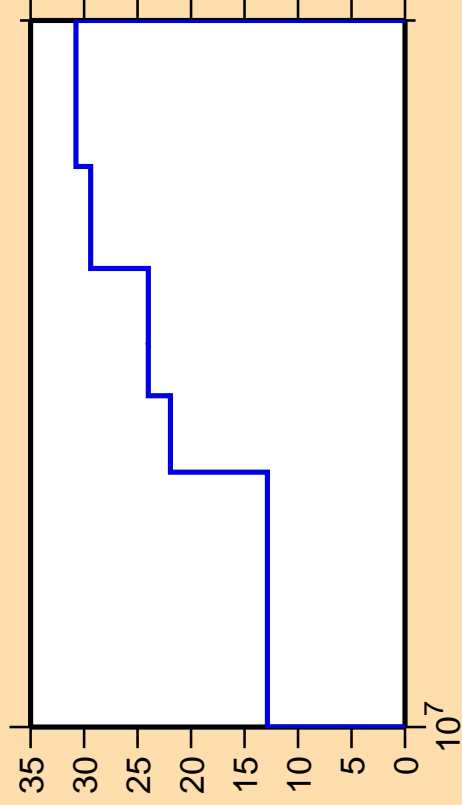

Ordinate scale is %
relative standard deviation.

Abcissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,2n)$

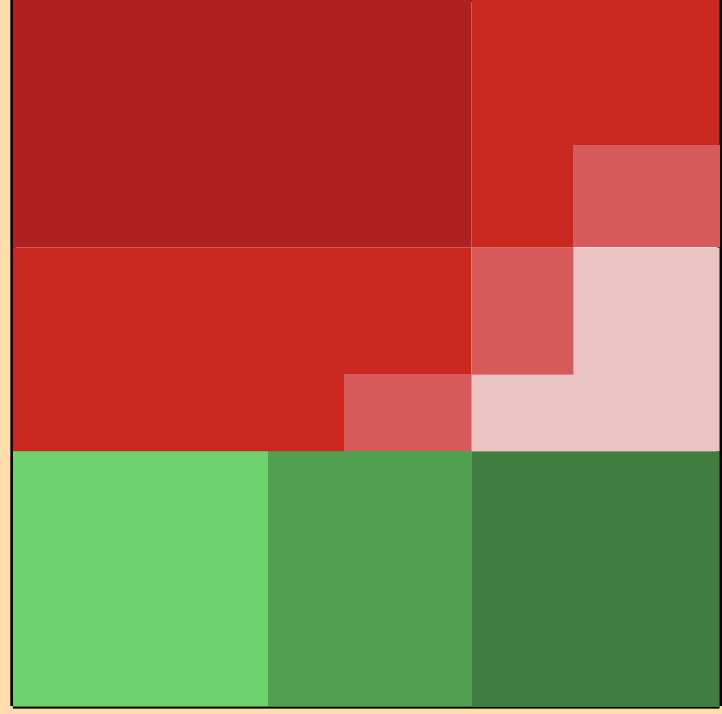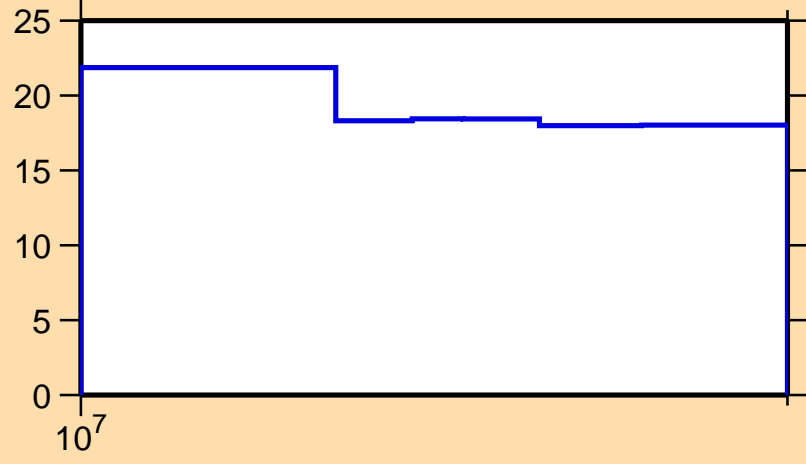

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,\gamma)$

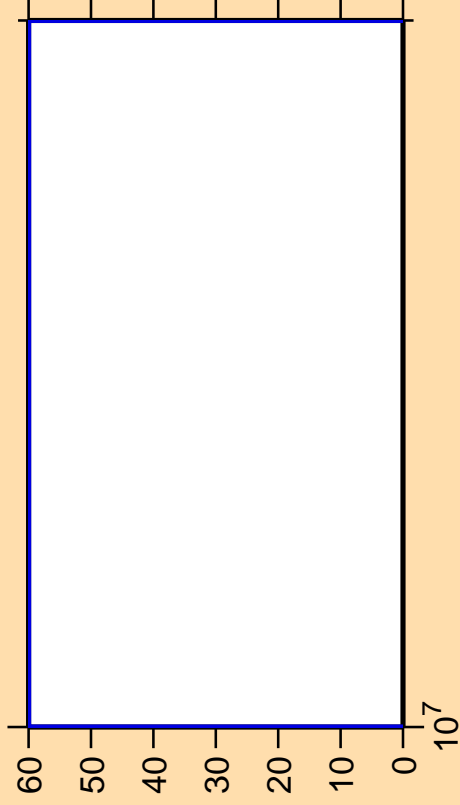


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.


$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,2n)$

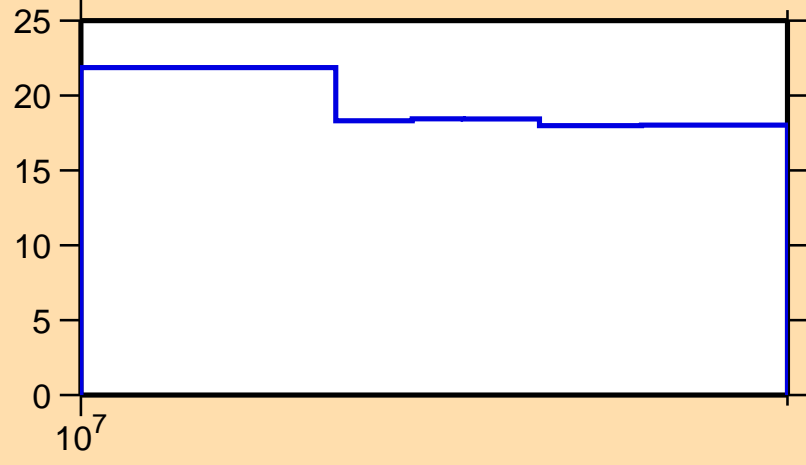

Correlation Matrix

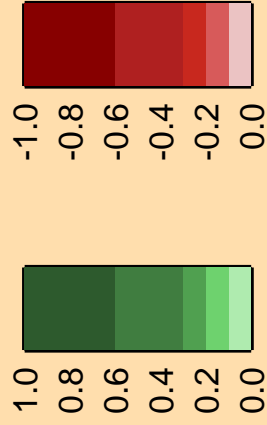



$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,p)$

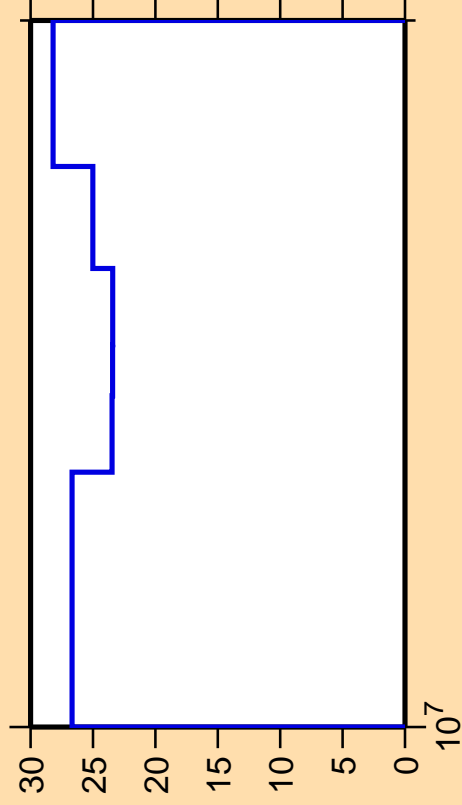

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,2n)$

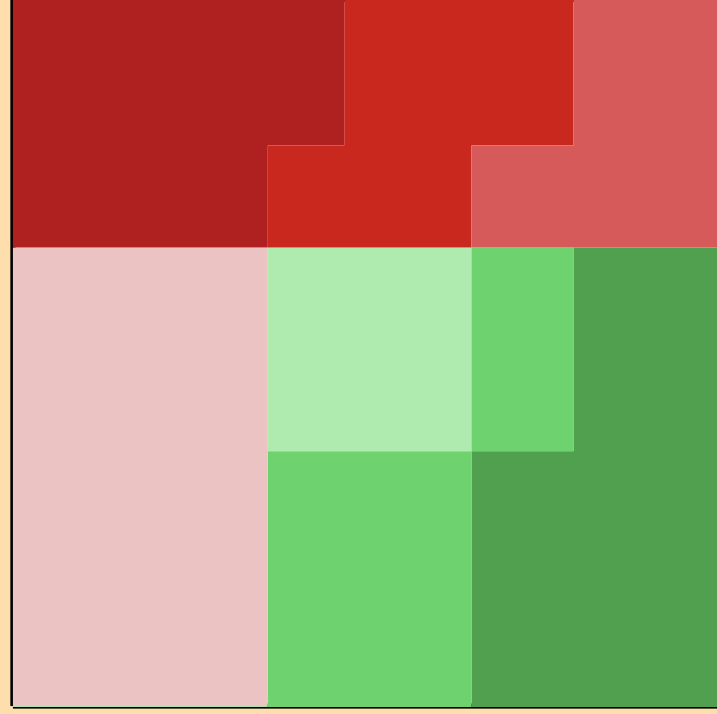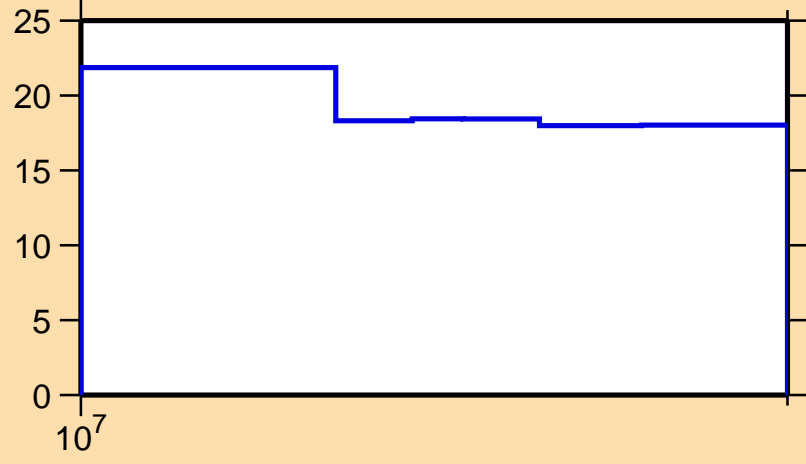

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,\alpha)$

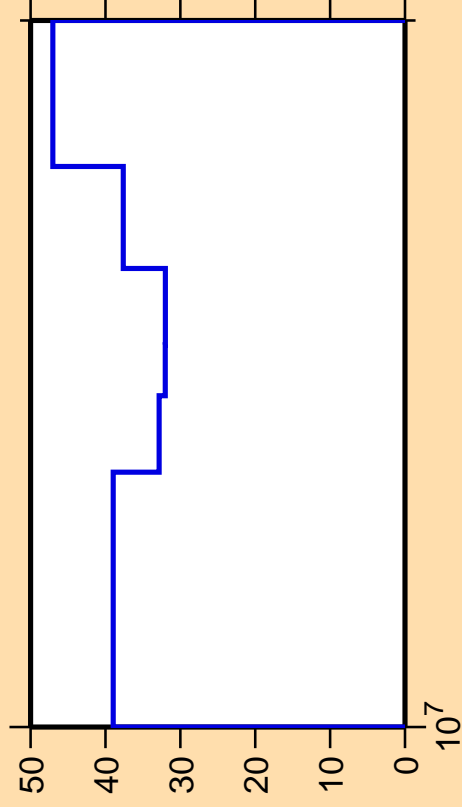


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,2n)$

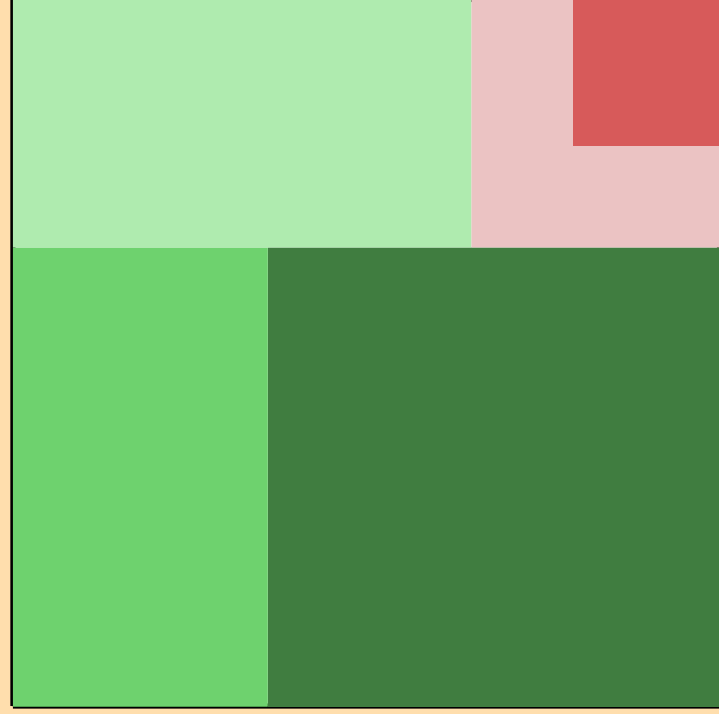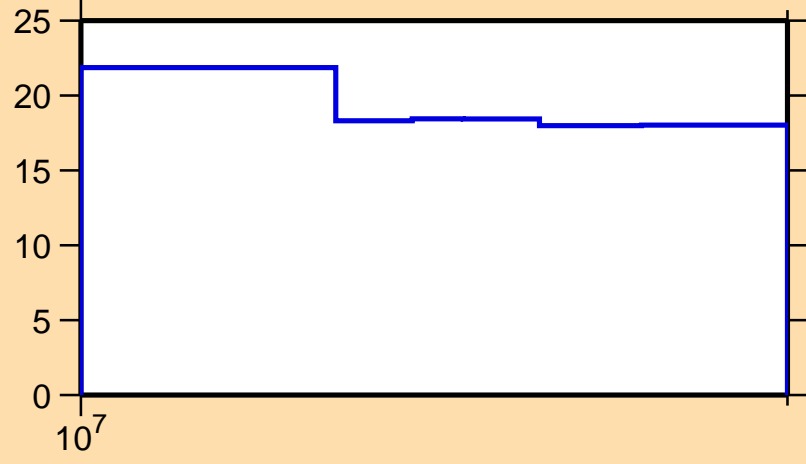

Correlation Matrix

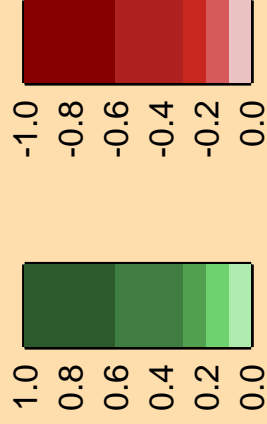


$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,3n)$

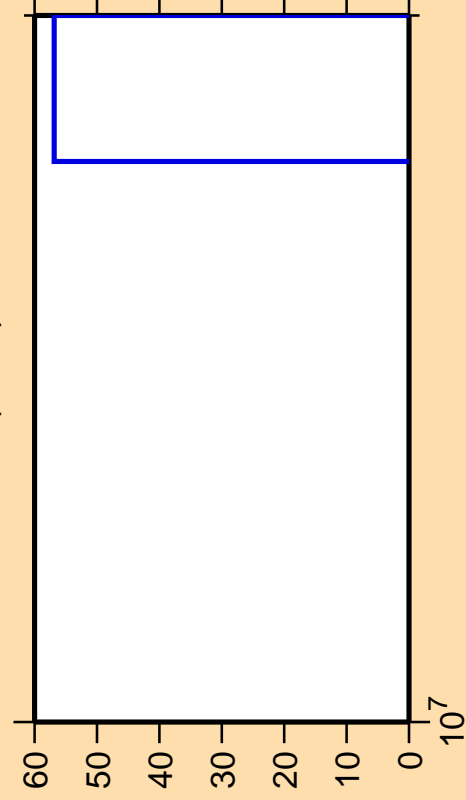

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


σ vs. E for $^{62}\text{Ni}(n,3n)$



Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,n\alpha)$

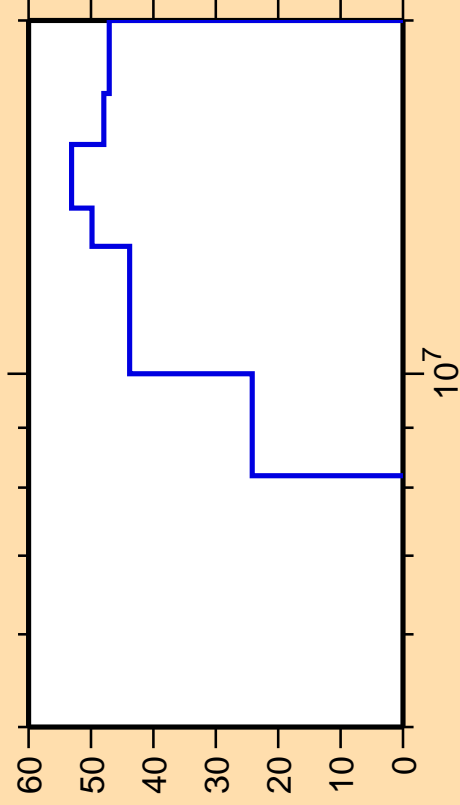


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


σ vs. E for $^{62}\text{Ni}(n,n\alpha)$

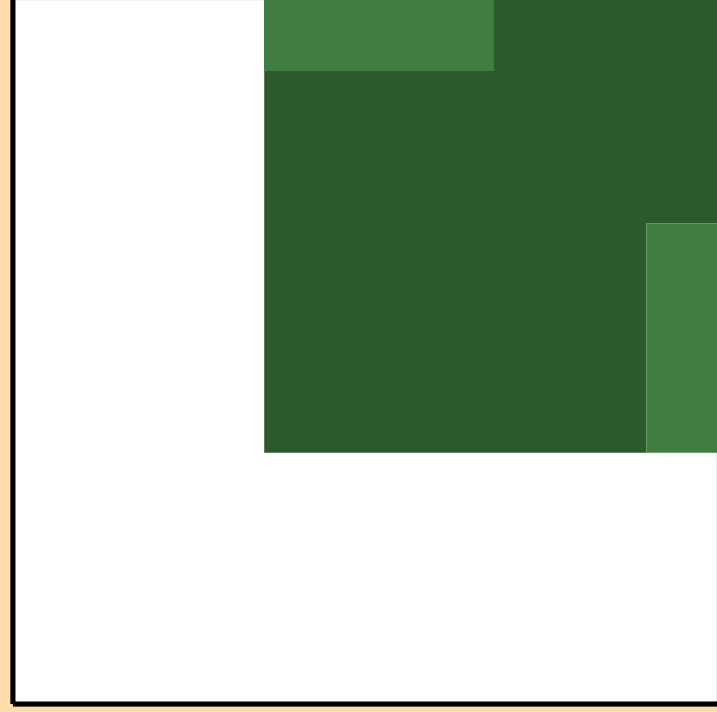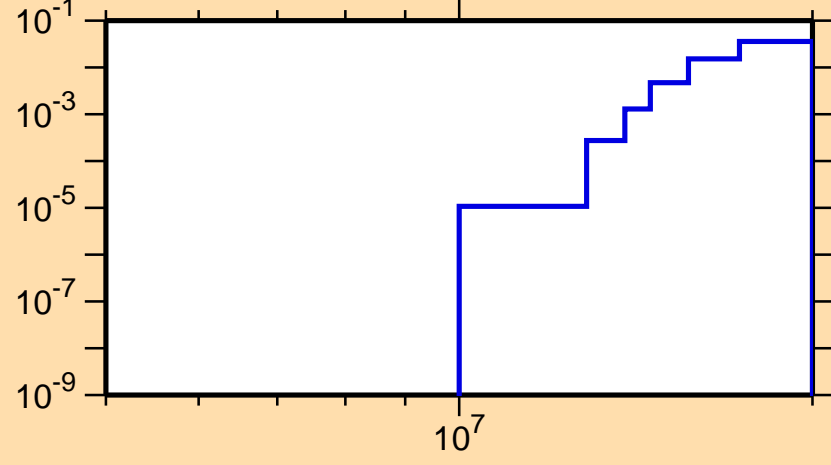

Correlation Matrix

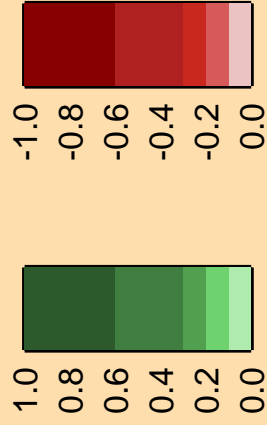


$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,np)$

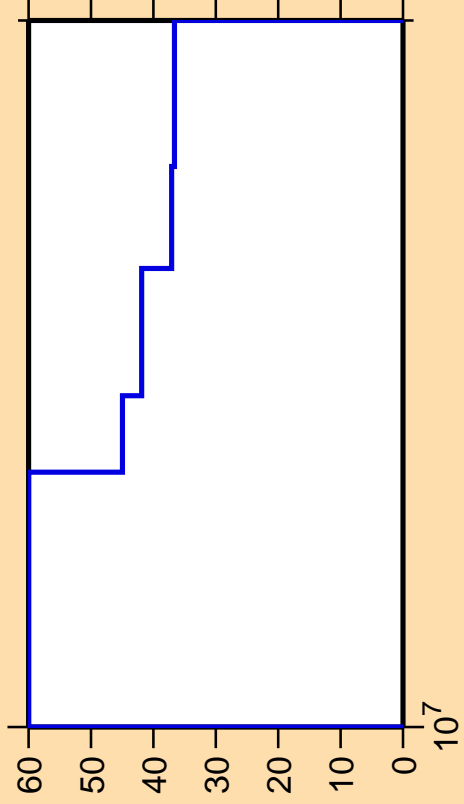


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.




Correlation Matrix

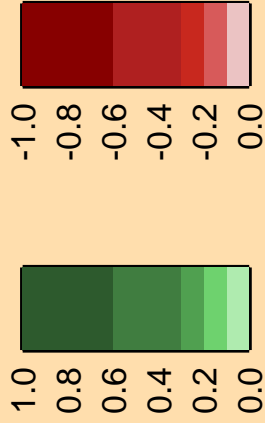

σ vs. E for $^{62}\text{Ni}(n,np)$

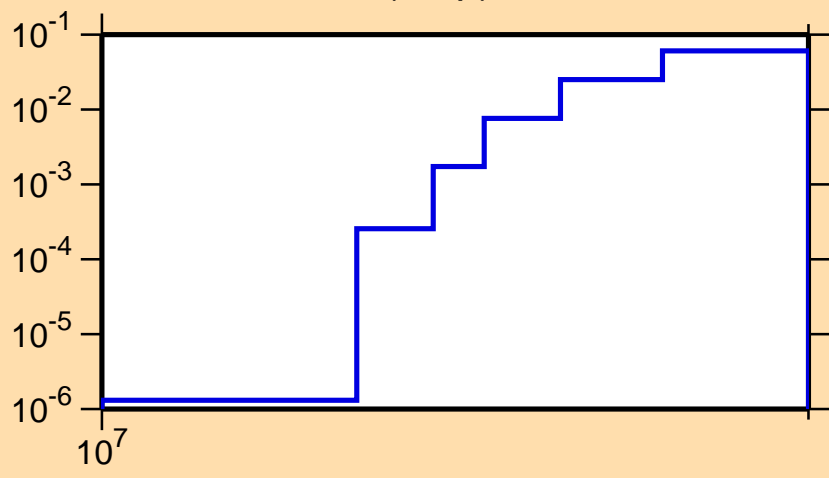

$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,\text{nd})$

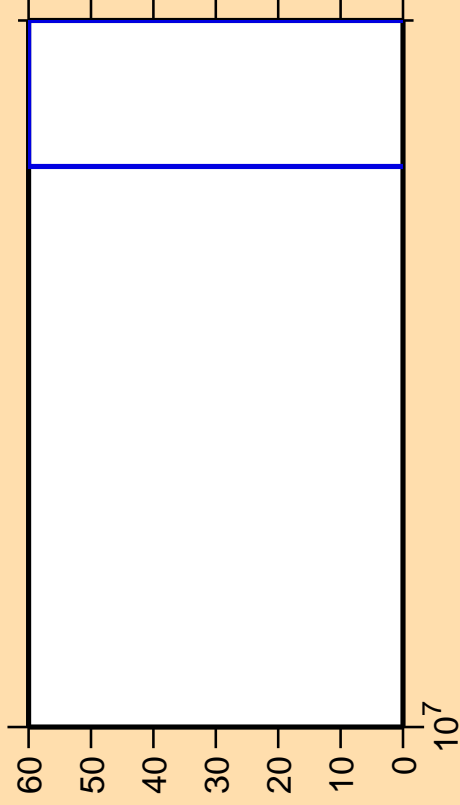

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

σ vs. E for $^{62}\text{Ni}(n,\text{nd})$




10⁷


* 10⁷



Correlation Matrix

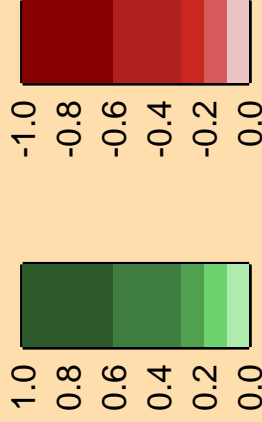



$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,n_1)$

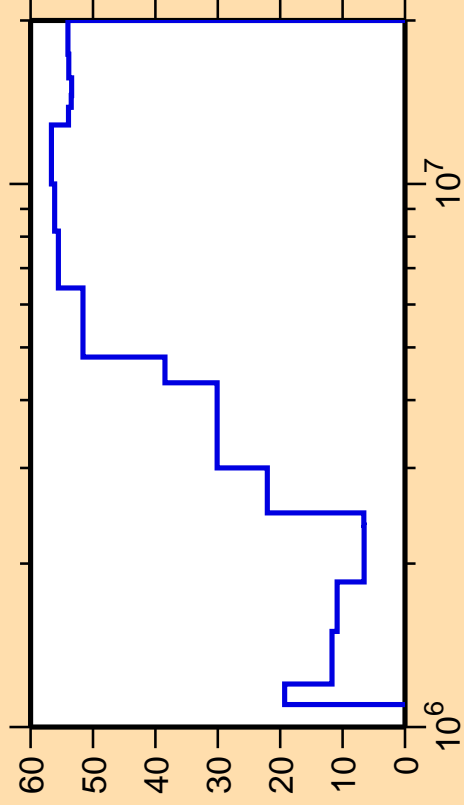


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


σ vs. E for $^{62}\text{Ni}(n,n_1)$

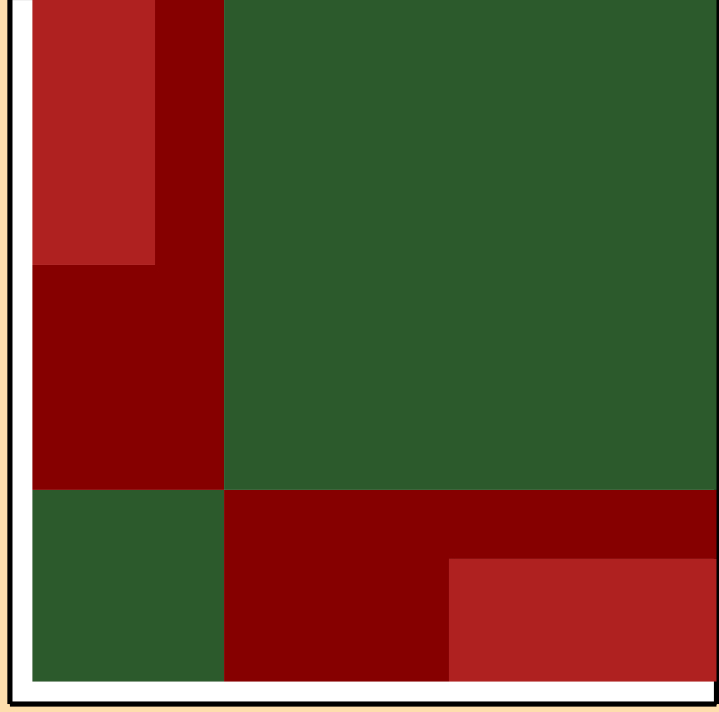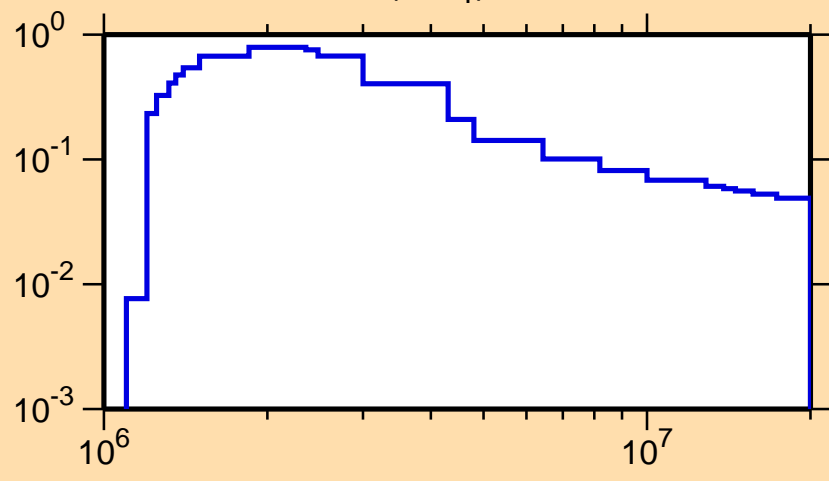

Correlation Matrix

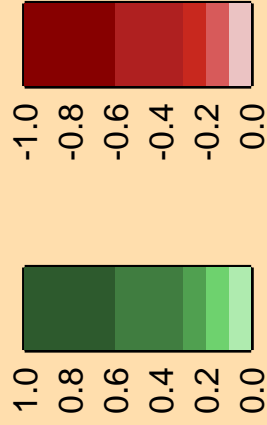



$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,n_{\text{cont}})$.

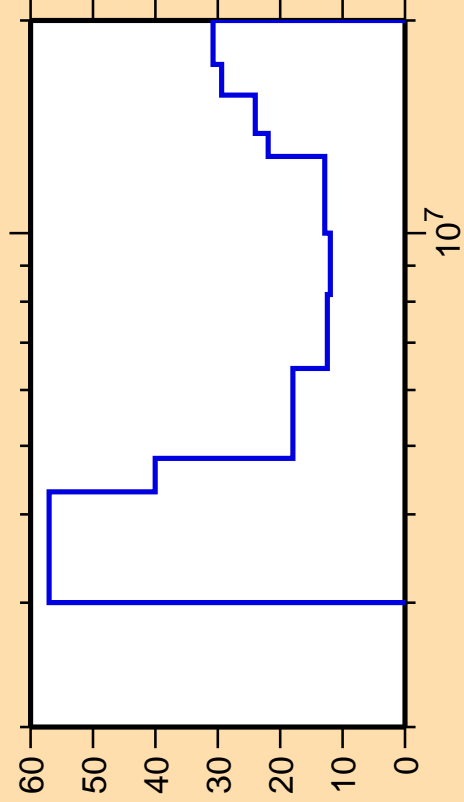


Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,n_1)$

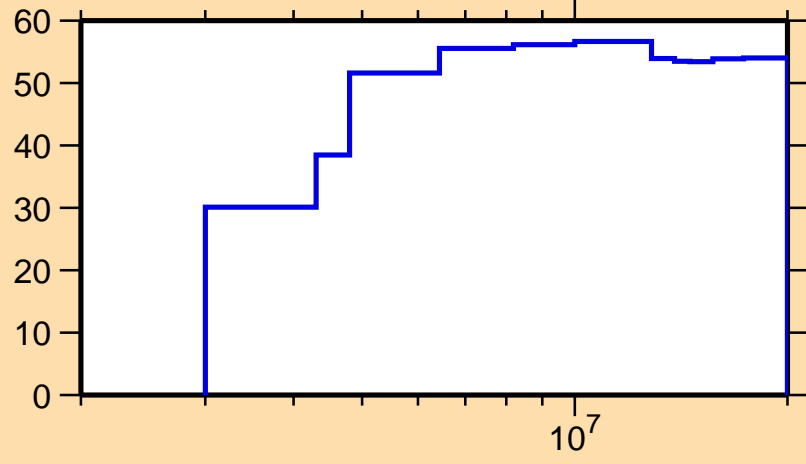

Correlation Matrix

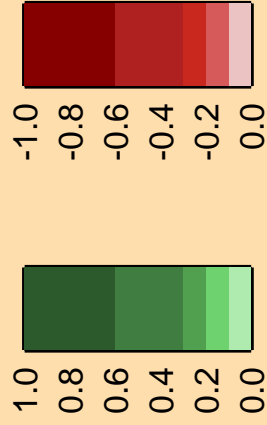

$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,\gamma)$

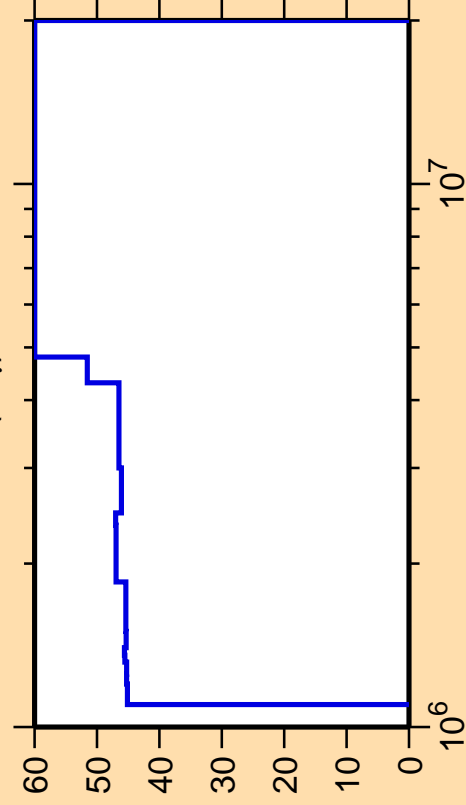


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.


$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,n_1)$

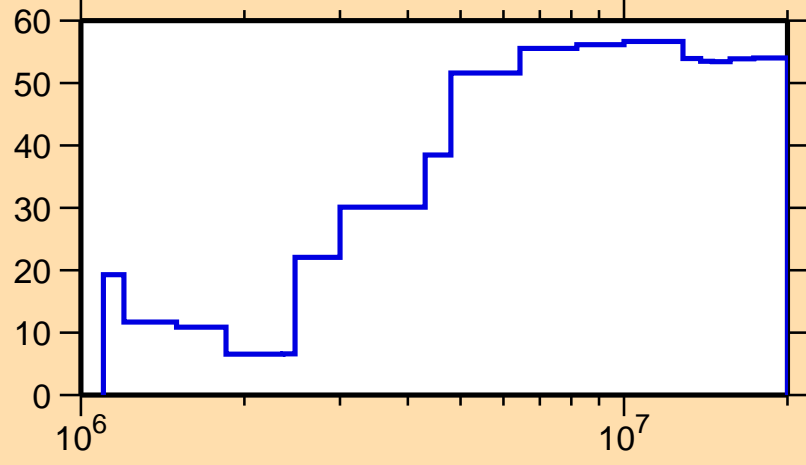

Correlation Matrix

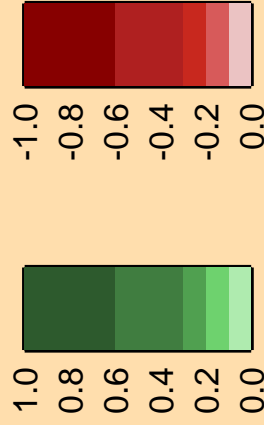



$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,p)$

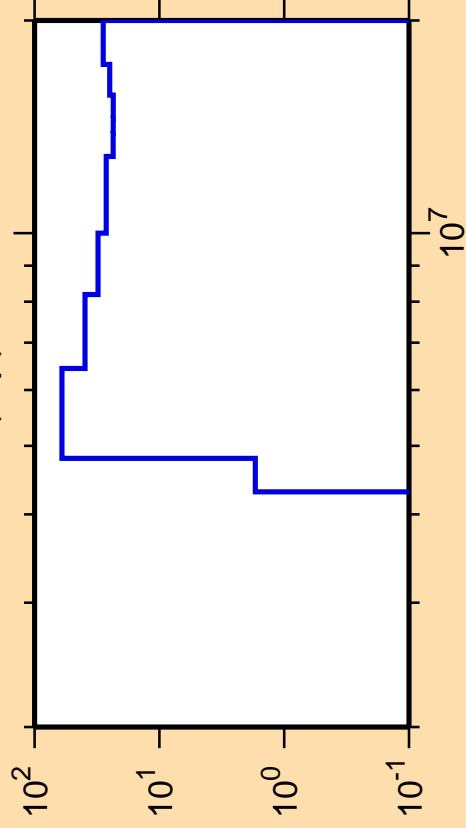


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,n_1)$

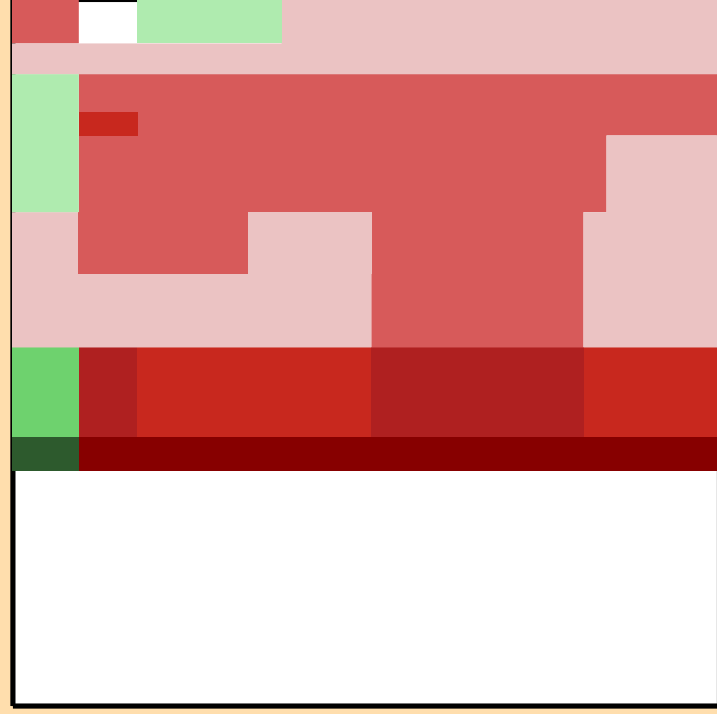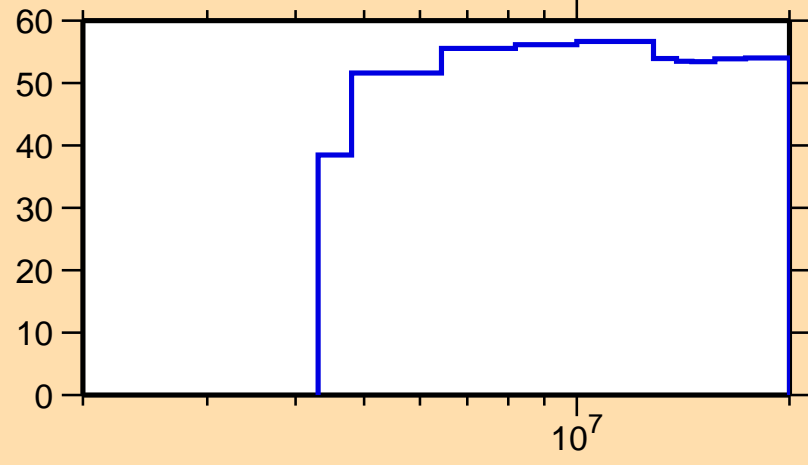

Correlation Matrix


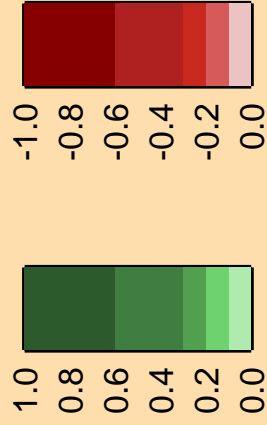


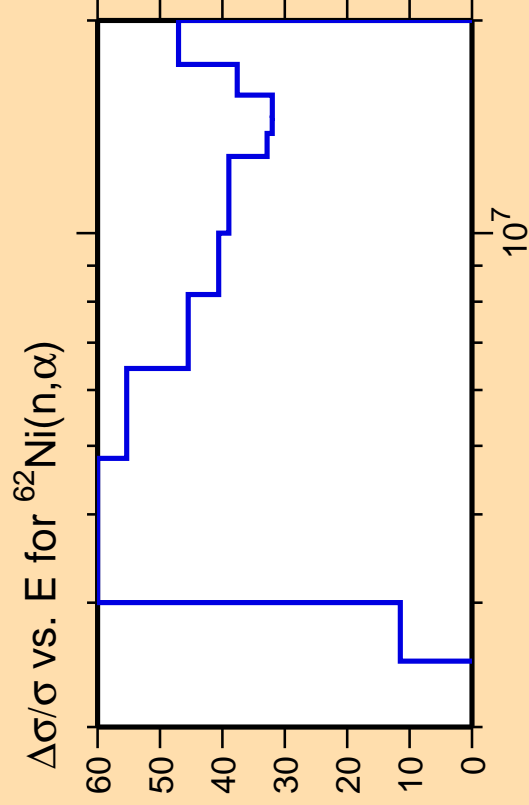


Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.

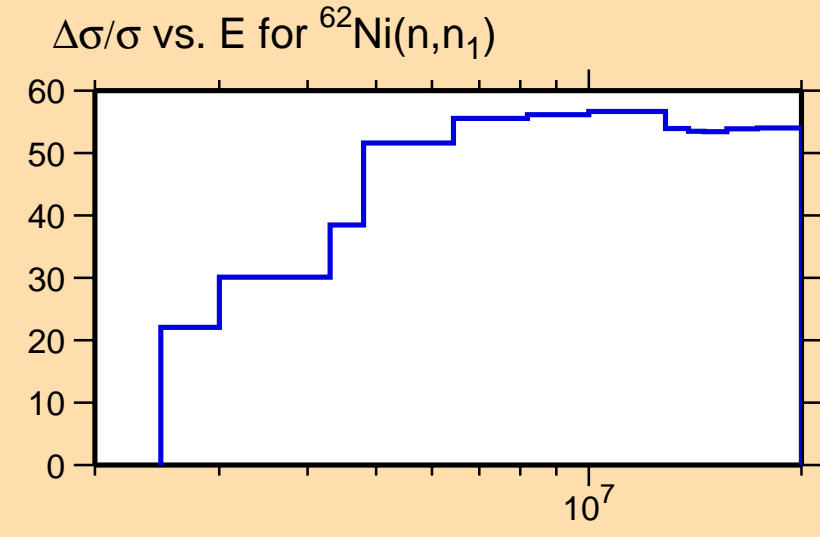

Correlation Matrix


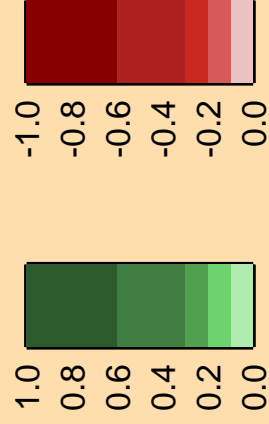


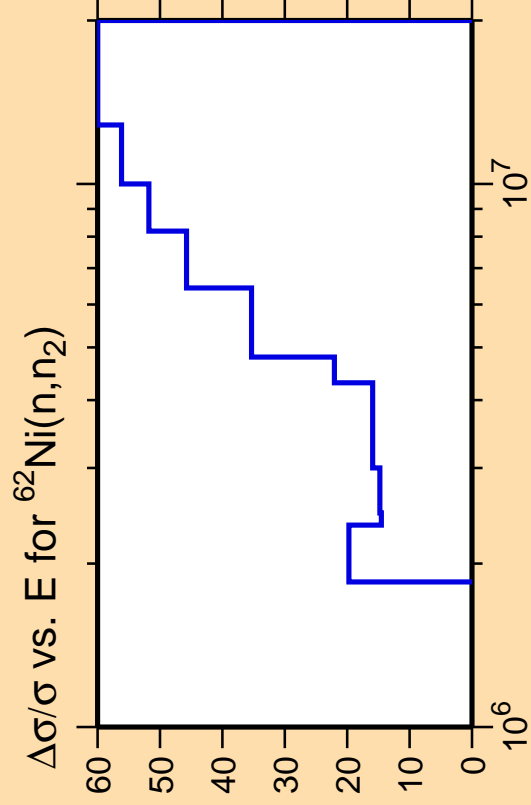

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

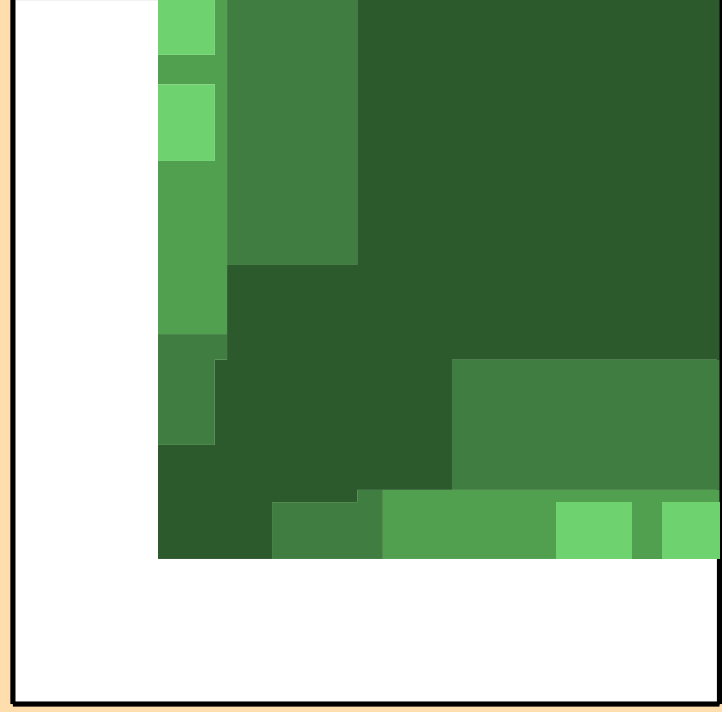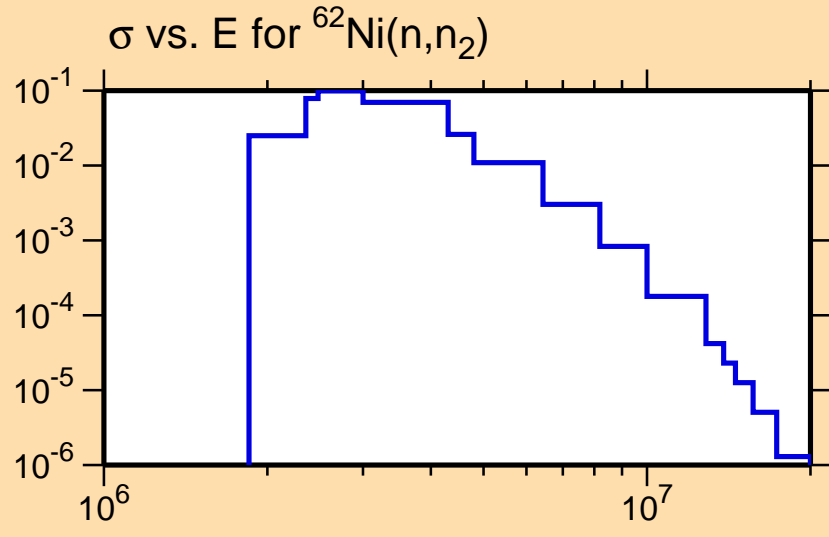

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,n_3)$

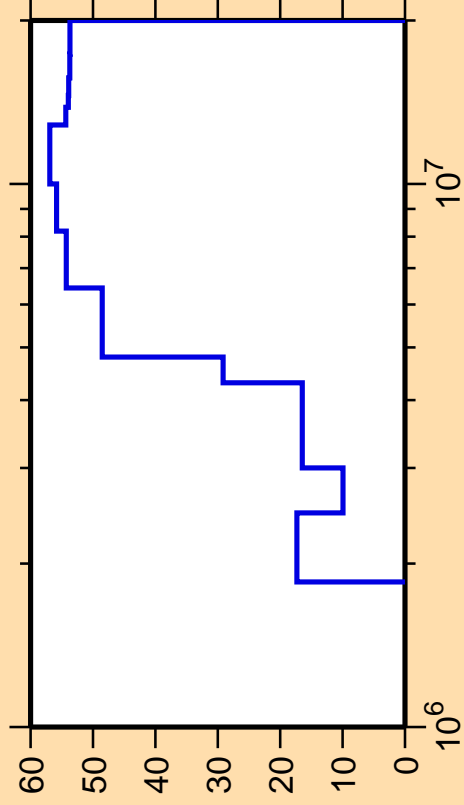


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


σ vs. E for $^{62}\text{Ni}(n,n_3)$

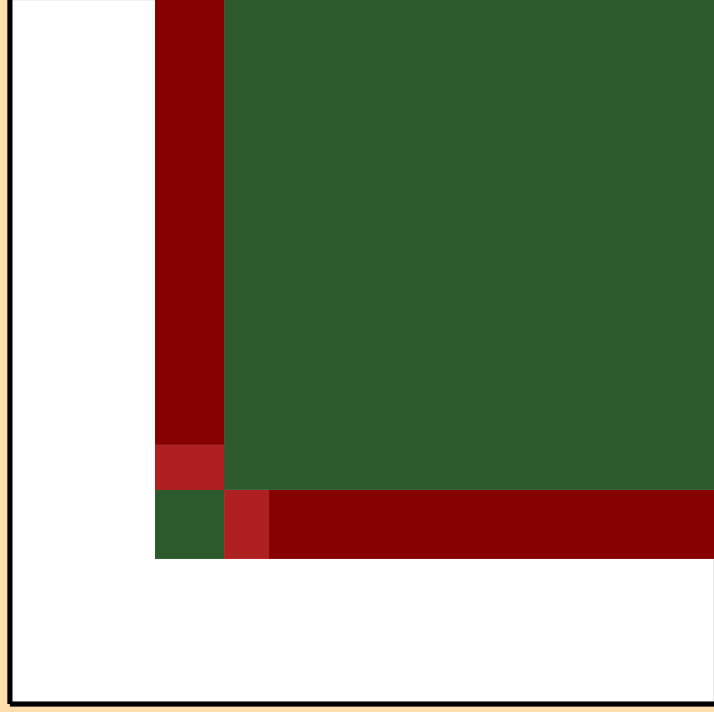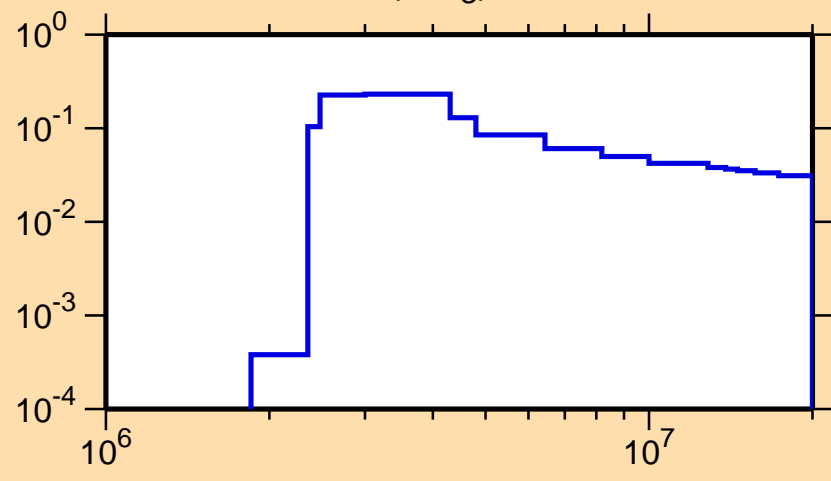

Correlation Matrix

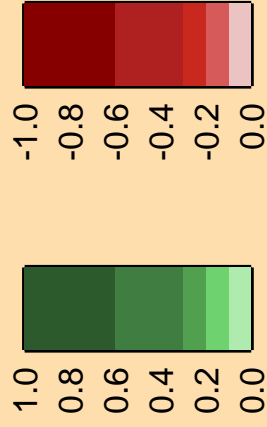



$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,n_4)$

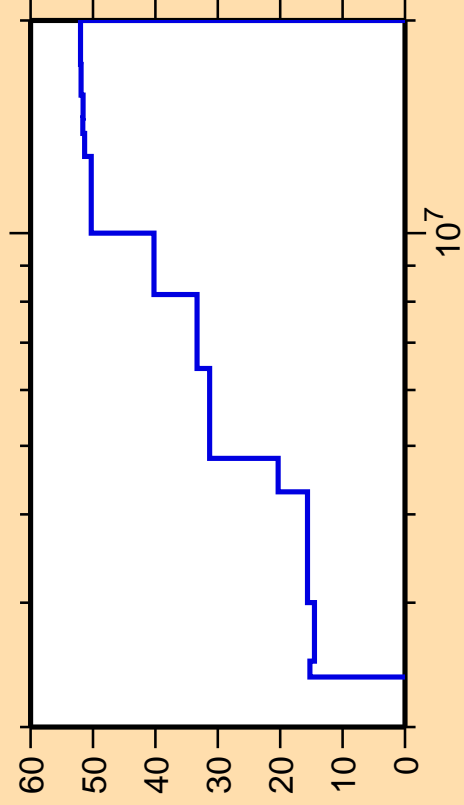


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


σ vs. E for $^{62}\text{Ni}(n,n_4)$

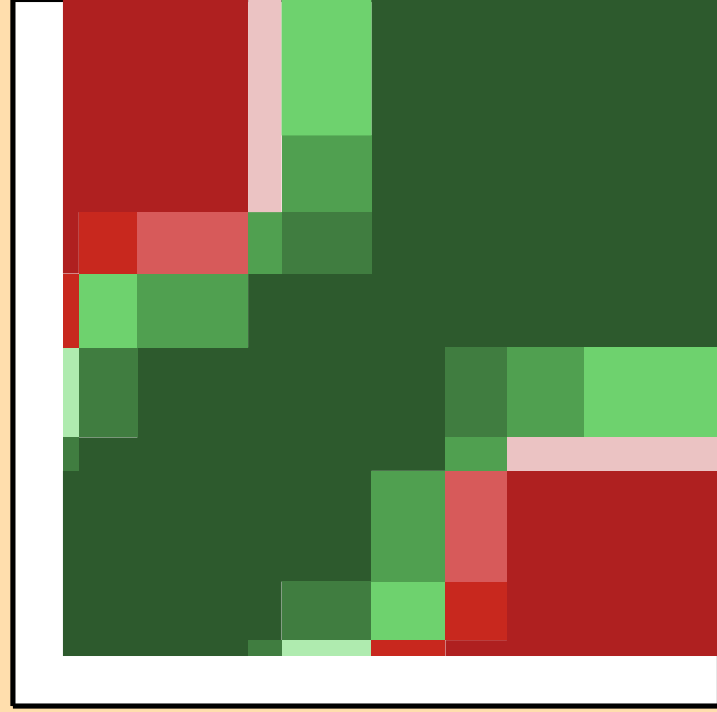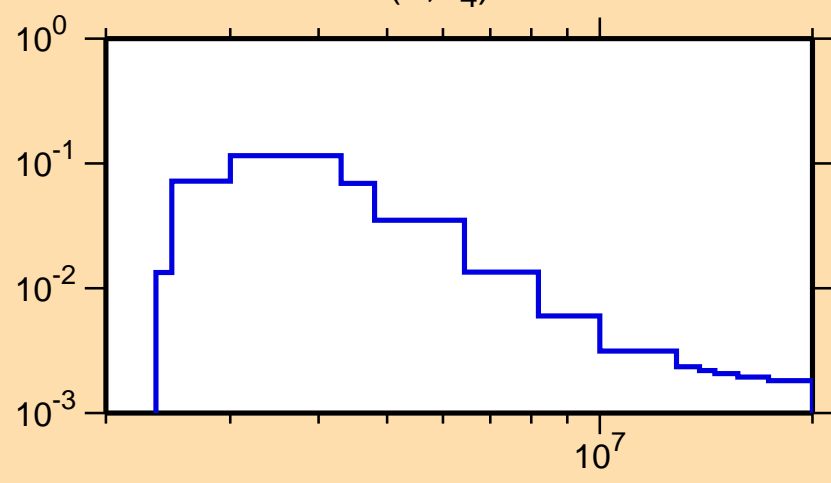

Correlation Matrix

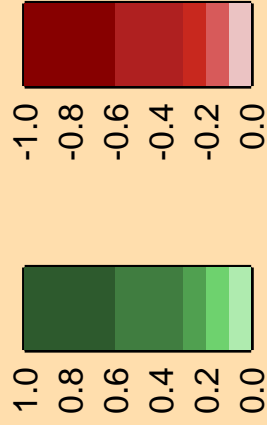



$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,n\text{cont.})$

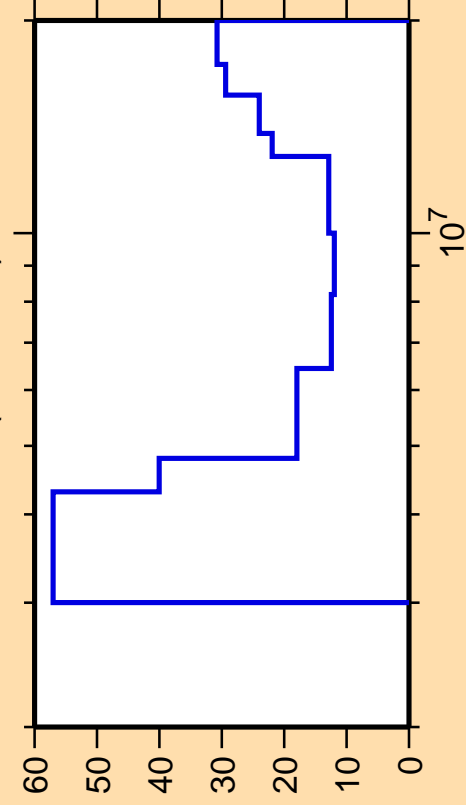


Ordinate scales are % relative standard deviation and barns.





Abscissa scales are energy (eV).




σ vs. E for $^{62}\text{Ni}(n,n\text{cont.})$

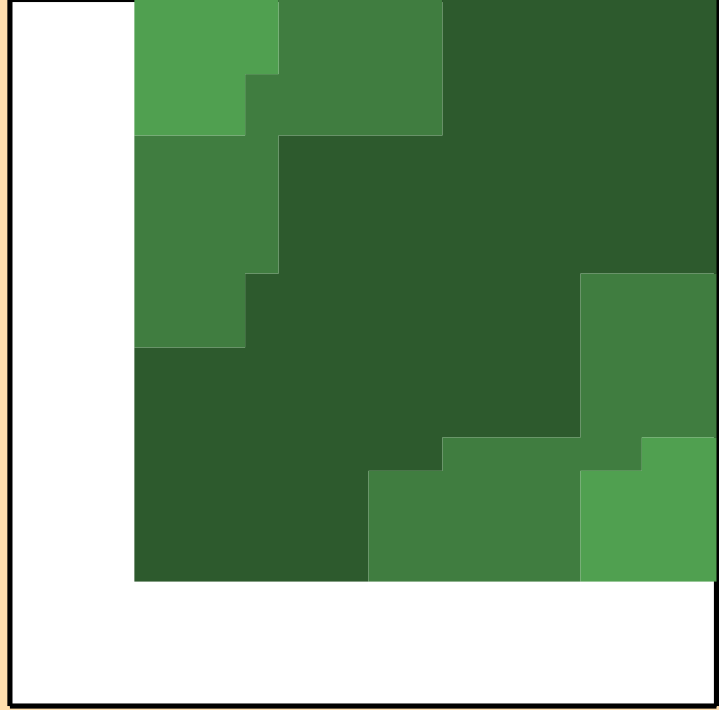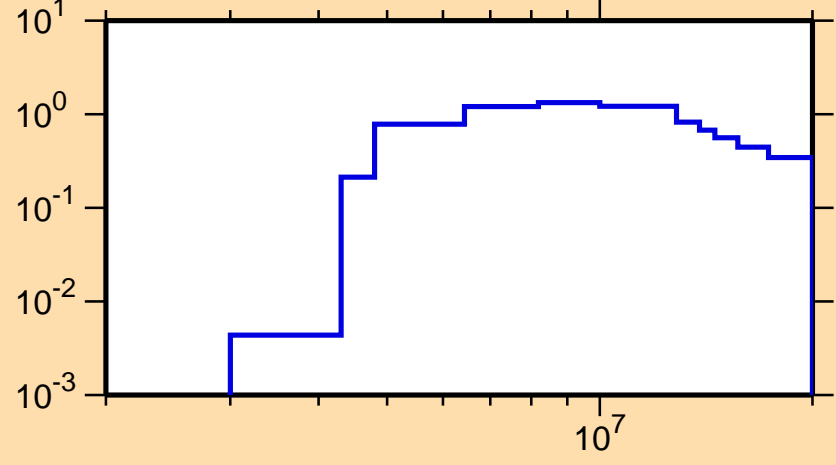


Correlation Matrix

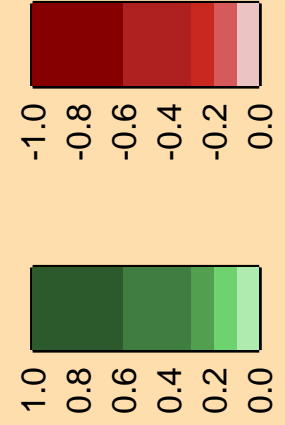


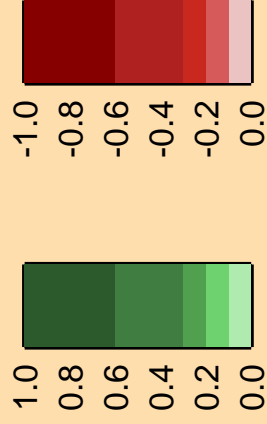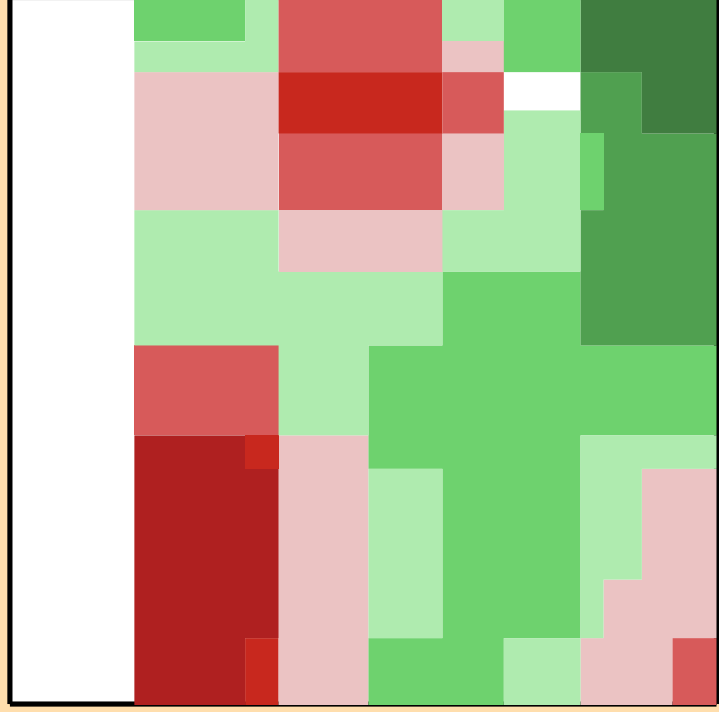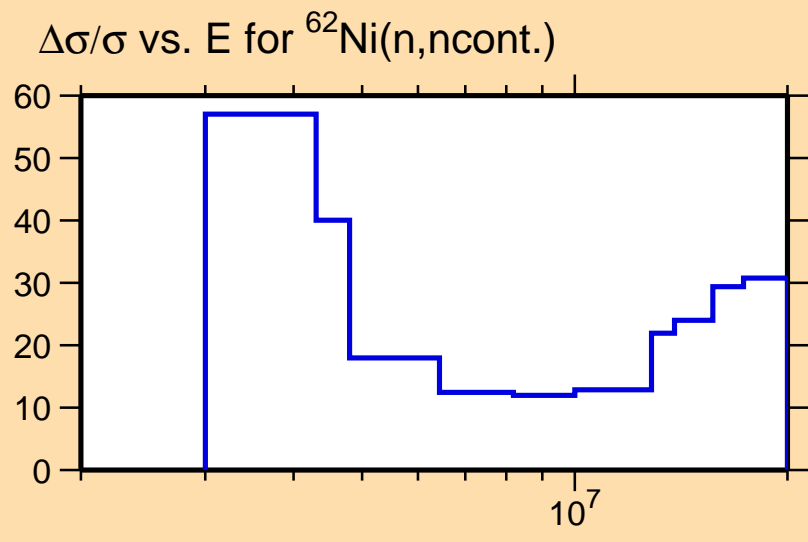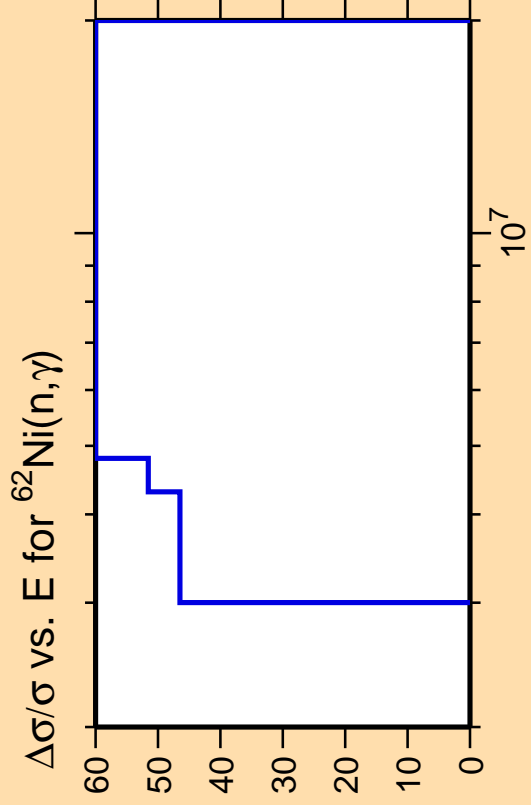

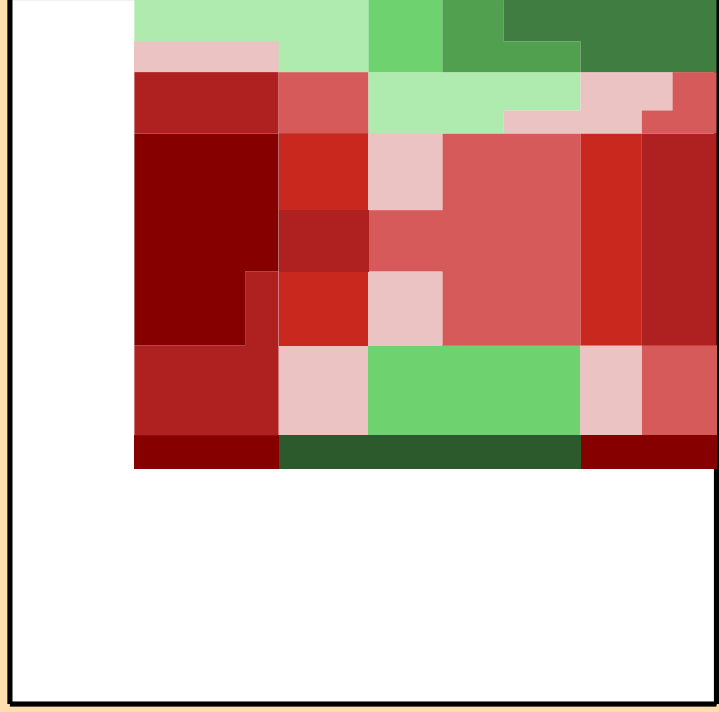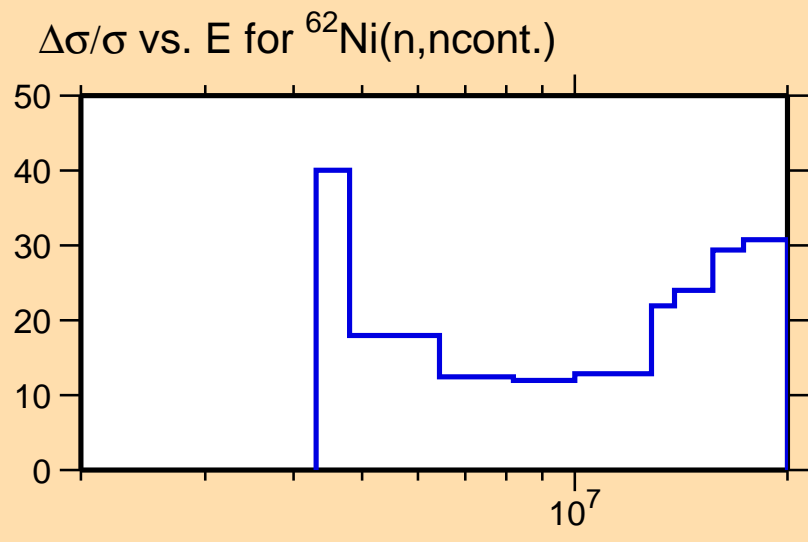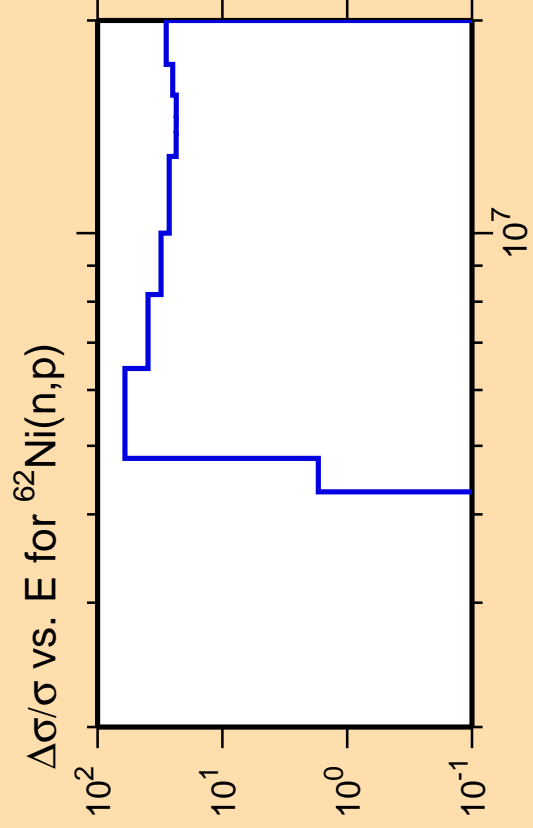

Correlation Matrix


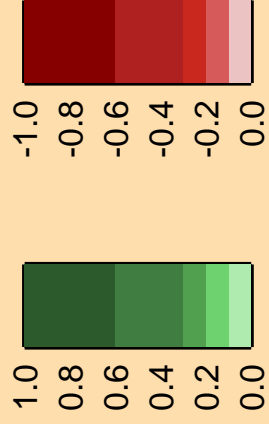


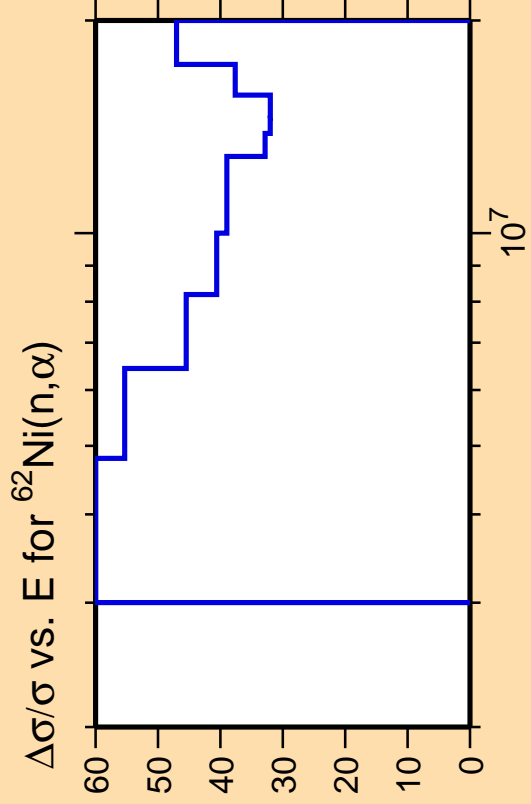

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

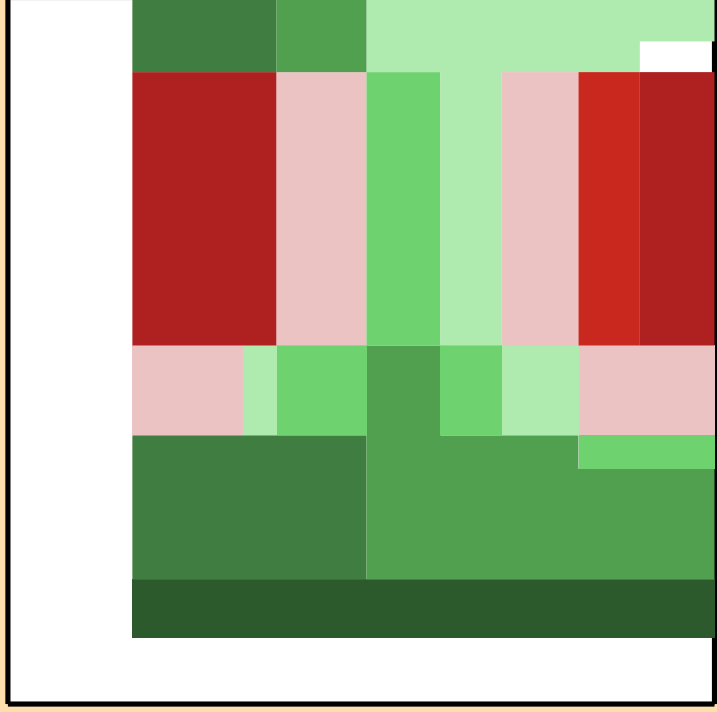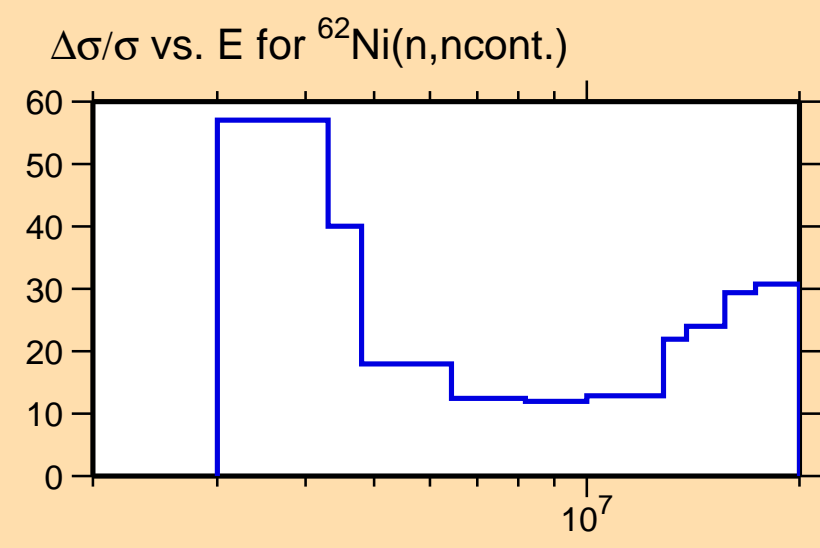

Correlation Matrix




$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,\gamma)$

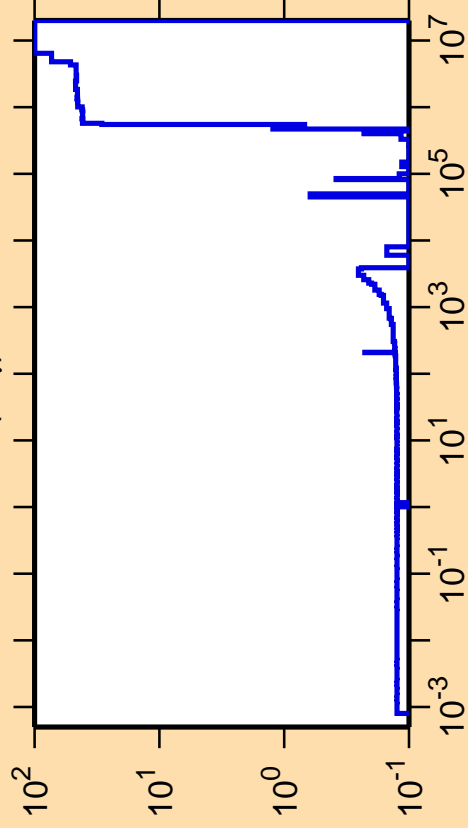

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

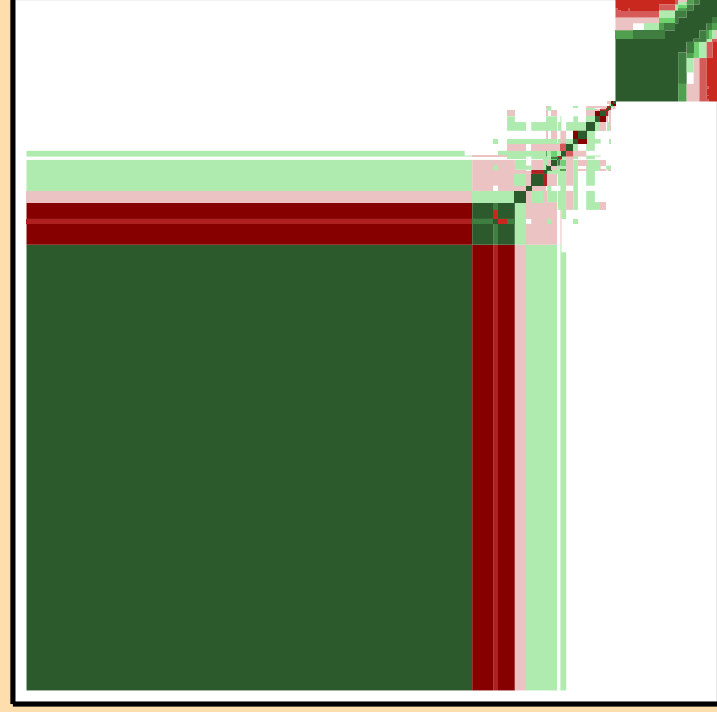


Correlation Matrix



σ vs. E for $^{62}\text{Ni}(n,\gamma)$

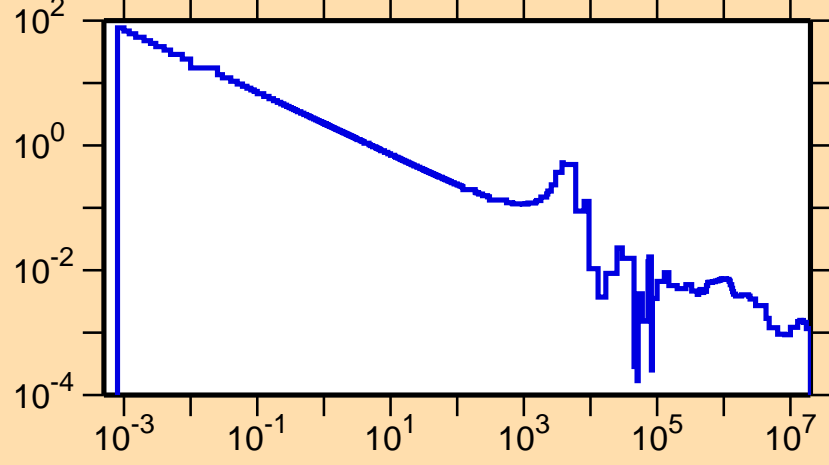


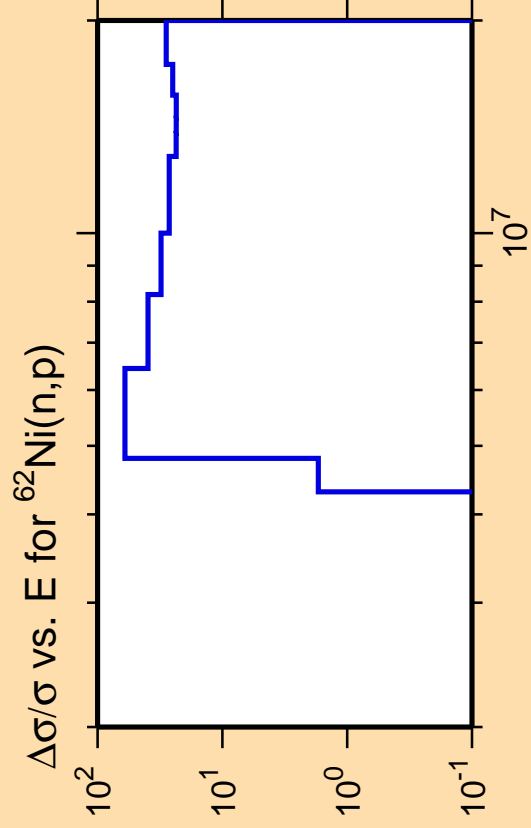

Ordinate scale is %
relative standard deviation.


Abscissa scales are energy (eV).

Warning: some uncertainty
data were suppressed.

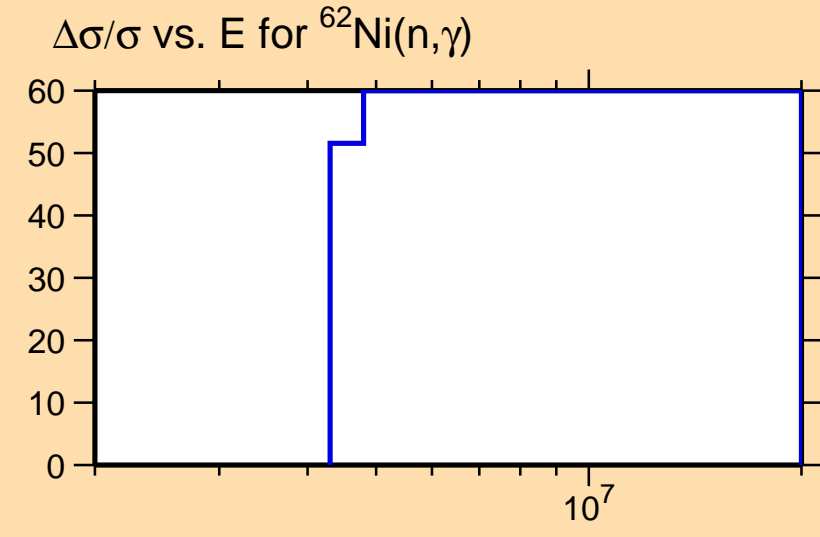

Correlation Matrix





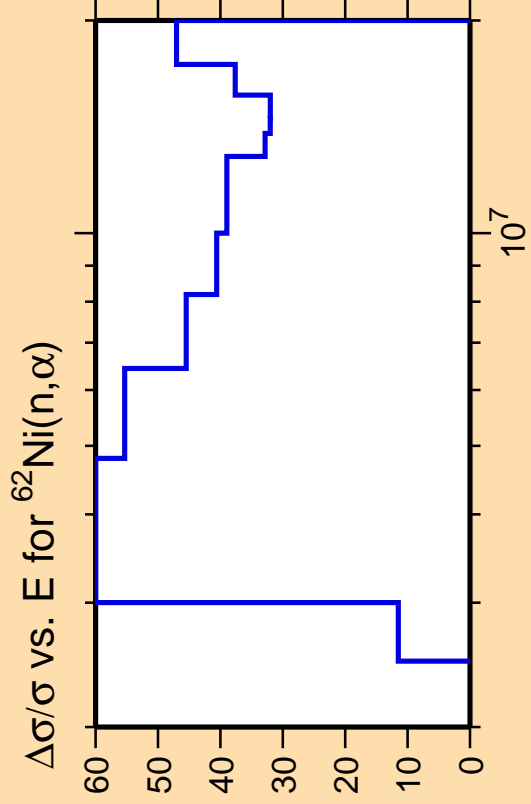

Ordinate scale is %
relative standard deviation.

Abscissa scales are energy (eV).


Warning: some uncertainty
data were suppressed.

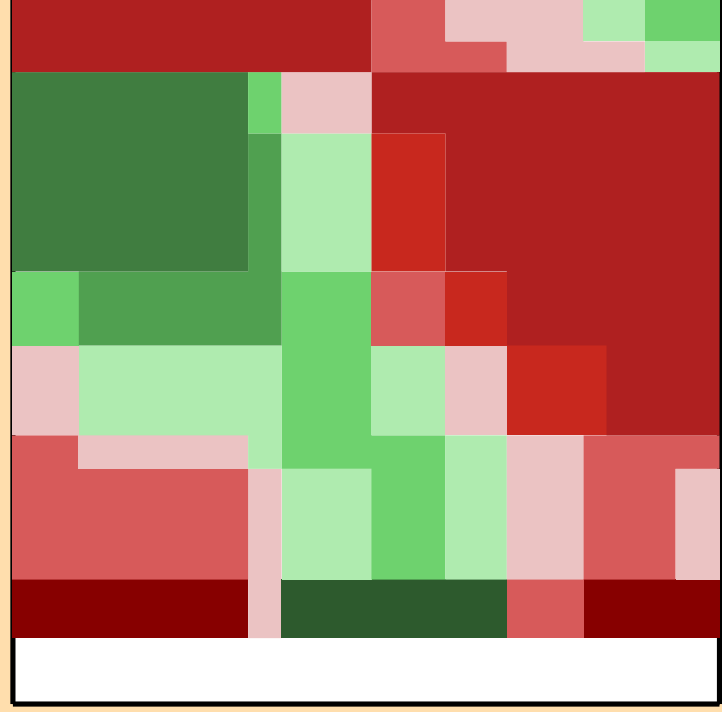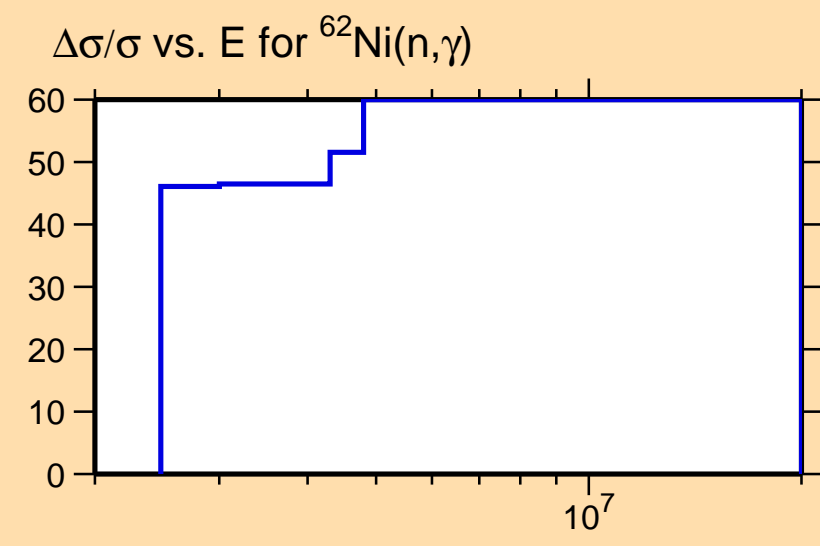

Correlation Matrix





$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,p)$

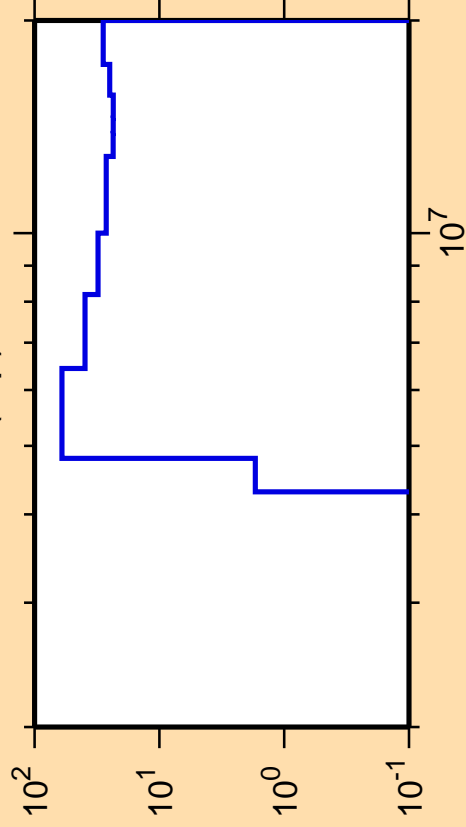


Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

σ vs. E for $^{62}\text{Ni}(n,p)$

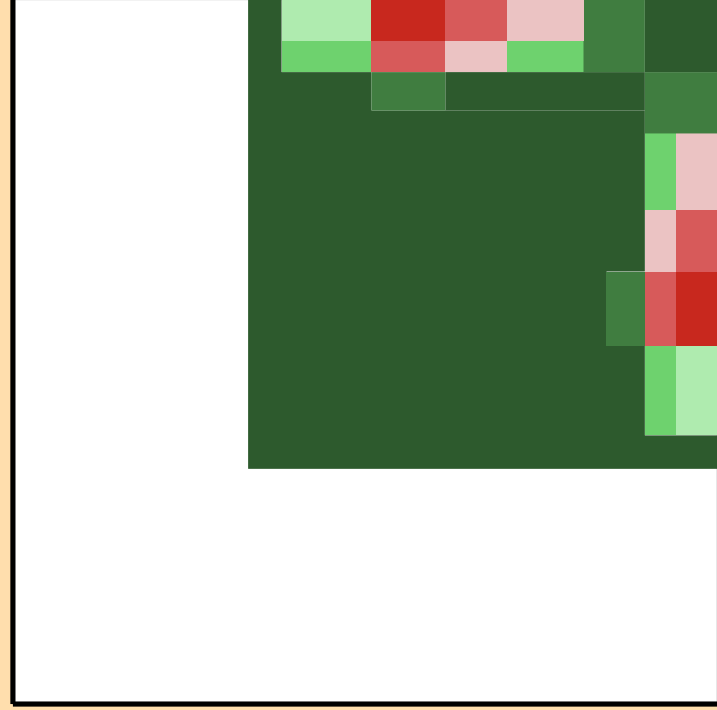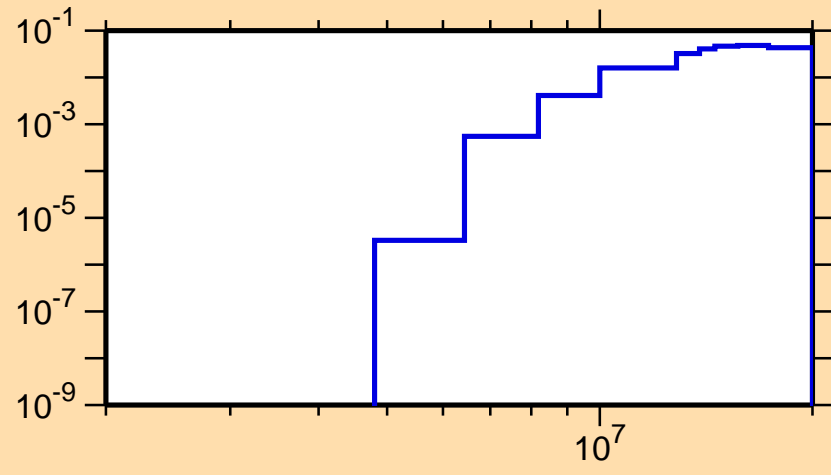

Correlation Matrix


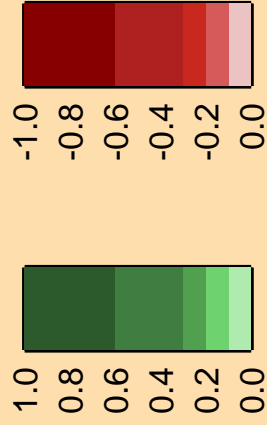


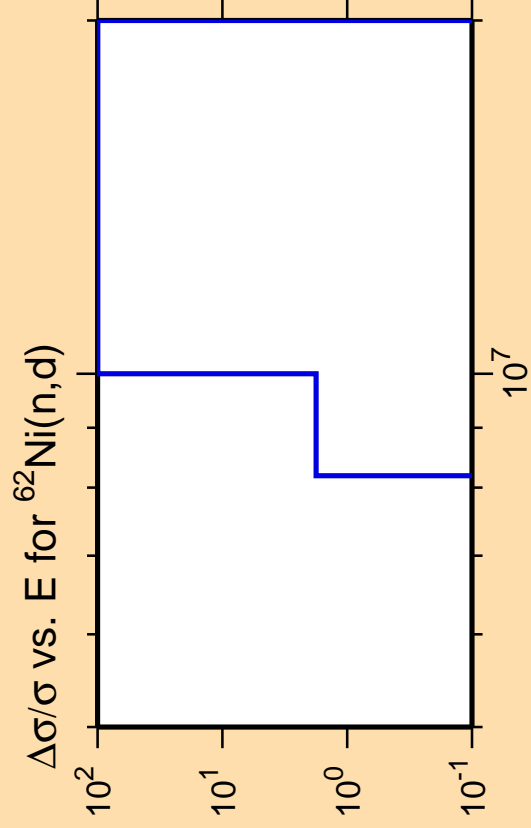


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

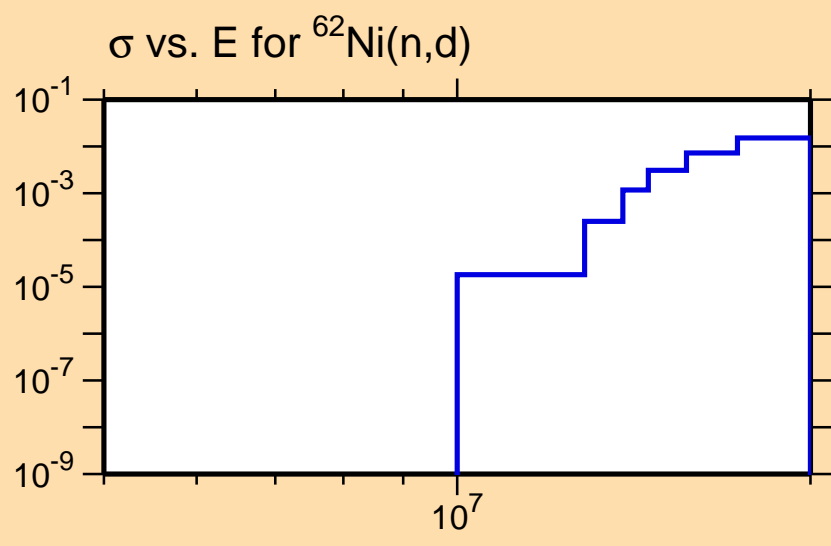

Correlation Matrix

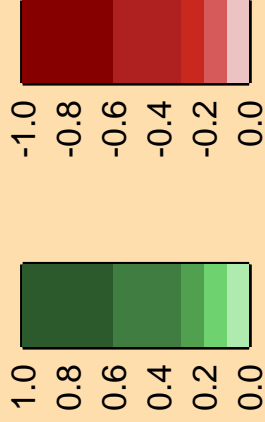

$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,t)$

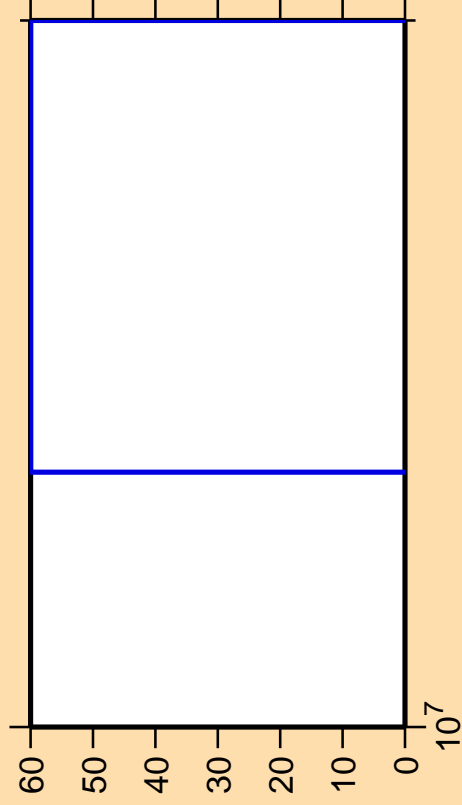


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

σ vs. E for $^{62}\text{Ni}(n,t)$

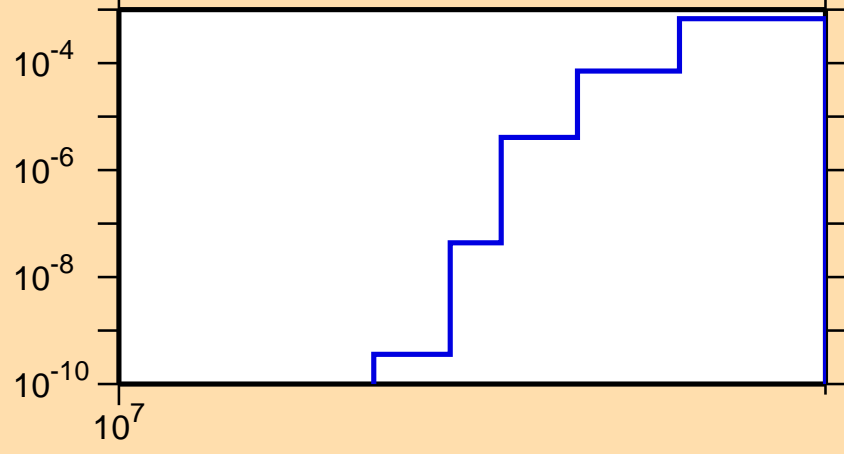

10^7


10^{-10}

10^{-8}

10^{-6}

10^{-4}


Correlation Matrix

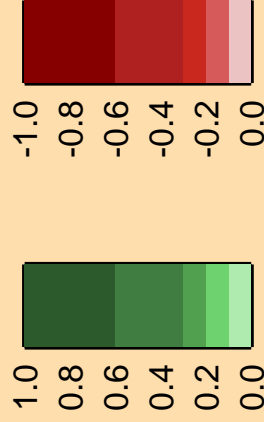

1.0
0.8
0.6
0.4
0.2
0.0

-1.0
-0.8
-0.6
-0.4
-0.2
0.0

$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,\text{He}3)$

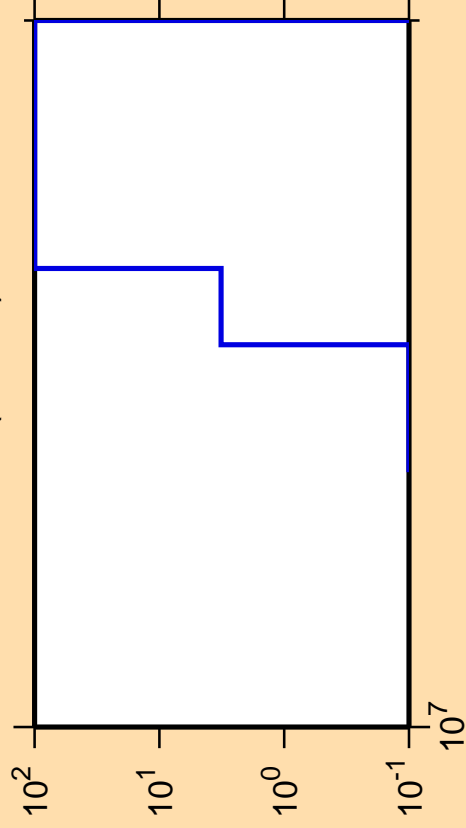


Ordinate scales are % relative standard deviation and barns.


Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.


σ vs. E for $^{62}\text{Ni}(n,\text{He}3)$

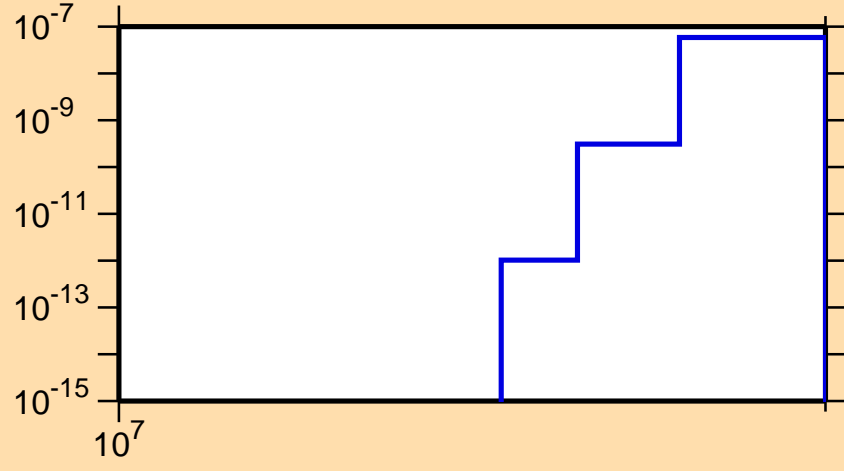


10^7



Correlation Matrix


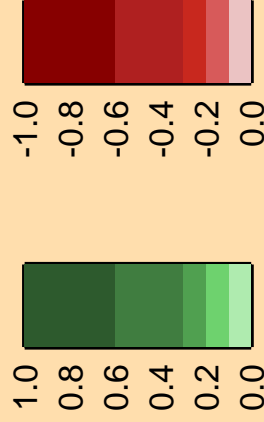


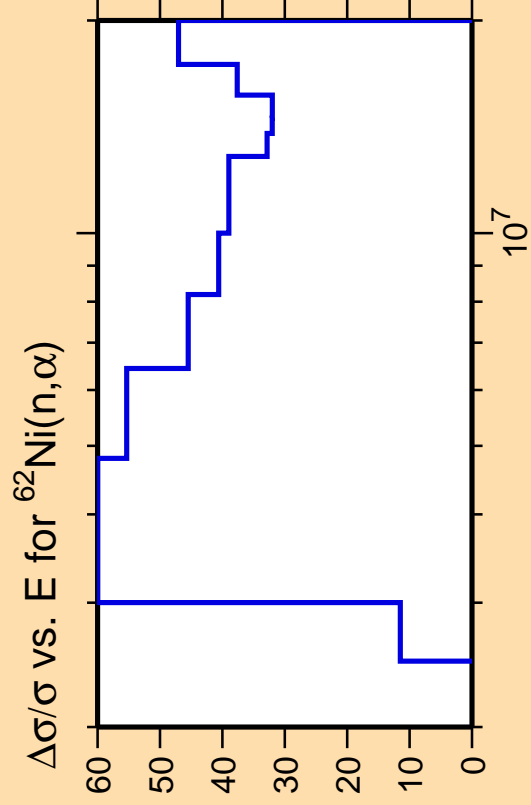

Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).


Warning: some uncertainty data were suppressed.

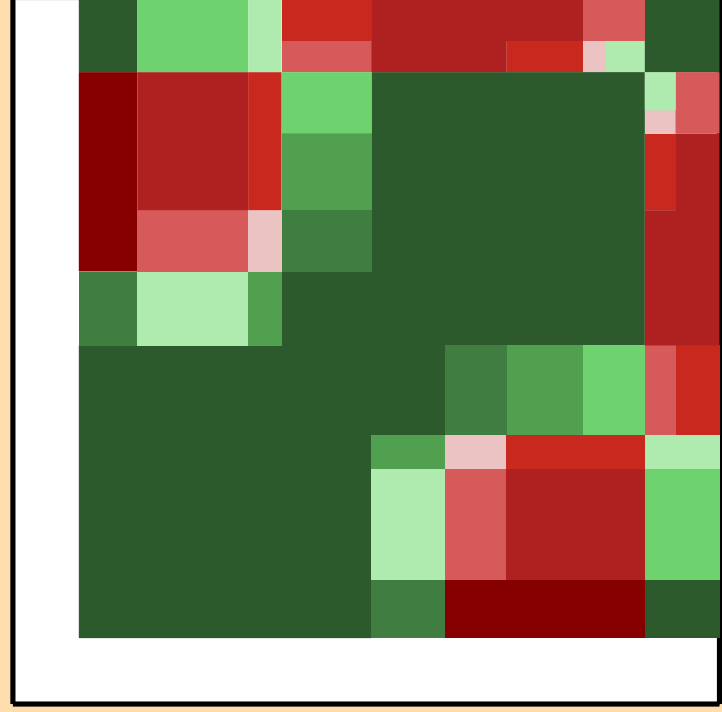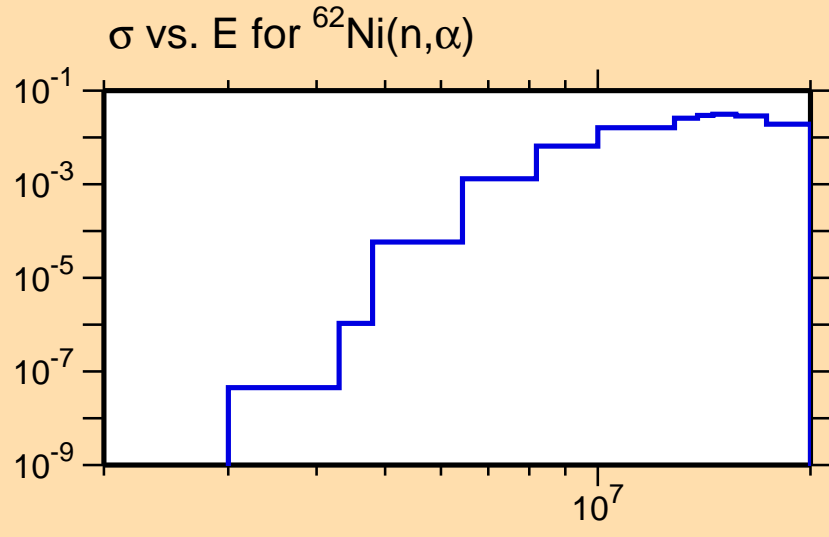

Correlation Matrix



$\Delta\sigma/\sigma$ vs. E for $^{62}\text{Ni}(n,p\alpha)$

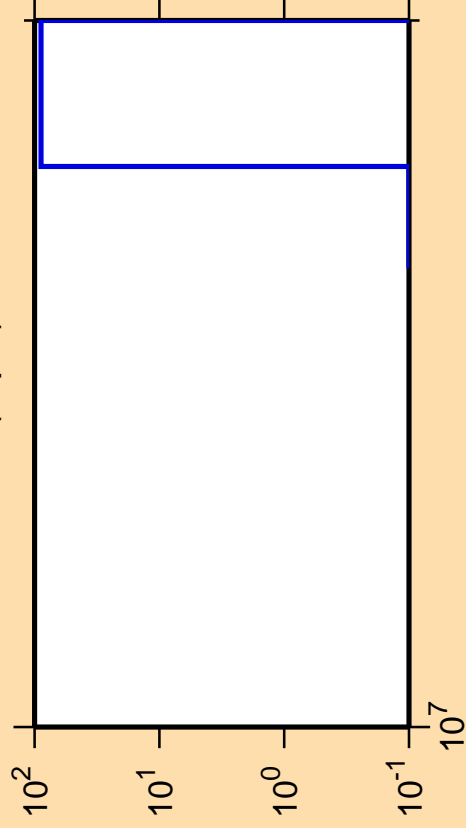


Ordinate scales are % relative standard deviation and barns.

Abscissa scales are energy (eV).

Warning: some uncertainty data were suppressed.

σ vs. E for $^{62}\text{Ni}(n,p\alpha)$

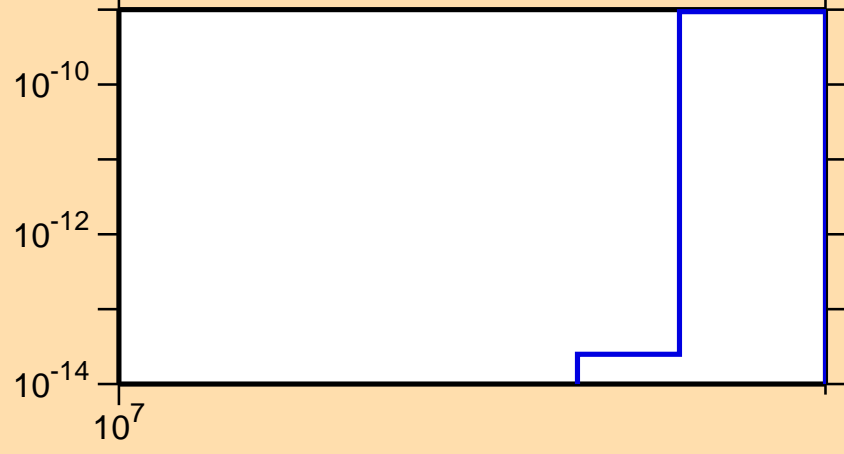


10^7

10^{-14}

10^{-12}

10^{-10}

Correlation Matrix

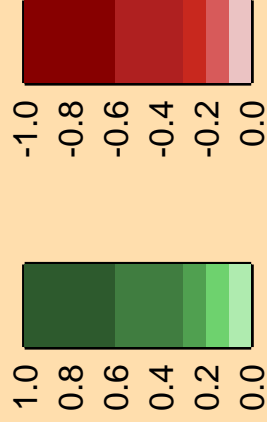

1.0

0.8

0.6

0.4

0.2

0.0

-1.0

-0.8

-0.6

-0.4

-0.2

0.0